



TETRA TECH

Mackenzie Valley Highway Sahtu South Segment Hydrotechnical Assessments GNWT Service Contract SC-5132



PRESENTED TO
**Government of the Northwest Territories
Department of Infrastructure**

MAY 26, 2022
ISSUED FOR USE
FILE: 704-ENG.WTRI03067-01

This page intentionally left blank.

EXECUTIVE SUMMARY

Tetra Tech Canada Inc. (Tetra Tech), as a subconsultant to Stantec Architecture Limited for K'alo-Stantec Limited (Stantec), was retained by the Government of the Northwest Territories (GNWT) to provide fish habitat and hydrotechnical assessments along a segment of the proposed Mackenzie Valley Highway (MVH) in the southern portion of the Sahtu Lands Administration Region (Sahtu South Segment). The assessed segment is approximately 150 km long, starting at the southern Sahtu border and extending north to Prohibition Creek. This work was done under a Standing Offer Agreement with the GNWT.

The alignment for the proposed MVH largely follows an existing winter road which has bridges at major watercourse crossings. The scope of work excludes the major crossings with existing bridges which have been evaluated previously.

The results of the fish habitat and hydrotechnical assessment are provided in separate discipline-specific reports. This report presents the hydrotechnical results.

Field Investigation

Twelve days of site investigation were completed from September 30 through October 11th, 2021, by two Tetra Tech field staff, accompanied by a wildlife monitor based out of Tulita, using helicopter services based in Norman Wells to access the sites. Approximately 40 predefined watercourses of potential interest were observed from the air to evaluate whether the watercourses were substantial enough to warrant a ground inspection. Ground inspections were made at 27 of these watercourses to measure flow rates, assess channel geometry and channel substrate, and to document other watercourse characteristics potentially pertinent to the design of appropriate drainage infrastructure.

Hydrologic Analysis

A hydrologic analysis was undertaken to estimate peak flows for various return periods. The methodology utilized a regional hydrologic approach to transpose flow quantiles of historical flow data for Water Survey of Canada (WSC) gauged watercourses in the study area vicinity to subject watercourses of interest.

Hydraulic Analysis and Crossing Structure Recommendations

Preliminary crossing structure recommendations are made for 27 crossing locations. Sizing assumed non-embedded circular corrugated culverts with inlet flow control at projecting inlets and a 100-year flow maximum allowable headwater elevation equal to the top of culvert. Recommended sizes range from a nominal minimum diameter of 800 millimetres (mm) to a maximum diameter of 3050 mm.

The sizing assumptions do not consider fish passage requirements and the preliminary sizes may therefore not be suitable for fish bearing streams. Alternative designs such as bridges or large arch culverts that preserve the natural channel hydraulic characteristics through the crossing should be considered for any watercourses subsequently deemed to be fish bearing.

TABLE OF CONTENTS

| | |
|---|-----------|
| EXECUTIVE SUMMARY | 1 |
| 1.0 INTRODUCTION | 1 |
| 2.0 SCOPE OF WORK AND BACKGROUND INFORMATION | 3 |
| 3.0 FIELD INVESTIGATIONS..... | 4 |
| 3.1 Watercourse Selection Methods..... | 5 |
| 3.2 Site Assessment Summary..... | 10 |
| 4.0 HYDROTECHNICAL ANALYSIS..... | 13 |
| 4.1 Watershed Delineation | 13 |
| 4.2 Hydrologic Analysis | 14 |
| 4.2.1 Hydrometric Station Selection | 15 |
| 4.2.2 Statistical Flood Frequency Analysis..... | 16 |
| 4.2.3 Regional Hydrological Analysis | 17 |
| 4.2.4 Lake Attenuation..... | 19 |
| 4.2.5 Climate Change Effects..... | 20 |
| 4.2.6 Watercourse Crossing Flood Flow Estimates..... | 21 |
| 4.2.7 Fish Passage Design Flows | 22 |
| 4.3 Preliminary Crossing Designs..... | 23 |
| 5.0 CLOSURE | 26 |
| REFERENCES | 27 |

LIST OF TABLES IN TEXT

| | |
|--|----|
| Table 3-1: Site Assessment Summary; UTM Coordinates | 11 |
| Table 4-1: Minor Watercourse Crossing Locations and Watershed Areas | 13 |
| Table 4-2: WSC Regional Stations | 15 |
| Table 4-3: Frequency Analysis Results | 17 |
| Table 4-4: Regional Peak Flow Equation Variables (<5% Lake Coverage) | 18 |
| Table 4-5: Lake Attenuation Factors for WSC Stations with >5% Lake Area | 19 |
| Table 4-6: PCIC Ensemble GCM Winter Mean Daily Precipitation for Sahtu Region..... | 20 |
| Table 4-7: Climate Atlas of Canada Winter Precipitation for Norman Wells | 21 |
| Table 4-8: Return Period Flows for Minor Watercourse Crossings..... | 21 |
| Table 4-9: Preliminary Proposed Culverts for Minor Watercourse Crossings..... | 23 |

LIST OF FIGURES IN TEXT

| | |
|---|----|
| Figure 1-1: Sahtu South Segment Regional Location Plan | 2 |
| Figure 3-1a: Sahtu Watercourse Crossings 1 of 4..... | 6 |
| Figure 3-1b: Sahtu Watercourse Crossings 2 of 4..... | 7 |
| Figure 3-1c: Sahtu Watercourse Crossings 3 of 4..... | 8 |
| Figure 3-1d: Watercourse Crossings 4 of 4 | 9 |
| Figure 4-3: Peak Flow Frequency Distribution for Bosworth Creek (10KA007)..... | 16 |
| Figure 4-5: 5-Year Flow vs Watershed Area for WSC Stations < 5% Lake Area | 18 |

APPENDIX SECTIONS

| | |
|------------|---|
| Appendix A | Tetra Tech's Limitations on the Use of this |
| Appendix B | Document Sahtu South Segment Field Photos |
| Appendix C | Minor Watercourse Drainage Basins |

LIMITATIONS OF REPORT

This report and its contents are intended for the sole use of the Government of the Northwest Territories and their agents. Tetra Tech Canada Inc. (Tetra Tech) does not accept any responsibility for the accuracy of any of the data, the analysis, or the recommendations contained or referenced in the report when the report is used or relied upon by any Party other than Government of the Northwest Territories, or for any Project other than the proposed development at the subject site. Any such unauthorized use of this report is at the sole risk of the user. Use of this document is subject to the Limitations on the Use of this Document attached in the Appendix A or Contractual Terms and Conditions executed by both parties.

ACRONYMS & ABBREVIATIONS

| Acronyms/Abbreviations | Definition |
|------------------------|---|
| % | percent |
| ASR | All Season Road |
| AT | Alberta Transportation |
| CSP | Corrugated Steel Pipe |
| DEM | Digital Elevation Model |
| ECCC | Environment and Climate Change Canada |
| ENR-ITI-Lands | Environment and Natural Resources - Industry, Tourism and Investment, and Lands |
| INF | Department of Infrastructure |
| GCM | Global Climate Model |
| GNWT | Government of the Northwest Territories |
| km | kilometre |
| KM | Kilometre marker |
| km ² | Square kilometres |
| LiDAR | Light Detection and Ranging |
| L/s | litres per second |
| m | metre |
| mm | millimetre |
| MVH | Mackenzie Valley Highway |
| MGAR | Mount Gaudet Access Road |
| NTS | National Topographic System (the system used by Natural Resources Canada for providing general purpose topographic maps of the country) |
| NWT | Northwest Territories |
| PCAR | Prohibition Creek Access Road |
| PDR | Project Description Report |
| SPCSP | Structural Plate Corrugated Steel Pipe |
| the Project | the Mackenzie Valley Highway Project |

1.0 INTRODUCTION

Tetra Tech Canada Inc. (Tetra Tech), as a subconsultant to Stantec Architecture Limited for K'alo-Stantec Limited (Stantec), was retained by the Government of the Northwest Territories (GNWT) to provide field and hydrotechnical aspects of fish habitat and hydrotechnical assessments along portions of the proposed Mackenzie Valley Highway (MVH) Project which will upgrade the existing winter road to an All-Season Road (ASR). This work was authorized by multiple Service Contracts under Standing Offer Agreement 4034 with the GNWT.


This report describes hydrotechnical services provided in late 2021 under Service Contract 5132 for an approximately 150-kilometre segment of the MVH in the southern portion of the Sahtu Lands Administration Region (Sahtu South Segment). This segment starts at the southern Sahtu border and extends north to Prohibition Creek.

Figure 1-1 presents a regional location plan showing the location and extents of the current Sahtu South Segment and also the three segments for which minor watercourse hydrotechnical assessed were conducted in 2020: (1) Prohibition Creek Access Road (PCAR), (2) Mount Gaudet Access Road (MGAR) and (3) Dehcho Segment (Tetra Tech, 2021). In addition to the above, Tetra Tech provided hydrotechnical input in 2021 for a multi-disciplinary team, led by Stantec, for detailed design of bridge-size culverts and modifications of approaches to existing bridges along the PCAR segment.

The alignment for the proposed ASR largely follows the existing winter road which has bridges at major watercourse crossings. The scope of work excludes the major crossings with existing bridges which have been evaluated previously. The watercourse crossings assessed in this report are described as “minor watercourse crossings” to distinguish them from the excluded larger watercourses with existing bridges and bridge-size culverts.

Field inspections were conducted from September 30 through October 11th, 2021, by a team consisting of one Tetra Tech hydrotechnical engineer, one Tetra Tech fisheries biologist and a local wildlife/environmental monitor based out of Tulita. Sites were accessed via helicopter based in Norman Wells.

The results of the fish habitat and hydrotechnical assessments are provided in separate discipline-specific reports. This report presents the hydrotechnical results.

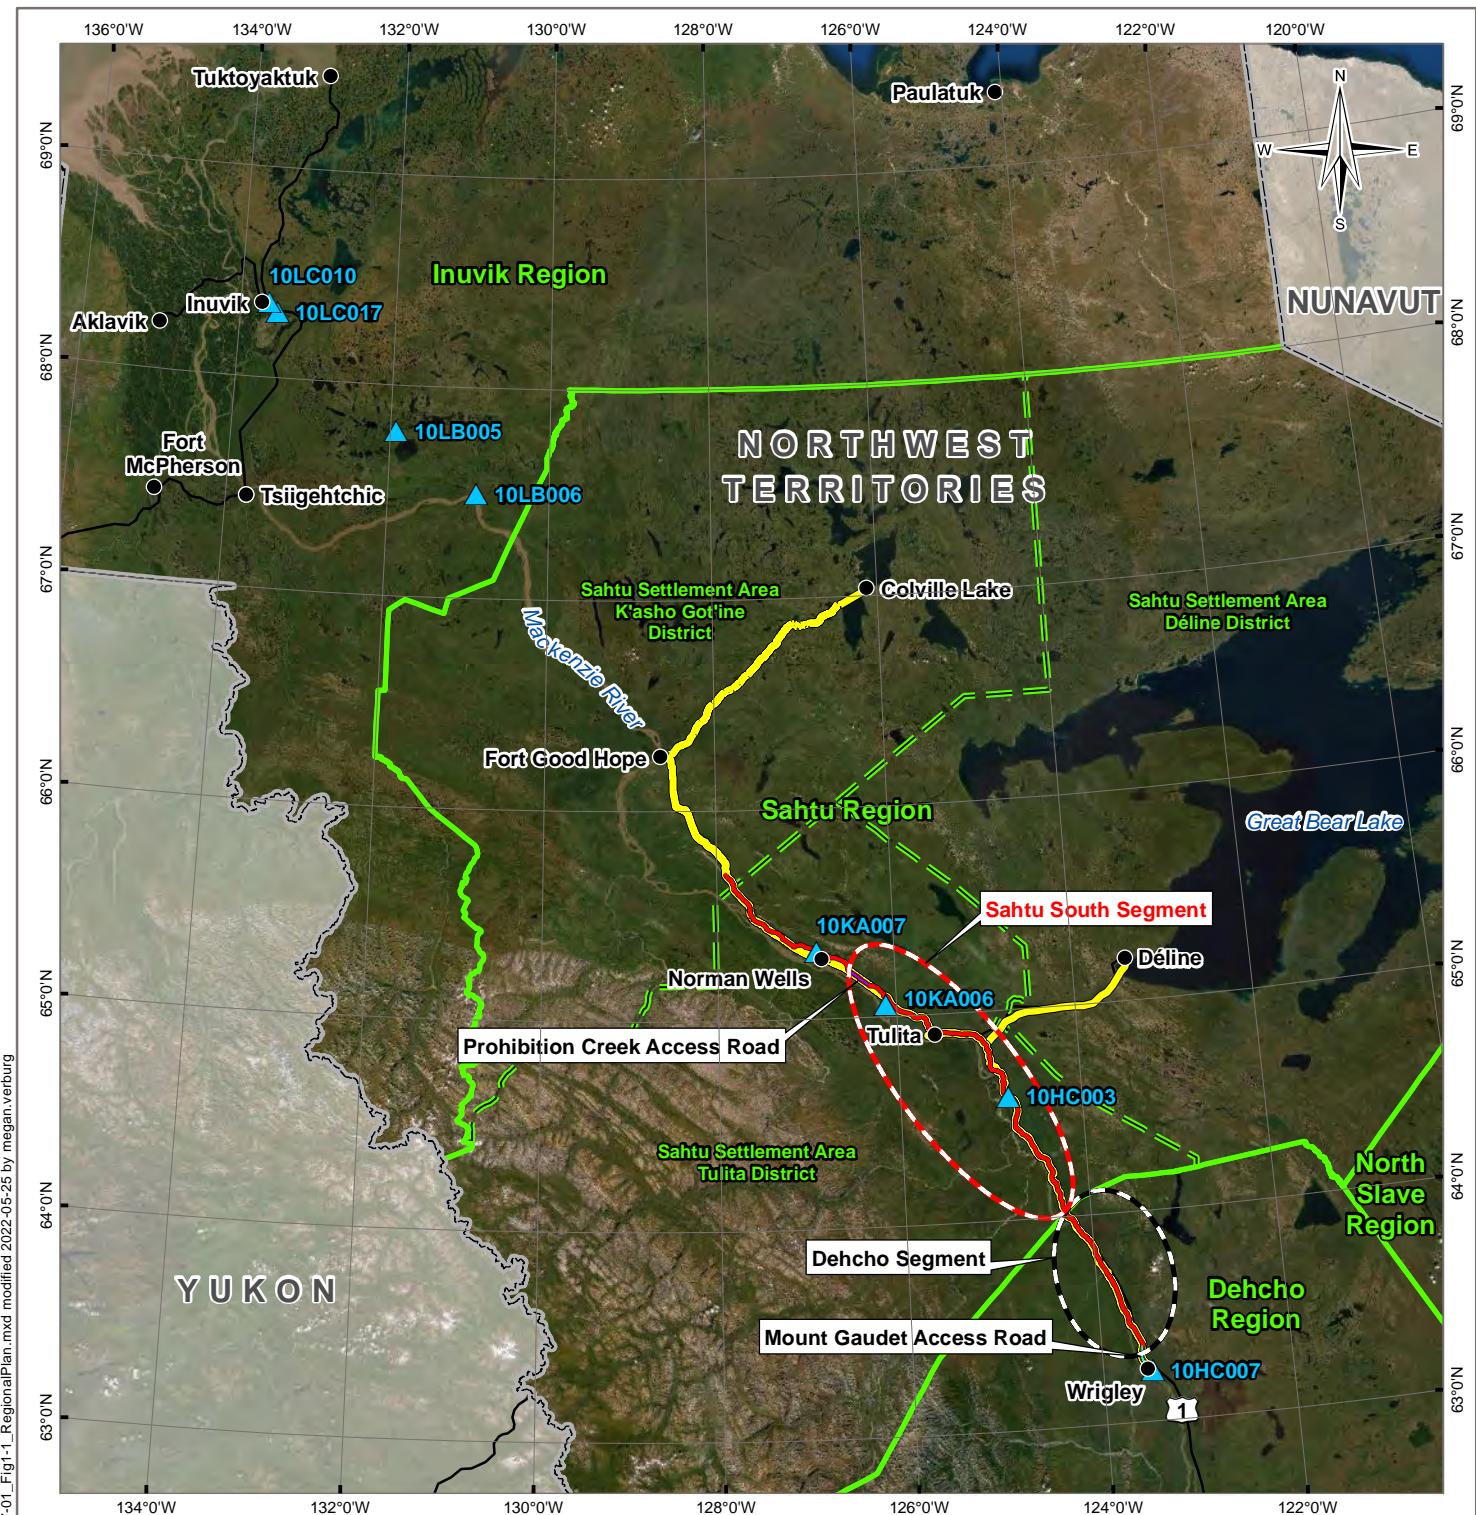

LEGEND

- Water Survey of Canada Stream Gauge Station
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Mount Gaudet Access Road
- Prohibition Creek Access Road
- Region Boundary
- District Boundary

Base Data

- Populated Place
- Other Road
-  Provincial/Territorial Boundary

NOTES

Base data source:
Natural Resources Canada
CanVec 1:5M scale
ESRI Data Maps
Imagery provided by ESRI; Maxar

MACKENZIE VALLEY HIGHWAY 021 HYDROTECHNICAL ASSESSMENTS

Sahtu South Segment Regional Location Plan

| | | | |
|--|--|-----------------------|---|
| PROJECTION Northwest Territories Lambert | | DATUM NAD83 | CLIENT  Northwest Territories |
| Scale: 1:4,000,000 50 25 0 50  Kilometres | | | |
| FILE NO. WTRI03067-01_Fig1-1_RegionalPlan.mxd | | | |
| OFFICE Tt-VANC | DWN SL | CKD BB | APVD MAN |
| | | | REV 0 |
| DATE May 25, 2022 | PROJECT NO. FNG WTRI03067-01 | | |

Figure 1-1

2.0 SCOPE OF WORK AND BACKGROUND INFORMATION

The original scope of work for the Sahtu South Segment anticipated the evaluation of 28 specific watercourses. Preliminary assessments made in preparation for field work determined that several watercourses appeared on the original list by error, such as watercourses not being crossed by the current proposed All Season Road (ASR) alignment or having been previously assessed, and that other pertinent watercourses had been omitted. To ensure timely completion of the field program, the work proceeded with a modified scope that included assessments of all relevant crossings from the original scope plus additional sites judged to be potentially significant based, in part, on aerial reconnaissance observations during the field program.

The additional sites selected for ground inspections and subsequent hydrotechnical assessment are believed to include all watercourses, excluding existing bridge crossings, substantial enough to contain fish and/or require a culvert greater than 1500mm in diameter, the cut-off diameter beyond which GNWT guidelines require bridge-size culverts to be designed in accordance with specific material and engineering criteria.

Scope of work elements included:

- Collection of relevant background information;
- Field investigation to assess watercourse crossing characteristics;
- Hydrologic desktop assessment for design flow determination; and
- Hydraulic analysis for preliminary crossing structure recommendations.

Background information obtained for desktop hydrologic studies consisted of regional streamflow data and topographic mapping information.

The ASR centreline was provided by Stantec for this project. This ASR alignment is understood to generally (but not exactly) match the alignment described in the Project Description Report (PDR) for the MVH Tulita District, Sahtu Settlement Area (EBA, 2011). The Kilometre Markers (KMs) used to describe the 2011 PDR alignment are used in this report to refer to the crossing locations.

Historical streamflow information from Water Survey Canada (WSC) stations in the vicinity of the study area, reflecting drainage from relatively-small basins in close proximity to the ASR, was obtained for the hydrologic analysis. The stations used in the analysis are identified in Figure 1-1 and described in Section 4.2.

Multiple forms of topographic mapping information were obtained, including: (1) bare earth Light Detection and Ranging (LiDAR) data acquired in 2010¹ by the GNWT for a corridor along the MVH alignment, (2) Government of Canada 1:50,000 scale National Topographic System (NTS) maps and companion CanVec data layers, (3) Government of Canada Geobase Digital Elevation Models, and 4) Polar Geospatial Centre ArcticDEM terrain models developed from satellite imagery. The LiDAR, NTS mapping, Geobase DEM and ArcticDEM data were used to determine watershed areas.

¹ GNWT acquired additional LiDAR data along the MVH alignment during 2019-2021 which was not available for the current assessment but should be used for subsequent detailed designs.

The methodology used for preliminary sizing of culverts at minor watercourse crossings incorporates knowledge gained during the preparation of detailed designs of culvert crossing along the PCAR segment in 2021 and is modified slightly from the methodology used for the PCAR and MGAR initial assessments in 2020.

It was learned during the PCAR detailed design that drainage crossing designs along the MVH ASR cannot rely on conventional ditching or grading along the road embankment, as initially assumed, to direct intercept runoff to designated cross-drainage locations. This is because of geotechnical recommendations for the embankment construction to be exclusively with fill, without grading of the native ground, to minimize ground disturbance in confirmed or potential permafrost areas. In a change from the prior initial assessments of the PCAR and MGAR segments which had assumed that all runoff intercepted by the road embankment would be directed to a designated cross drainage location, the minor crossing designs for the Dehcho and Sahtu assessments only consider the watershed areas that naturally drain to the specific minor crossing locations.

It was also learned during the PCAR detailed design it is not always possible to size a single culvert with sufficient capacity to convey the design flow that naturally drains to the culvert location. This condition occurs at drainages without a well-defined channel or gully deep enough to develop the headwater (depth of water at the culvert inlet) to pass the design flow without creating bypass flow along the toe of the road embankment. For example, if the native topography can only impound water to a depth of 0.5 m before bypass flow occurs, it is essentially not possible to utilize the full capacity of culverts with a diameter greater than 0.5 m. The minor crossing designs for the Dehcho and Sahtu assessments consider headwater constraints which need to be resolved with multiple culverts and sometimes eliminate the need for bridge-size culverts.

The current scope of work provides preliminary sizing recommendations for minor watercourse crossings and does not include preparation of detailed designs which will incorporate geotechnical, road design and other information not yet available. The 2011 PDR (EBA, 2011) included a relevant discussion of future detailed designs for minor stream crossings, copied below for reference.

Other minor stream crossings will utilize common culvert design and installation or minor bridges. The decision to use a culvert or a minor bridge structure is generally dependent on ground and soil conditions, availability of fill material, cost, and most importantly, requirements to protect fish habitat. Where large diameter culverts (greater than 1,400 mm dia.) are considered for minor crossings, the culverts will be traditional circular or arch culverts with closed bottoms as these are known to have better performance in permafrost regions than open bottom arch culverts. As the cost of shipping large diameter corrugated steel pipe culverts is prohibitive, structural plate corrugated steel pipe culverts will be considered.

Designs for major and minor culverts will include requirements for bedding materials, geotextile, and insulation to provide strength in foundation and to protect the surrounding permafrost and ice rich soils from thaw. Detailed geotechnical information will be collected in field investigations in the next steps in development of the Highway and detailed design stages will incorporate the bedding and foundation requirements for culverts.

3.0 FIELD INVESTIGATIONS

The field investigation along the MVH South Sahtu Segment was conducted from September 30 to October 11, 2021, by hydrotechnical engineer Mark Aylward-Nally, P.Eng. (BC) and aquatic biologist Theresa McCaffrey of Tetra Tech, accompanied by a local wildlife/environmental monitor based in Tulita. A total of 27 water crossings were accessed by helicopter to evaluate the drainage and fish habitat characteristics, reported separately.

The proposed ASR alignment largely follows the current winter road alignment with exceptions where deviations have been made to improve the alignment. The majority (18) of the watercourse crossings evaluated in this assessment are at locations where the two alignments match.

The terrain over the Sahtu South Segment can be characterized as gently rolling terrain that generally drains west towards the Mackenzie River. Ground cover along the alignment is predominantly muskeg, often wet and marshy in low-lying areas, vegetated with small trees and shrubs. Heavy beaver activity was noted along the entire Sahtu South Segment, creating blockages on many of the visited watercourses.


3.1 Watercourse Selection Methods

As described in Section 2.0, the watercourse crossing site list in the originally scope of work was modified to include some alternate crossings after it was determined that the original list, based on watercourses from the 2011 PDR (EBA, 2011), included several watercourses that were either avoided by the most current ASR alignment or had been previously assessed for a now-existing bridge or bridge culvert. The final list of sites was developed by a combination of desktop reviews and field aerial reconnaissance.

A review of background reports and topography data was completed prior to the field visit to prepare a list of watercourses of potential interest. This list included still-relevant watercourses identified in the 2011 PDR report plus additional potential watercourses identified through examination of LiDAR and ArcticDEM terrain models, NTS 1:50,000 topographic maps and aerial imagery to identify substantial drainage features. In total, 36 preliminary sites were identified. During the field program each of these sites was viewed from the air to determine whether a significant enough watercourse was present to warrant ground inspection.

Ground assessments were made at a total of 27 sites. The final site list includes every watercourse along the MVH Sahtu South Segment, without an existing bridge or bridge culvert, significant enough to possibly require an engineered bridge size culvert design. The site list also includes many smaller watercourses. Although an effort was made to include the largest of the smaller watercourses, it was difficult to make this determination from the aerial assessment. The final list does not provide a comprehensive summary of locations where small channels (some larger than those where site inspections were made) or flowing wetlands exist and where cross-drainage will be required.

Figures 3-1a through 3-1d show the locations of the minor watercourse crossings which are evaluated in this report. Figures C-1 to C-8 in Appendix C show the crossings locations at a smaller scale, together with their drainage basin areas.

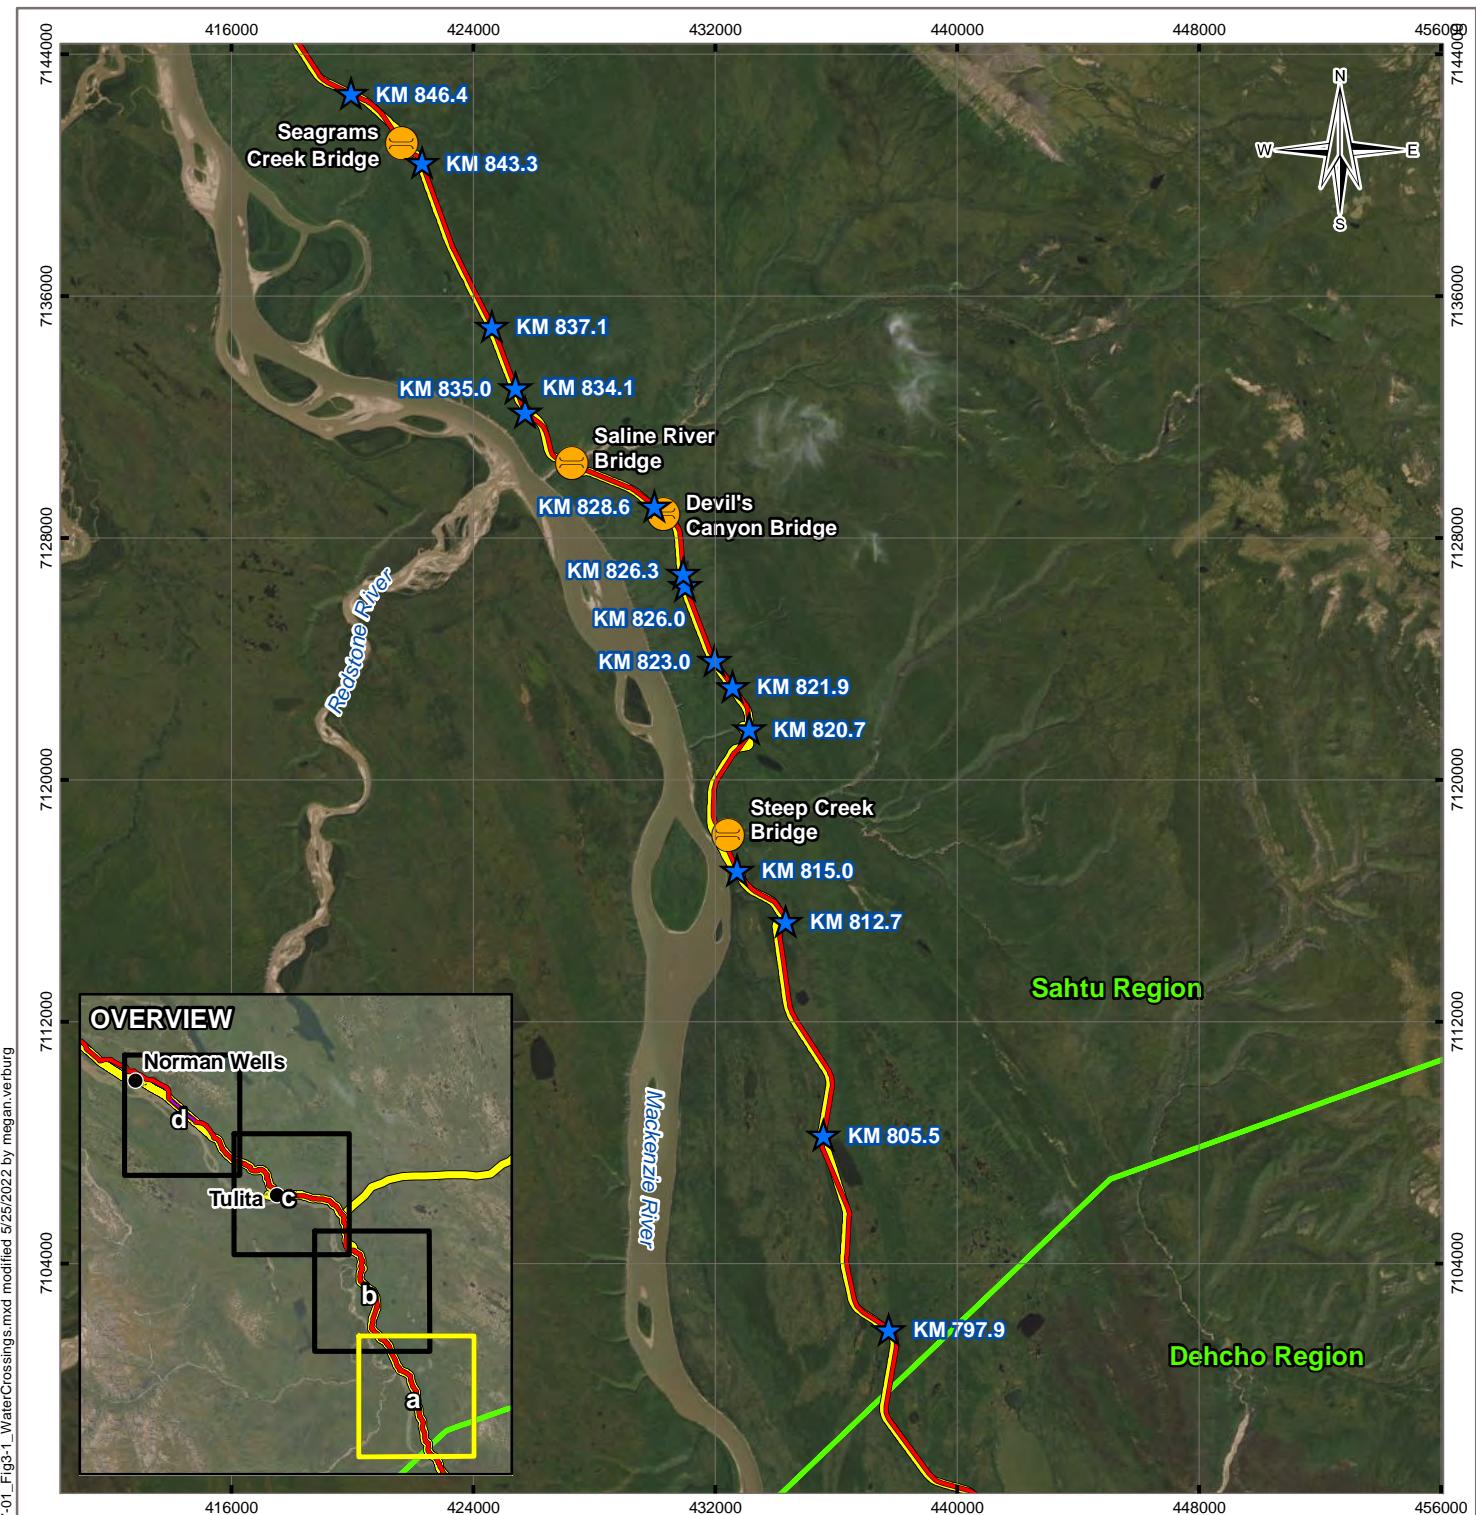

LEGEND

- Existing Bridge
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

NOTES

Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)


Base data source:
Natural Resources Canada
CanVec 1:250,000 scale
ESRI Data Maps
Imagery provided by ESRI; Maxar
(various dates)

MACKENZIE VALLEY HIGHWAY 2021 HYDROTECHNICAL ASSESSMENTS

Sahtu South Segment Watercourse Crossings

| PROJECTION | | DATUM | CLIENT |
|--|------------------|-----------|--|
| UTM Zone 10 | | NAD83 |  Northwest Territories |
| Scale: 1:250,000 | | | |
| 5 | 2.5 | 0 | 5 |
| Kilometres | | | |
| FILE NO. | | | |
| WTRI03067-01_Fig3-1_WaterCrossings.mxd | | | |
| OFFICE | DWN SL | CKD BB | APVD MAN |
| Tl-VANC | | | REV 0 |
| DATE | PROJECT NO. | | |
| May 25, 2022 | ENG.WTRI03067-01 | | |

Figure 3-1a

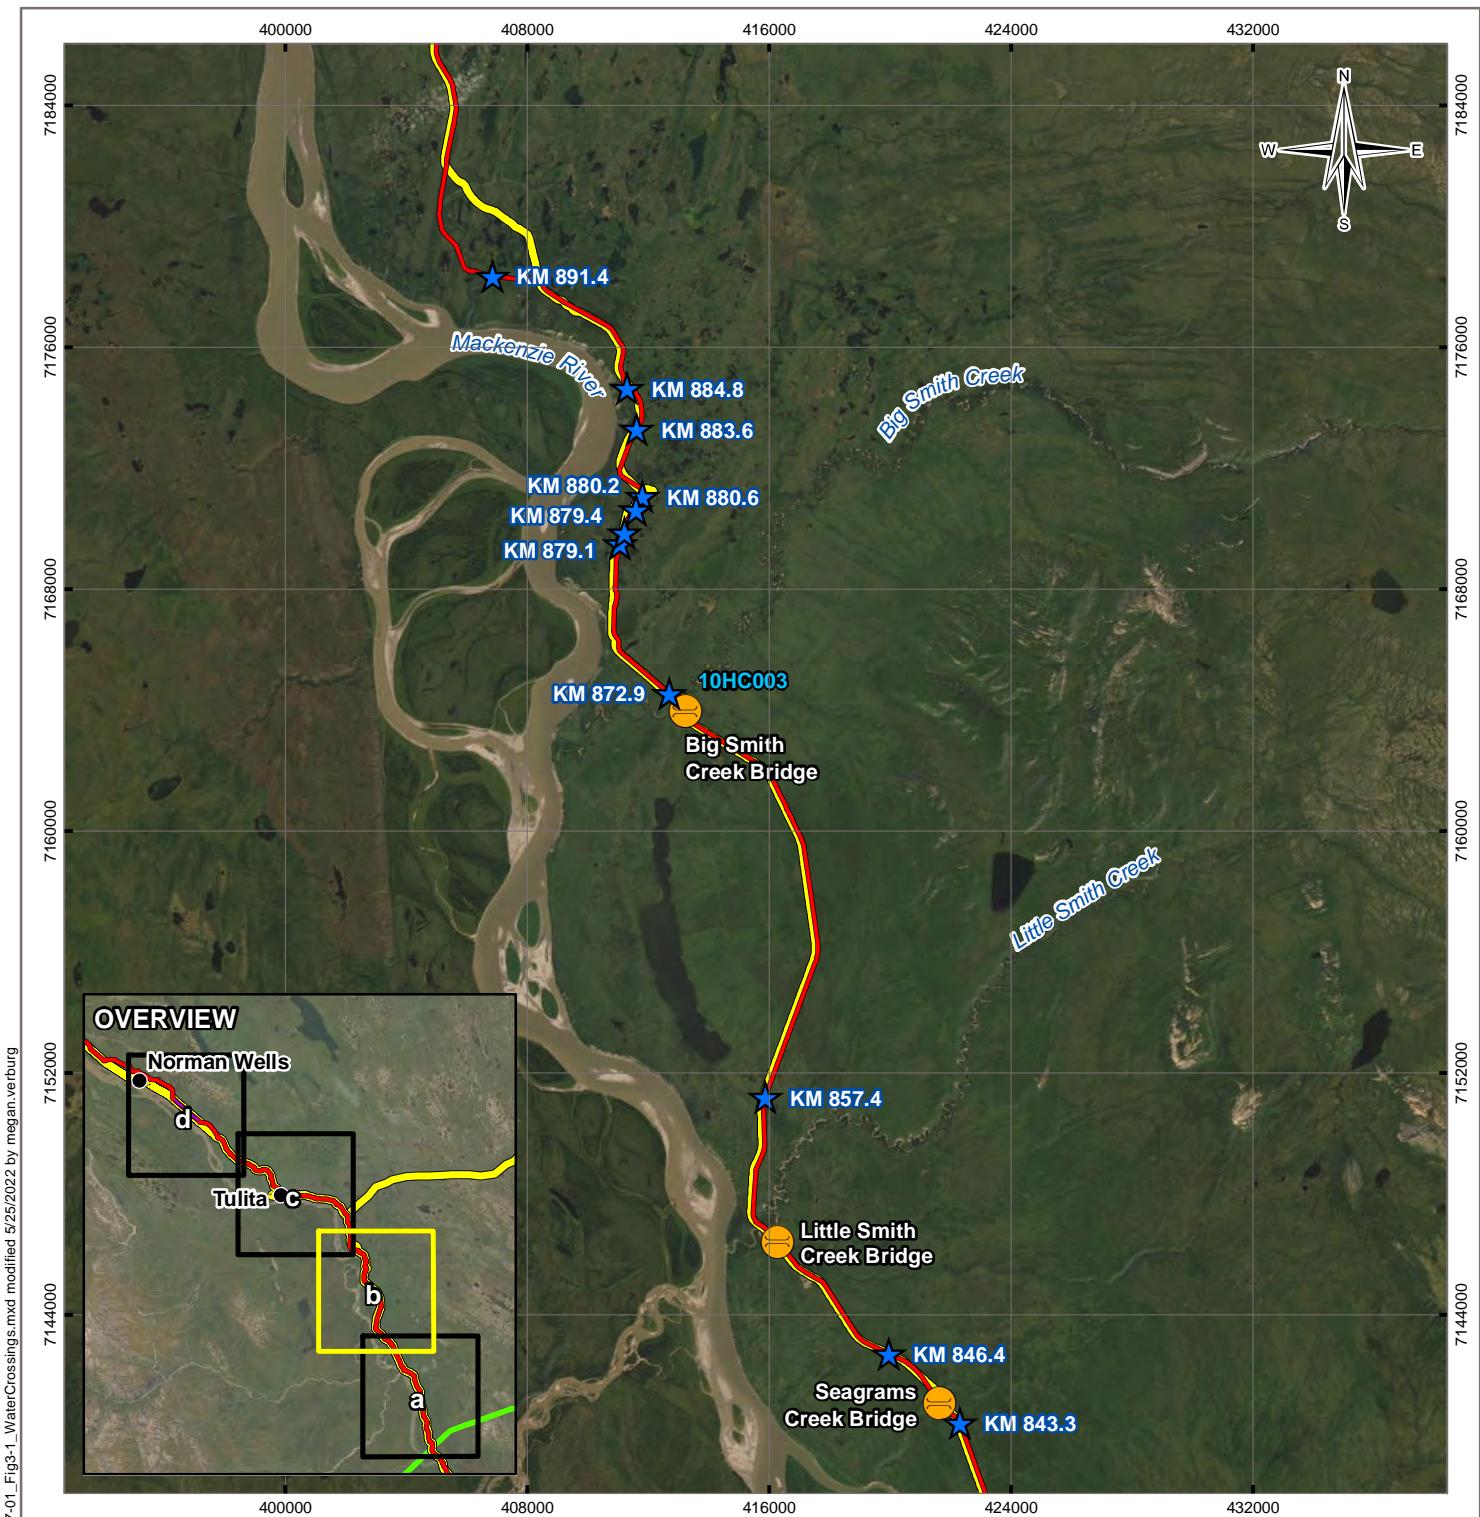

LEGEND

- Existing Bridge
- ★ Minor Watercourse Crossing
- ▲ Water Survey of Canada Stream Gauge Station
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

NOTES

Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)


Base data source:
Natural Resources Canada
CanVec 1:250,000 scale
ESRI Data Maps
Imagery provided by ESRI; Maxar
(various dates)

MACKENZIE VALLEY HIGHWAY 2021 HYDROTECHNICAL ASSESSMENTS

Sahtu South Segment Watercourse Crossings

| PROJECTION | | DATUM | CLIENT | |
|------------------|--|--------|--|-------|
| UTM Zone 10 | | NAD83 |  Northwest Territories | |
| Scale: 1:250,000 | | | | |
| 5 | 2.5 | 0 | 5 | |
| Kilometres | | | | |
| FILE NO. | WTRI03067-01_Fig3-1_WaterCrossings.mxd | | | |
| OFFICE | DWN SL | CKD BB | APVD MAN | REV 0 |
| Tf-VANC | | | | |
| DATE | PROJECT NO. | | | |
| May 25, 2022 | ENG.WTRI03067-01 | | | |

Figure 3-1b

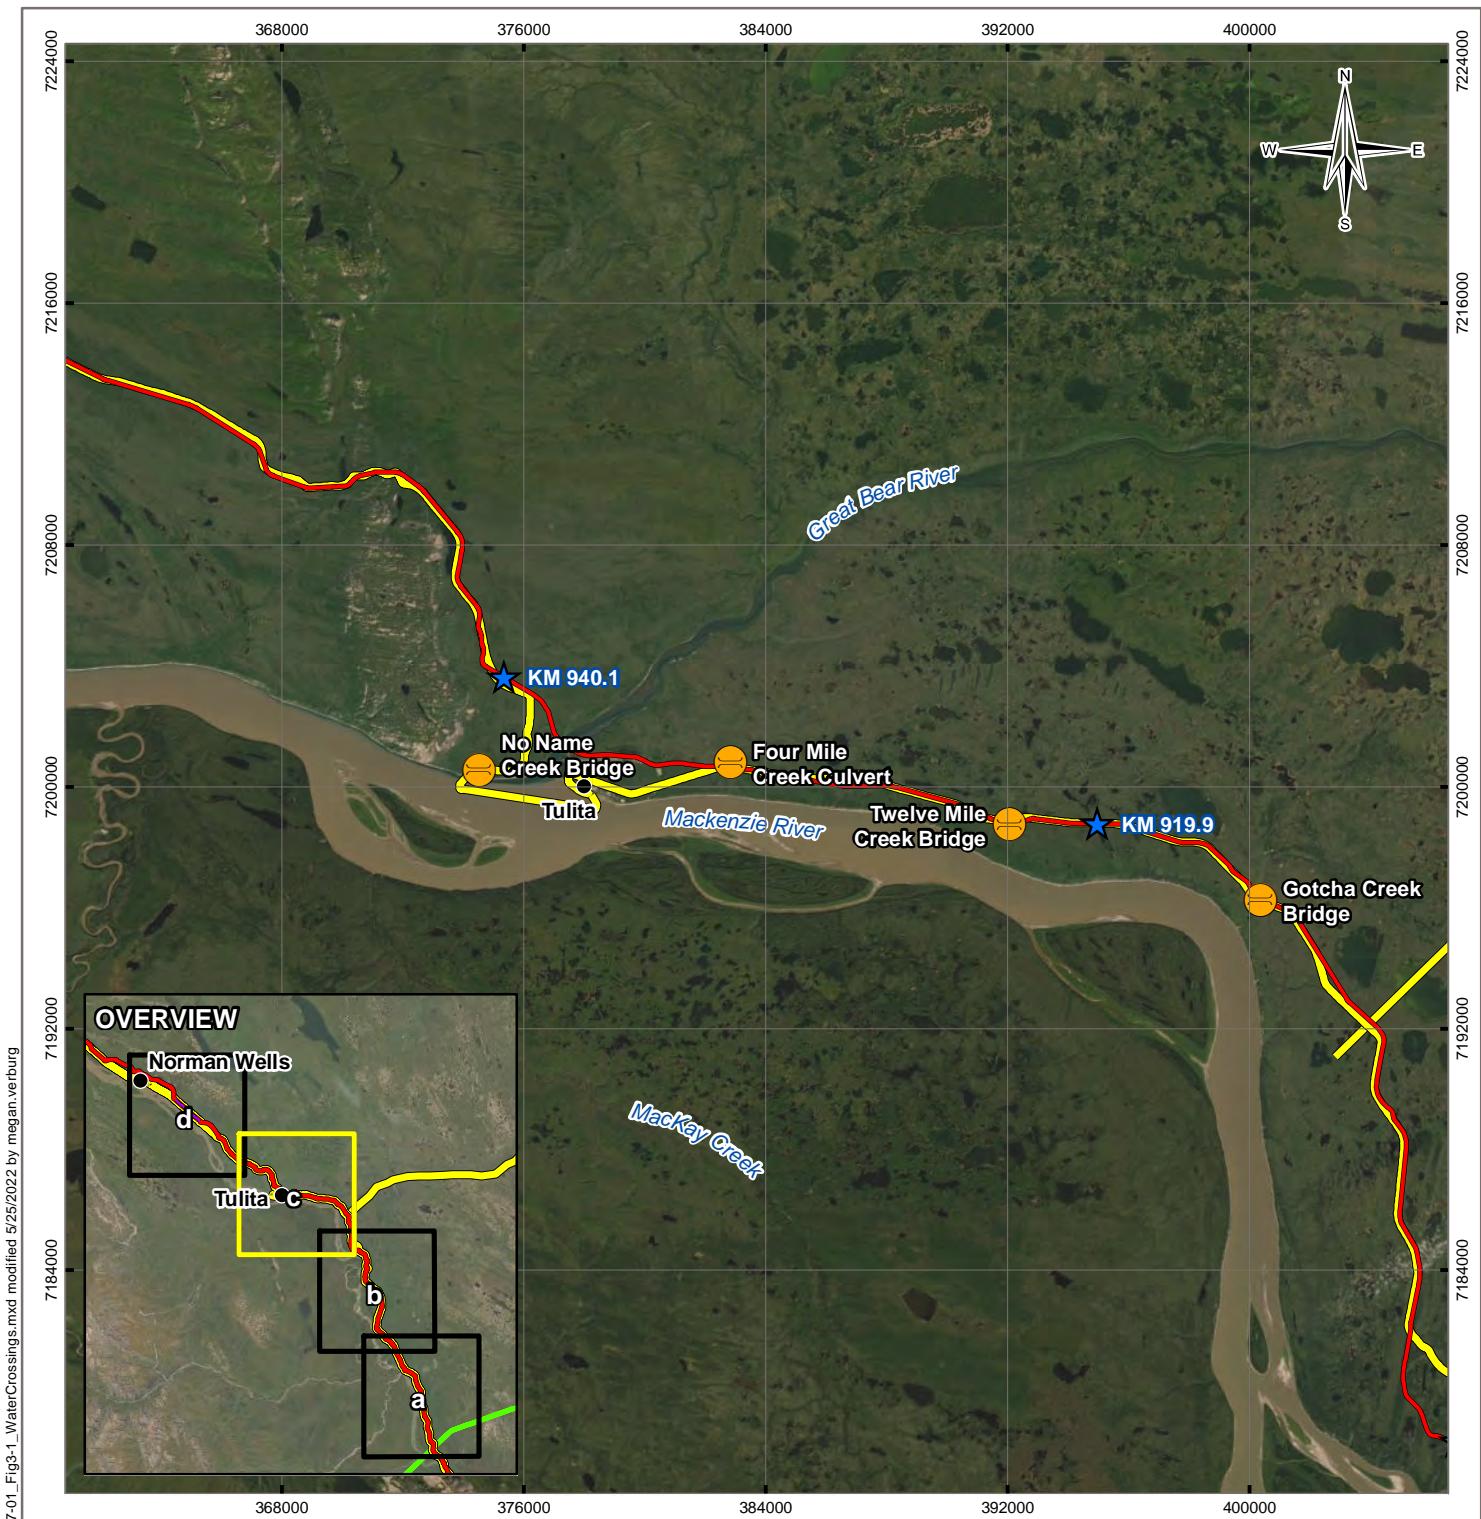

LEGEND

- Existing Bridge
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Populated Place

NOTES

Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)


Base data source:
Natural Resources Canada
CanVec 1:250,000 scale
ESRI Data Maps
Imagery provided by ESRI; Maxar
(various dates)

MACKENZIE VALLEY HIGHWAY 2021 HYDROTECHNICAL ASSESSMENTS

Sahtu South Segment Watercourse Crossings

| PROJECTION | | DATUM | CLIENT |
|--|------------------|-----------|--|
| UTM Zone 10 | | NAD83 |  Northwest Territories |
| Scale: 1:250,000 | | | |
| 5 | 2.5 | 0 | 5 |
| Kilometres | | | |
| FILE NO. | | | |
| WTRI03067-01_Fig3-1_WaterCrossings.mxd | | | |
| OFFICE | DWN SL | CKD BB | APVD MAN |
| T1-VANC | | | REV 0 |
| DATE | PROJECT NO. | | |
| May 25, 2022 | ENG.WTRI03067-01 | | |

Figure 3-1c

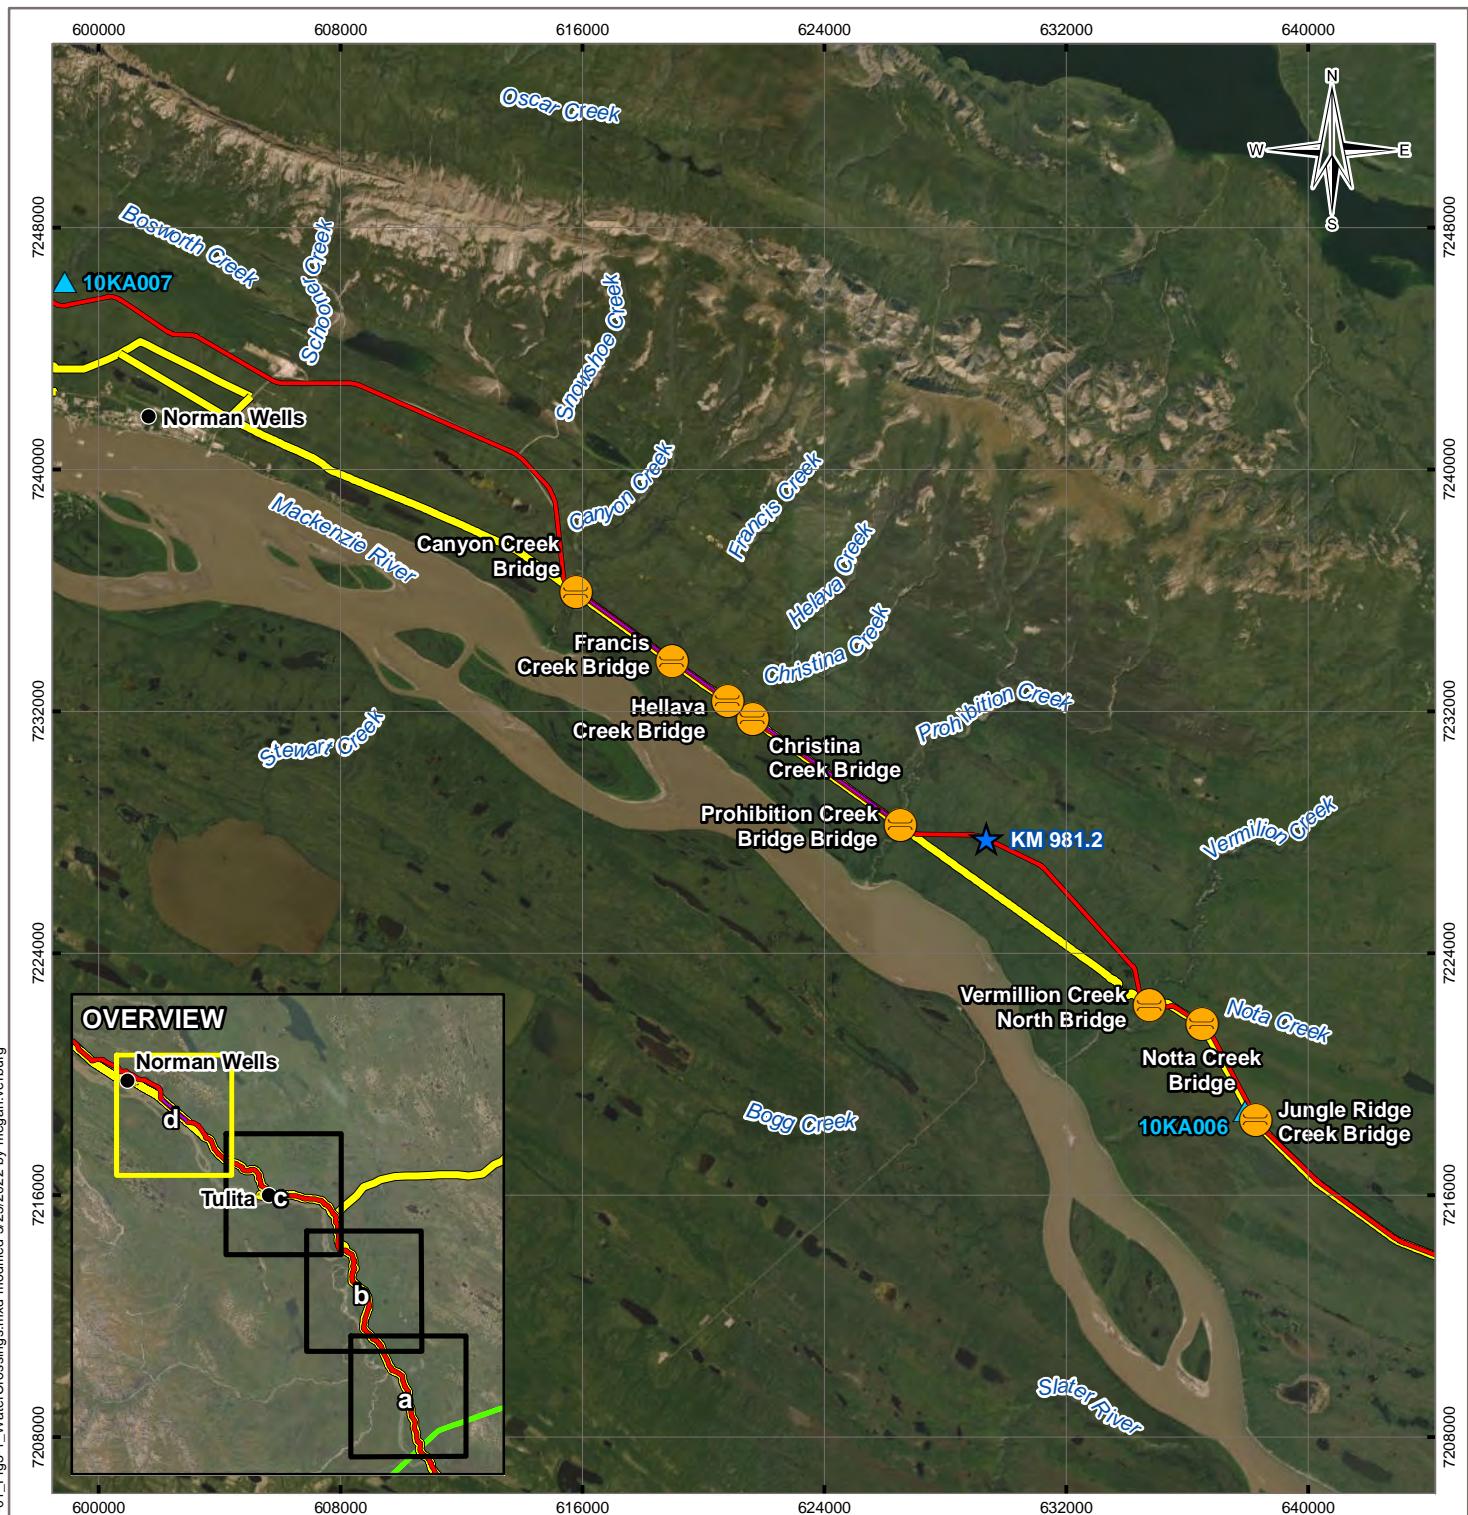

LEGEND

- Existing Bridge
- Minor Watercourse Crossing
- Water Survey of Canada Stream Gauge Station
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Prohibition Creek Access Road
- Region Boundary

Base Data

- Populated Place

NOTES

Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)

Base data source:
Natural Resources Canada
CanVec 1:250,000 scale
ESRI Data Maps
Imagery provided by ESRI; Maxar
(various dates)

MACKENZIE VALLEY HIGHWAY 2021 HYDROTECHNICAL ASSESSMENTS

Sahtu South Segment Watercourse Crossings

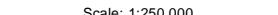
| | | | | | |
|---|---------------------------------|-----------|----------------|----------|--|
| PROJECTION UTM Zone 9 | | | DATUM NAD83 | | CLIENT  Northwest Territories |
| Scale: 1:250,000 | | | | | |
| 5 | 2.5 | 0 | | 5 | |
|  | | | | | |
| Kilometres | | | | | |
| FILE NO. WTRI03067-01_Fig3-1_WaterCrossings.mxd | | | | | |
| OFFICE Tt-VANC | DWN SL | CKD BB | APVD MAN | REV 0 | |
| DATE May 25, 2022 | PROJECT NO. ENG.WTRI03067-01 | | | | |

Figure 3-1d

3.2 Site Assessment Summary

Ground inspections were made at each crossing to measure flow rates, assess channel geometry and channel substrate, and to document other watercourse characteristics potentially pertinent to the design of appropriate drainage infrastructure. Flow rates were measured using a Swoffer meter and the velocity-area method or timed volumetric measurements when possible; visual estimates were made of flows too difficult to measure with metering equipment, such as shallow flow in vegetated areas.

Table 3-1 presents a summary of the assessments of each minor watercourse. Field photos are presented in Appendix B; drainage basins are presented in Appendix C.

Table 3-1: Site Assessment Summary; UTM Coordinates

| Winter Road Crossing ID | Zone 10 Easting (m) | Zone 10 Northing (m) | Date Assessed | Flow (L/s) | Bankfull Width (m) | Bankfull Depth (m) | Channel Slope (%) | Substrate Composition | Site Notes | Photo Numbers in Appendix B |
|-------------------------|---------------------|----------------------|---------------|------------|--------------------|--------------------|-------------------|------------------------------------|---|-----------------------------|
| KM 797.9 | 437749 | 7101831 | 1-Oct-21 | 20 | 4.1 | 1.3 | 0.5 | Fines and waterlogged woody debris | Wide and deep slow-moving channel, banks comprised of sand, silt, and clay. Numerous small beaver dams downstream of crossing have flooded the entire area. 100m upstream of the crossing location water is freely flowing in a defined channel filled with woody debris. | 1 to 4 |
| KM 805.5 | 435588 | 7108256 | 1-Oct-21 | n/a | ~30 | ~1.0 | 0.3 | Fines | Proposed crossing location is an approximately 30-metre-wide strip of wetland containing two wide deep channels. No flow visible at crossing due to large wetted cross-sectional area. Soft substrate with some sunken woody debris. Downstream of crossing flow disperses across a 50 m wide wetland with many braids of flow. | 5 and 6 |
| KM 812.7 | 434330 | 7115335 | 1-Oct-21 | 2 | 1.3 | 0.55 | 2.4 | Gravel and sand | Proposed crossing is approximately 100m upstream of present winter road crossing. Flow is only 2 L/s at the new proposed crossing while closer to 8 L/s downstream of the existing crossing suggesting that additional inflows are occurring. No obvious additional tributaries visible so it is assumed that this increase in flow is due to seepage. A large gully is present immediately south of this crossing which had stagnant water but no flow at the time of the visit. | 7 to 11 |
| KM 815.0 | 432726 | 7117027 | 2-Oct-21 | 5 | 1.9 | 0.4 | 6.5 | Gravel and sand, some cobbles | Two culverts (1000 and 900mm) present at winter road. Both in poor structural condition and the outlets are perched by about 1 m. Defined but small channel at crossing with small amounts of woody debris. 200m downstream of crossing channel dissipates into multiple largely stagnant braids. | 12 to 14 |
| KM 820.7 | 433134 | 7121695 | 6-Oct-21 | 30 | 20-30 | ~1.0 | 0.1 | Fines and organics | Proposed crossing is within a wetland that has a defined single flow path. Wetted top width was approximately 8 metres at time of visit, but it is likely that it increases to 20 or 30 metres during freshet. Wetland continues approximately 300m downstream of crossing where gradient increases and flow fully channelizes. | 15 to 20 |
| KM 821.9 | 432581 | 7123102 | 9-Oct-21 | ~0.1 | 1.3 | 0.7 | 2.0 | Fines and gravel | Small but defined channel. Watercourse base data from CanVec are not accurate for the 1.4 km segment that includes this channel; LiDAR elevation data show additional, some larger, unmapped drainages where culverts will be required in this segment. | 21 to 23 |
| KM 823.0 | 431979 | 7123969 | 6-Oct-21 | 2 | 2.5 | 0.7 | 2.2 | Boulders and cobbles | Well defined channel, boulder and cobble substrate at crossing. Gradient lessens immediately downstream of the crossing where substrate changes to gravel, sand, and organics | 24 to 27 |
| KM 826.0 | 431008 | 7126447 | 8-Oct-21 | ~0.5 | 1.8 | 0.7 | <0.1 | Fines and organics | Wide seemingly stagnant channel at PDR. Lake and wetland immediately upstream of crossing. Gradient increases downstream of proposed crossing, flow confined to small but defined channel with small but obvious flow. | 28 to 31 |
| KM 826.3 | 430947 | 7126835 | 8-Oct-21 | 2 | 1.2 | 0.4 | 1.4 | Fines and organics | Small but defined channel. Large amounts of felled trees and woody debris along the entire watercourse. | 32 to 35 |
| KM 828.6 | 429994 | 7129068 | 9-Oct-21 | ~0.5 | 1.0 | 0.8 | 2.5 | Fines and sand, some gravel | Small but defined channel. Heavily overgrown in parts. | 36 to 39 |
| KM 834.1 | 425726 | 7132183 | 10-Oct-21 | <1 | 1.1 | 0.5 | 2.4 | Fines and sand | Small but defined channel. Heavily overgrown in parts. | 40 and 41 |
| KM 835.0 | 425407 | 7132984 | 10-Oct-21 | <1 | 1.5 | 0.55 | 5.8 | Sand and gravel, some cobbles | Small but defined channel. | 42 and 43 |
| KM 837.1 | 424624 | 7135021 | 11-Oct-21 | 2 | 1.5 | 0.5 | 8.0 | Cobbles and gravel | Well-defined channel. Gravel and cobble substrate throughout the entire length of channel walked. | 44 to 47 |
| KM 843.3 | 422302 | 7140425 | 11-Oct-21 | 4 | 25 | 0.25 | 2.1 | Fines and organics | Two small channels present upstream of crossing which reach their confluence at the crossing location, beyond which flow dissipates and no defined channels are present. Area downstream of crossing area is flooded with water flowing in multiple braids. | 48 to 53 |
| KM 846.4 | 419957 | 7142711 | 11-Oct-21 | 50 | 12 | 0.2 | 1.0 | Fines and organics | No discernable channel at or upstream of crossing. Water seeps across the winter road in multiple spots over an ~12 m wide section of winter road. Gradient marginally increases downstream of alignment resulting in flow consolidating in a slow-moving but defined channel overgrown by trees and other vegetation. | 54 to 57 |

Table 3-1: Site Assessment Summary; UTM Coordinates

| Winter Road Crossing ID | Zone 10 Easting (m) | Zone 10 Northing (m) | Date Assessed | Flow (L/s) | Bankfull Width (m) | Bankfull Depth (m) | Channel Slope (%) | Substrate Composition | Site Notes | Photo Numbers in Appendix B |
|-------------------------|---------------------|----------------------|---------------|------------|--------------------|--------------------|-------------------|-----------------------------------|---|-----------------------------|
| KM 857.4 | 415860 | 7151193 | 11-Oct-21 | 5 | 2.3 | 0.6 | 1.9 | Fines and organics | Two consecutive beaver dams are present immediately upstream (north) of the roadway alignment flooding a large area. Flow proceeds in a small channel across the alignment and continues about 50 m downstream before encountering another area completely flooded by multiple beaver dams. A separate small channel crosses the PDR alignment approximately 120m to the south of this crossing. | 58 to 62 |
| KM 872.9 | 412680 | 7164554 | 2-Oct-21 | <5 | 40 | ~0.6 | 0.6 | Fines and organics | Crossing is located within a strip of wetland that extends upstream and downstream with no defined channels. A wooden bridge structure and 500mm culvert are present on site for the winter road. No observable flow at crossing due to large, wetted area, a trickle seen in a braid downstream. | 63 to 65 |
| KM 879.1 | 411054 | 7169500 | 9-Oct-21 | <1 | ~3 | ~1 | 0.2 | Organics | Wide wetland type channel of seemingly stagnant water connecting lakes on each side of the alignment. | 66 and 67 |
| KM 879.4 | 411210 | 7169865 | 9-Oct-21 | 10 | 5.2 | 0.5 | 1.7 | Organics | Crossing is approximately 50 metres downstream of a lake outlet. Wide wetted width (~5m) at alignment, lots of willows/reeds growing in channel. Downstream of roadway alignment gradient steepens and a well-defined channel exists. | 68 and 69 |
| KM 880.2 | 411595 | 7170626 | 2-Oct-21 | 1 | 1.2 | 0.4 | 2.0 | Fines and organics | Tiny watercourse in a poorly defined channel, quite overgrown. | 70 to 72 |
| KM 880.6 | 411801 | 7171055 | 5-Oct-21 | 50 | 1.8 | 0.8 | 2.3 | Cobbles and gravels | Larger watercourse contained within a well-defined channel crowded by lots of vegetation. | 73 to 76 |
| KM 883.6 | 411616 | 7173284 | 5-Oct-21 | 1 | 4.0 | 0.4 | 1.8 | Fines and organics | Poorly defined channel. Flow spread over a couple metres of marshy ground at PDR alignment. | 77 to 81 |
| KM 884.8 | 411300 | 7174637 | 30-Sep-21 | 12 | 2.5 | 0.85 | 1.7 | Fines | An uncovered 900mm culvert is present along the winter road alignment. PDR alignment is approximately 160m downstream of the winter road alignment. Entire area shows signs of being substantially flooded for a long period of time. Trees at the PDR crossing location are stained ~2m in height. Local wildlife monitor says a large beaver dam was removed here just last year which had created this flooding. Small amounts of woody debris present in channel. | 82 to 86 |
| KM 891.4 | 406838 | 7178354 | 11-Oct-21 | 500 | 15 | >1.5 m | 0.6 | Fines | Crossing is at the outlet of a large lake. Large woody debris and a beaver dam have backwatered this crossing to ~0.3m higher than the bank height at time of site visit. ~150m downstream of PDR alignment channel is free of blockages and water flows freely in a well-defined channel (~7m wide). | 87 to 91 |
| KM 919.9 | 394957 | 7198774 | 30-Sep-21 | 15 | ~40 | 1.1 | 0.5 | Fines and organics | Crossing is within a wetland backwatered by a 1m high beaver dam located ~50 metres downstream. A small lake is immediately upstream of crossing location. Winter road crosses this watercourse via a recently constructed crushed rock embankment with 600mm culvert installed. | 92 to 95 |
| KM 940.1 | 375328 | 7203624 | 7-Oct-21 | 3 | 1.5 | 0.9 | 3.0 | Fines | Flow contained in a single defined channel highly overgrown by small trees and other vegetation. | 96 to 99 |
| KM 981.2 | 629355 (Zone 9) | 7227772 (Zone 9) | 7-Oct-21 | 5 | 2.26 | 0.8 | 3.0 | Cobbles and gravel, some boulders | Well defined channel, small amounts of erosion and undercutting to both banks. | 100 to 102 |

4.0 HYDROTECHNICAL ANALYSIS

The hydrotechnical assessment of highway drainage involved three basic components: (1) delineation of watershed areas; (2) hydrologic analysis to determine a design discharge for each site; and (3) hydraulic design and sizing of drainage openings of sufficient size to pass the design discharge. These components are described below.

4.1 Watershed Delineation

Available LiDAR surface data was combined with ArcticDEM surface data to synthesize a Digital Elevation Model (DEM) that covers the entirety of the watershed areas crossing the Sahtu South Segment alignment. Digital watershed delineations were completed using the Global Mapper GIS software package. Lake areas within each watershed were calculated through use of the CanVec 1:50,000 Waterbodies dataset.

Tributary watersheds were delineated for the 27 crossings as listed in Table 4-1 and shown on Figures C-1 through C-8 in Appendix C. Watershed areas range between approximately 0.2 km² and 63 km².

Several very small watersheds are included in the assessment because of preliminary screening information that suggested a potentially large watershed. For example, at KM 879.1 (0.22 km²), a defined watercourse connects two lakes on opposite sides of the alignment where east-to-west flow normally occurs towards the Mackenzie River. However, subsequent basin delineation with the project high-resolution LiDAR DEM identified that this defined channel actually flows from west to east and is part of a larger watershed to the crossing at KM 879.4 that drains east to west. In another example, at KM 880.2 (0.26 km²) the crossing corresponds to the start of a deep gully and NTS/CanVec mapping shows a defined watercourse at this location. Basin delineation with the high-resolution LiDAR DEM however identified the small basin area. Here and in other locations along the ASR alignment, the presence of a well-defined gully, even with a mapped watercourse from NTS/CanVec, is not a reliable indicator of drainage from a large watershed.

Table 4-1: Minor Watercourse Crossing Locations and Watershed Areas

| Crossing ID | Easting (m) | Northing (m) | UTM Zone | Watershed Area (sq km) | Lake Area (sq km) |
|-------------|-------------|--------------|----------|------------------------|-------------------|
| KM 797.9 | 437749 | 7101831 | 10 W | 50.22 | 1.21 |
| KM 805.5 | 435588 | 7108256 | 10 W | 37.94 | 2.09 |
| KM 812.7 | 434330 | 7115335 | 10 W | 6.41 | 0.00 |
| KM 815.0 | 432726 | 7117027 | 10 W | 3.83 | 0.00 |
| KM 820.7 | 433134 | 7121695 | 10 W | 15.64 | 0.25 |
| KM 821.9 | 432581 | 7123102 | 10 W | 0.30 | 0.00 |
| KM 823.0 | 431979 | 7123969 | 10 W | 8.84 | 0.00 |
| KM 826.0 | 431008 | 7126447 | 10 W | 1.41 | 0.02 |
| KM 826.3 | 430947 | 7126835 | 10 W | 4.30 | 0.03 |

Table 4-1: Minor Watercourse Crossing Locations and Watershed Areas

| Crossing ID | Easting (m) | Northing (m) | UTM Zone | Watershed Area (sq km) | Lake Area (sq km) |
|-------------|-------------|--------------|----------|------------------------|-------------------|
| KM 828.6 | 429994 | 7129068 | 10 W | 2.12 | 0.00 |
| KM 834.1 | 425726 | 7132183 | 10 W | 3.05 | 0.01 |
| KM 835.0 | 425407 | 7132984 | 10 W | 1.32 | 0.00 |
| KM 837.1 | 424624 | 7135021 | 10 W | 2.43 | 0.00 |
| KM 843.3 | 422302 | 7140425 | 10 W | 2.67 | 0.00 |
| KM 846.4 | 419957 | 7142711 | 10 W | 4.25 | 0.00 |
| KM 857.4 | 415860 | 7151193 | 10 W | 0.75 | 0.02 |
| KM 872.9 | 412680 | 7164554 | 10 W | 1.36 | 0.00 |
| KM 879.1 | 411054 | 7169500 | 10 W | 0.22 | 0.04 |
| KM 879.4 | 411210 | 7169865 | 10 W | 1.63 | 0.23 |
| KM 880.2 | 411595 | 7170626 | 10 W | 0.26 | 0.10 |
| KM 880.6 | 411801 | 7171055 | 10 W | 11.40 | 1.73 |
| KM 883.6 | 411616 | 7173284 | 10 W | 0.42 | 0.01 |
| KM 884.8 | 411300 | 7174637 | 10 W | 8.63 | 1.16 |
| KM 891.4 | 406838 | 7178354 | 10 W | 62.26 | 7.31 |
| KM 919.9 | 394957 | 7198774 | 10 W | 1.85 | 0.13 |
| KM 940.1 | 375328 | 7203624 | 10 W | 2.77 | 0.06 |
| KM 981.2 | 629355 | 7227772 | 9 W | 5.36 | 0.17 |

4.2 Hydrologic Analysis

The goal of the hydrologic analysis was to estimate the flow, for various return periods, at drainage crossings along the proposed highway alignment.

The hydrology was evaluated using a regional analysis approach. Regional analyses are used to estimate flow in ungauged watersheds by using relationships based on measured flows in gauged watersheds with similar physiographic characteristics. This approach was used to develop 2-year through 200-year peak flows estimates for each of the identified minor watercourses crossed by the Sahtu South Segment of the MVH alignment.

4.2.1 Hydrometric Station Selection

Water Survey of Canada (WSC) hydrometric stations draining basins in proximity to the MVH project site were reviewed to find gauged watercourses with similar watershed characteristics and sufficient data for meaningful statistical analysis. Eight stations on relatively small drainages situated within the Mackenzie Valley between Wrigley and Inuvik were selected for the analysis. Station information is included in Table 4-2 below. The WSC stations selected for analysis of the Sahtu South Segment are modified from those used for analysis of the prior PCAR, MGAR and Dehcho segments, primarily to include stations draining watersheds with significant lake attenuation effects that did not apply to the prior segments. Station locations are shown in the Figure 1-1 Regional Location Plan.

Watershed areas have been published by WSC for five of the eight stations selected for analysis. Stations which do not have a published area have typically been installed within complex watersheds which are challenging to accurately delineate due to shallow topography possibly creating multiple drainage outlets.

Additionally, Environment and Climate Change Canada (ECCC) has prepared the National Hydrometric Network Basin Polygon dataset which contains watershed polygons for all WSC stations. These polygons have been compiled from a number of contributing agencies, including provinces, territories and other government departments and have been delineated independently and thus may differ from, the WSC published areas.

Tetra Tech completed an independent delineation of all eight of the hydrometric stations based on 1:50,000 NTS elevation data. These delineations were then further refined through a review of: the most recent National Hydrometric Network Basin Polygon dataset and satellite imagery. The Tetra Tech delineations which considered all available information were used in all subsequent hydrological analysis.

Table 4-2: WSC Regional Stations

| Station ID | Station Name | Watershed Area (km ²) | | | Period of Record | Data Available (years) |
|------------|--|-----------------------------------|------------------|------------------------|------------------|------------------------|
| | | WSC Reported | ECCC Delineation | Tetra Tech Delineation | | |
| 10LB005 | Travaillant River above Travaillant Lake | n/a | 1255 | 1214 | 2004-2016 | 13 |
| 10HC003 | Big Smith Creek near Highway No. 1 | 980 | 920 | 932 | 1974-1994 | 21 |
| 10LB006 | Thunder River near the Mouth | n/a | 521 | 563 | 2006-2013 | 8 |
| 10HC007 | Hodgson Creek near the Mouth | n/a | 303 | 333 | 2006-2014 | 9 |
| 10KA007 | Bosworth Creek near Norman Wells | 125 | 111 | 110 | 1976-2017 | 27 |
| 10KA006 | Jungle Ridge Creek near the Mouth | 60 | 109 | 104 | 1980-2011 | 15 |
| 10LC010 | Boot Creek near Inuvik | 28.2 | 28.6 | 28.0 | 1981-1990 | 9 |
| 10LC017 | Havikpak Creek near Inuvik | 15.2 | 16.8 | 17.4 | 1995-2015 | 20 |

4.2.2 Statistical Flood Frequency Analysis

A peak flow frequency analysis was completed using peak instantaneous flows for each of the stations. In years where a station had a maximum daily flow reported, but no maximum instantaneous flow, a maximum instantaneous flow was synthesized from the maximum daily value based on an average ratio of the two in years where both values were available.

The statistical frequency analysis software, HYFRANPLUS, was used to fit the flow data to commonly-used statistical distributions. Several probability distributions were tested from which a best distribution was selected for each station, usually Gumbel. A chart of the Gumbel fitting used for station 10KA007 (Bosworth Creek) is shown in Figure 4-3.

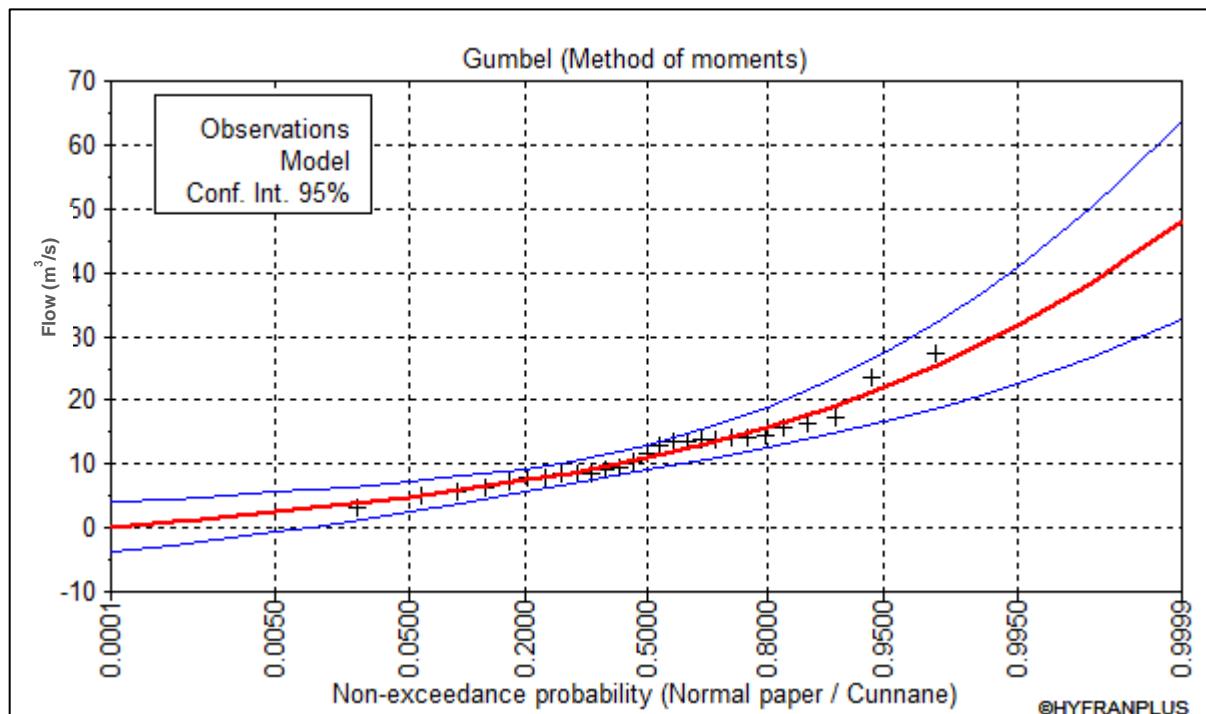


Figure 4-3: Peak Flow Frequency Distribution for Bosworth Creek (10KA007)

Results of the frequency analysis estimating 2-year through 200-year flows for each station are shown in Table 4-3. The accuracy of individual quantiles is dependent on the years of record for each station, with longer records yielding greater confidence in the results. Figure 4-3 includes 95% confidence lines for the Bosworth Creek frequency curve, from which it is apparent that the confidence in a particular estimate decreases with increasing return period (larger non-exceedance probability). In other words, the confidence in a 2-year estimate (0.5 probability) is higher than for a 200-year (0.995 probability). The confidence in the estimates for larger return periods increases for data sets with longer periods of record.

Table 4-3: Frequency Analysis Results

| Station | 10LB005 | 10HC003 | 10LB006 | 10HC007 | 10KA007 | 10KA006 | 10LC010 | 10LC017 |
|-----------------------------------|---------|---------|---------|---------|---------|---------|---------|---------|
| Area (km²) | 1214 | 932 | 563 | 333 | 110 | 104 | 28.0 | 17.4 |
| Lake Area (km²) | 199 | 26.7 | 65.0 | 5.11 | 3.64 | 2.29 | 1.41 | 0.75 |
| Years of Data | 13 | 21 | 8 | 9 | 27 | 15 | 9 | 20 |
| 200-Year (m³/s) | 73.3 | 230 | 77.0 | 85.4 | 31.5 | 24.3 | 8.34 | 6.34 |
| 100-Year (m³/s) | 66.6 | 212 | 68.5 | 77.7 | 28.6 | 22.2 | 7.54 | 5.72 |
| 50-Year (m³/s) | 59.9 | 193 | 60.0 | 70.0 | 25.7 | 20.0 | 6.75 | 5.10 |
| 20-Year (m³/s) | 51.0 | 168 | 48.7 | 59.7 | 21.8 | 17.1 | 5.68 | 4.26 |
| 10-Year (m³/s) | 44.1 | 149 | 40.0 | 51.7 | 18.8 | 14.9 | 4.86 | 3.62 |
| 5-Year (m³/s) | 36.8 | 129 | 30.9 | 43.4 | 15.7 | 12.6 | 4.00 | 2.95 |
| 2-Year (m³/s) | 25.9 | 98.4 | 17.1 | 30.9 | 11.0 | 9.09 | 2.71 | 1.94 |

4.2.3 Regional Hydrological Analysis

Figure 4-4 depicts a preliminary relationship between watershed area and 5-year flow for the eight selected regional WSC stations. The 5-year flow was selected for this preliminary comparison because confidence in the peak flow estimates is higher for relatively frequent events than for more extreme events such as a 100-year flow.

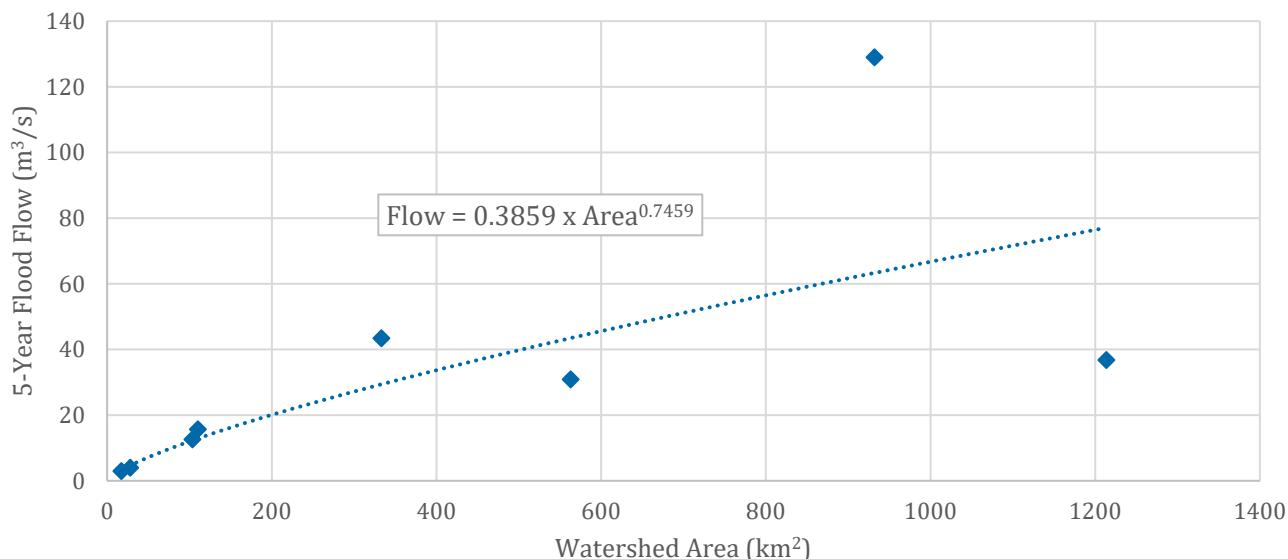


Figure 4-4: 5-Year Peak Flow versus Watershed Area for Regional WSC Stations

Though a visible trend can be observed across several of the stations, the overall scatter is unfavorable for establishing a relationship to define the hydrologic performance of all watercourses within the region. This scatter is predominately due to the different levels of flood attenuation that lakes provide in each watershed. Greater amounts of lake coverage, particularly within the lower parts of a watershed, translates to a greater amount of flood attenuation. Unsurprisingly we note in Figure 4-4 that the two datapoints furthest removed from the others are the two WSC stations with highest percentage of lake coverage, Travallant and Thunder River, with 16.4 and 11.5 percent lake coverage respectively. The other six gauged watercourses all have less than 5 percent lake coverage within their watersheds. By temporarily removing the two stations with greatest lake coverage, a convincing relationship can be established across the remaining six (Figure 4-5).

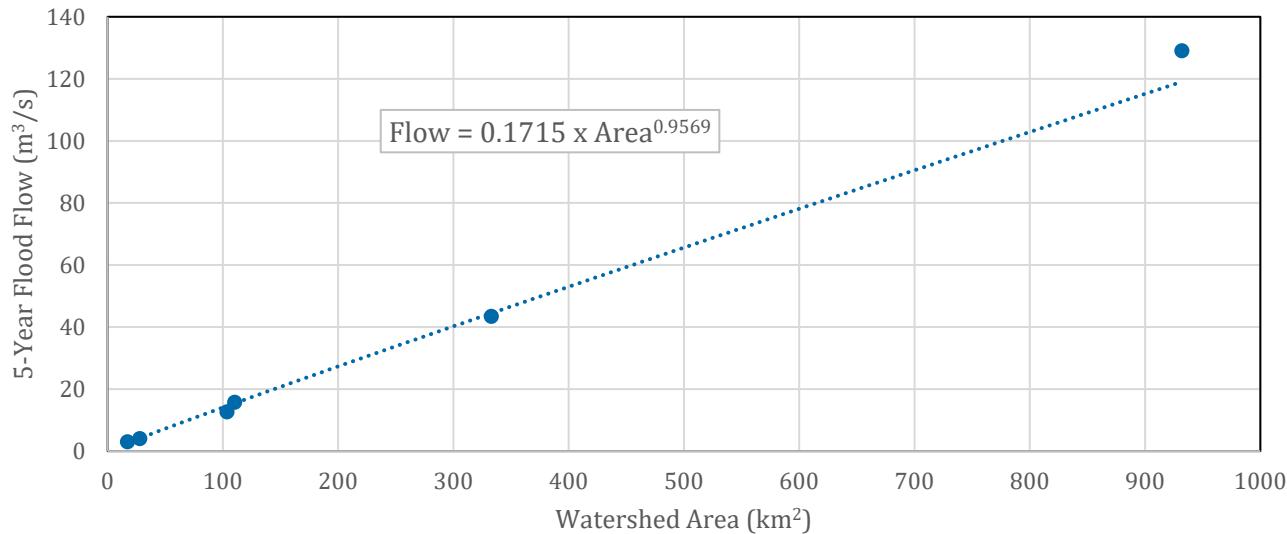


Figure 4-5: 5-Year Flow vs Watershed Area for WSC Stations < 5% Lake Area

The relationship presented in Figure 4-5 shows a strong correlation between watershed area and 5-year flow across the WSC stations for basins with a small percentage of lake area. The equation exponent of 0.957 suggests a near linear relationship between flood flow and watershed area (1.00 would be linear). This exponent is reasonable for arctic watersheds which will experience their peak annual flows during freshet, a largely homogenous runoff event where similar runoff rates can be expected across watersheds of a wide range of sizes. Given the strong correlation between the six plotted WSCs and this appropriate exponent magnitude, this equation is expected to produce good estimations of 5-year flood flows for basins with less than 5% lake coverage. An additional factor must be multiplied in for this equation to be appropriate for watersheds with substantial lake attenuation (Section 4.2.1).

With Figure 4-5 demonstrating the success of the approach, similar equations [Flow = coefficient x (Area)^{exponent}] were derived from the same six WSCs to estimate 2-year through 200-year floods as presented in Table 4-4.

Table 4-4: Regional Peak Flow Equation Variables (<5% Lake Coverage)

| Return Period | Coefficient | Exponent |
|---------------|-------------|----------|
| 2-Year | 0.1037 | 0.9895 |
| 5-Year | 0.1715 | 0.9569 |
| 10-Year | 0.218 | 0.9436 |
| 100-Year | 0.3666 | 0.9209 |
| 200-Year | 0.4118 | 0.9162 |

4.2.4 Lake Attenuation

Lake attenuation refers to the flood hydrograph attenuation (and peak flow reduction) that occurs due to lake storage effects. Several of the project watersheds have substantial lake attenuation, with lakes covering greater than 5% of their total watershed area. An additional “lake attenuation factor” was developed for these watersheds, to be applied as an adjustment to the results of small-percentage-lake equations presented in Table 4-4.

Lake attenuation factors were derived through analysis of the two WSC stations with substantial lake coverage. The dampening effects of the lakes on peak flows were estimated by comparing the statistically derived 5-year flow estimates of each station to the 5-year flow rates expected for basin of similar size but without lake effects as per the Figure 4-5 (and Table 4-4) regional equation. A lake attenuation factor was calculated for each station as the ratio between these two flows as presented in Table 4-5.

Table 4-5: Lake Attenuation Factors for WSC Stations with >5% Lake Area

| Attribute | Travaillant River above Travaillant Lake | Thunder River near the Mouth |
|--|--|------------------------------|
| Watershed Area (km ²): | 1214 | 563 |
| Lake Area (km ²): | 199 | 65.0 |
| Percentage Lake Coverage (%): | 16.4% | 11.5% |
| Statistically Derived 5-Year Flow (m ³ /s): | 36.8 | 30.9 |
| Regional Equation 5-Year Flow (m ³ /s): | 153.2 | 73.5 |
| Lake Attenuation Factor: | 0.240 | 0.420 |

Figure 4-6 shows the relationship and equation that was developed to calculate lake attenuation factor as a function of percent lake coverage within a catchment and applied for all return periods as discussed further below. The factor was accepted to be 1.0 for all watersheds with under 5% lake coverage.

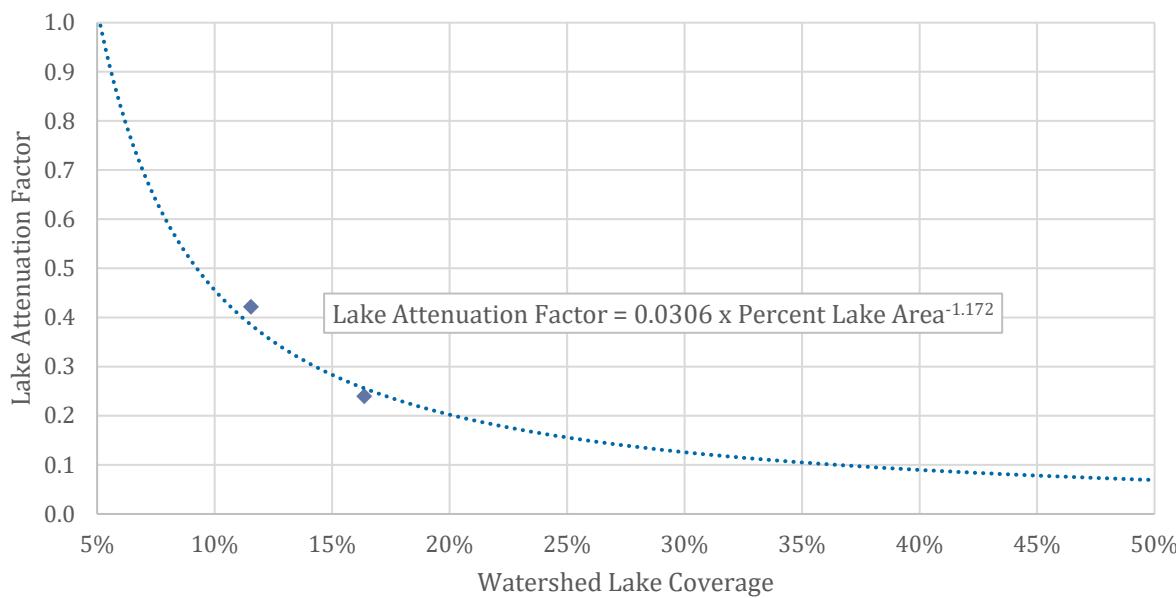


Figure 4-6: Lake Attenuation Factor by Watershed Lake Coverage

The lake attenuation factor equation derived from 5-Year flow observations was used to estimate flood flows for other return periods from 2-year to 200-year. This simplifying assumption was needed because historical flow data were too limited to allow for development of unique attenuation factors for different return periods. This method of quantifying the impact of lakes within a watershed as a function of lake area is further simplified as it does not capture the effects of the spatial distribution of lakes within a watershed. These simplifications are considered to be reasonable and appropriate in the context of sizing culverts for minor watercourse crossings.

4.2.5 Climate Change Effects

Due to freshet flows being the dominant high flow events for gauged streams for the project region, it was assumed that peak flows are related to winter precipitation depths. Climate change effects on peak flows were assessed with a simplifying assumption that the magnitude of these effects will be similar to modelled climate change effects on winter precipitation.

Climate model data was obtained from the Pacific Climate Impacts Consortium (PCIC) Climate Explorer² for the Winter (Dec to Feb) Precipitation RCP 8.5 (high carbon) scenario. An ensemble³ mean was calculated from six Global Climate Models (GCM) recommended by PCIC as appropriate for Western North America and selected for having seasonal precipitation outputs. Results applicable to the MVH Sahtu South Segment region are shown in Table 4-6.

Table 4-6: PCIC Ensemble GCM Winter Mean Daily Precipitation for Sahtu Region

| Model Period | Min | Max | Mean | Median | Std. Dev | Units |
|--------------|-------|-------|--------------|--------|----------|--------|
| 1961 – 1990 | 0.537 | 0.738 | 0.602 | 0.600 | 0.040 | mm/day |
| 1971 – 2000 | 0.530 | 0.735 | 0.595 | 0.592 | 0.040 | mm/day |
| 1981 – 2010 | 0.540 | 0.743 | 0.600 | 0.598 | 0.040 | mm/day |
| 2010 – 2039 | 0.572 | 0.785 | 0.642 | 0.635 | 0.042 | mm/day |
| 2040 – 2069 | 0.602 | 0.818 | 0.668 | 0.660 | 0.042 | mm/day |
| 2070 – 2099 | 0.685 | 0.925 | 0.757 | 0.748 | 0.045 | mm/day |

From the highlighted (bold font) projections in Table 4-6, an increase in winter precipitation of 17.9 percent is estimated for the project area for the time period of 2070-2099 compared to the current time period of 2010-2039.

A separate check using the Climate Atlas of Canada⁴ GCM-based projections for Norman Wells, representing the Sahtu South Segment, are shown in Table 4-7. A linear interpolation was applied to the winter precipitation depths between the two time periods of 1976-2005 and 2021-2050 to estimate a 2020 depth of 63.3 mm. An increase in winter precipitation of 15.2 percent is estimated for the project area for the time period of 2051-2080 versus the interpolated precipitation depth for 2020.

² <https://services.pacificclimate.org/pcex/app>

² The models selected for ensemble analysis were: GFDL-ESM2 m; GFDL-ESM2G; GFDL-CM3; CNRM-CM5; CanESM2; and MIROC5

⁴<https://climateatlas.ca>

Table 4-7: Climate Atlas of Canada Winter Precipitation for Norman Wells

| Time Period | Winter Precipitation (mm) |
|----------------------|---------------------------|
| 1976-2005 | 58.0 |
| 2021-2050 | 66.0 |
| 2020, (Interpolated) | 63.3 |
| 2051-2080 | 73.0 |

The PCIC Climate Explorer and Climate Atlas of Canada projections are reasonably consistent. Climate change effects on project area peak flows were estimated using the 17.9 percent increase in winter precipitation from the PCIC data. A linear relationship was assumed between cumulative winter precipitation and freshet magnitude resulting in initial flood flow estimates being increased by 17.9 percent.

4.2.6 Watercourse Crossing Flood Flow Estimates

Following the methods detailed in this report, flood flows for each of the 27 crossings were calculated for various return periods of interest as presented in Table 4-8. The 100-year flows estimates were used in the subsequent preliminary culvert designs discussed in Section 4.4.

Table 4-8: Return Period Flows for Minor Watercourse Crossings

| Crossing ID | Watershed Area (km ²) | Lake Area (%) | Lake Attenuation Factor | Climate Change Adjusted Flood Flow (m ³ /s) | | | |
|-------------|-----------------------------------|---------------|-------------------------|--|---------|----------|----------|
| | | | | 2-Year | 10-Year | 100-Year | 200-Year |
| KM 797.9 | 50.22 | 2.4% | 1.00 | 5.89 | 10.35 | 15.92 | 17.56 |
| KM 805.5 | 37.94 | 5.5% | 0.92 | 4.09 | 7.28 | 11.27 | 12.45 |
| KM 812.7 | 6.41 | 0.0% | 1.00 | 0.77 | 1.48 | 2.39 | 2.66 |
| KM 815.0 | 3.83 | 0.0% | 1.00 | 0.46 | 0.91 | 1.49 | 1.66 |
| KM 820.7 | 15.64 | 1.6% | 1.00 | 1.86 | 3.44 | 5.44 | 6.03 |
| KM 821.9 | 0.30 | 0.0% | 1.00 | 0.04 | 0.08 | 0.14 | 0.16 |
| KM 823.0 | 8.84 | 0.0% | 1.00 | 1.06 | 2.01 | 3.21 | 3.57 |
| KM 826.0 | 1.41 | 1.5% | 1.00 | 0.17 | 0.36 | 0.59 | 0.67 |
| KM 826.3 | 4.30 | 0.7% | 1.00 | 0.52 | 1.02 | 1.66 | 1.85 |
| KM 828.6 | 2.12 | 0.0% | 1.00 | 0.26 | 0.52 | 0.86 | 0.97 |
| KM 834.1 | 3.05 | 0.4% | 1.00 | 0.37 | 0.74 | 1.21 | 1.35 |
| KM 835.0 | 1.32 | 0.0% | 1.00 | 0.16 | 0.33 | 0.56 | 0.62 |
| KM 837.1 | 2.43 | 0.2% | 1.00 | 0.29 | 0.59 | 0.98 | 1.09 |
| KM 843.3 | 2.67 | 0.0% | 1.00 | 0.32 | 0.65 | 1.07 | 1.20 |
| KM 846.4 | 4.25 | 0.0% | 1.00 | 0.51 | 1.01 | 1.64 | 1.83 |
| KM 857.4 | 0.75 | 3.0% | 1.00 | 0.09 | 0.20 | 0.33 | 0.37 |
| KM 872.9 | 1.36 | 0.0% | 1.00 | 0.17 | 0.34 | 0.57 | 0.64 |
| KM 879.1 | 0.22 | 16.6% | 0.25 | 0.01 | 0.02 | 0.03 | 0.03 |

| Crossing ID | Watershed Area (km ²) | Lake Area (%) | Lake Attenuation Factor | Climate Change Adjusted Flood Flow (m ³ /s) | | | |
|-------------|-----------------------------------|---------------|-------------------------|--|---------|----------|----------|
| | | | | 2-Year | 10-Year | 100-Year | 200-Year |
| KM 879.4 | 1.63 | 13.9% | 0.31 | 0.06 | 0.13 | 0.21 | 0.23 |
| KM 880.2 | 0.26 | 39.5% | 0.09 | 0.00 | 0.01 | 0.01 | 0.01 |
| KM 880.6 | 11.40 | 15.2% | 0.28 | 0.38 | 0.71 | 1.13 | 1.26 |
| KM 883.6 | 0.42 | 2.8% | 1.00 | 0.05 | 0.11 | 0.20 | 0.22 |
| KM 884.8 | 8.63 | 13.5% | 0.32 | 0.33 | 0.63 | 1.01 | 1.12 |
| KM 891.4 | 62.26 | 11.7% | 0.38 | 2.75 | 4.78 | 7.32 | 8.06 |
| KM 919.9 | 1.85 | 7.1% | 0.68 | 0.15 | 0.31 | 0.52 | 0.58 |
| KM 940.1 | 2.77 | 2.1% | 1.00 | 0.34 | 0.67 | 1.11 | 1.24 |
| KM 981.2 | 5.36 | 3.2% | 1.00 | 0.64 | 1.25 | 2.03 | 2.26 |

4.2.7 Fish Passage Design Flows

A three-day one-in-ten year delay discharge, referred to as a 3Q10 flow, is sometimes considered for hydraulic designs of fishways and other fish passage structures. As described in Introduction to Fishway Design⁵ (Katopodis, 1992) the method addresses a concern that certain fish species will only tolerate a delay of three days before giving up on their migration and reabsorbing their eggs. Statistically, 3Q10 flows are evaluated from analysis of recorded streamflow data, identifying the fourth highest consecutive mean daily discharge for each year of record, and then conducting a frequency analysis on the resulting series to determine the 10-year quantile.

The hydrotechnical scopes of work for the current MVH Sahtu South Segment, and the prior PCAR, MGAR, and Dehcho Segments, identify 3Q10 flows as a deliverable. It was carried forward from prior GNWT requirements for a hydrotechnical study, awarded to Tetra Tech in 2018, for 31 existing culverts along the Mackenzie Highway, Ingraham Trail, Liard Highway and Dempster Highway. During the development of current 2020/21 hydrotechnical work scopes for the MVH studies, it was assumed that 3Q10 flows would again be required.

Current GNWT design guidelines for Bridges and Bridge Culverts do not specify or require the 3Q10 methodology. Tetra Tech became aware of the current guidelines in 2021 during the preparation of detailed designs for bridge culverts along the PCAR segment. Applicable fish passage requirements are found from Alberta Transportation (AT) publications, specifically Design Guidelines for Bridge Size Culverts⁶ cited by GNWT, and companion AT Bridge Conceptual Design Guidelines⁷ which reject the 3Q10 methodology and recommend a slope-based approach to determine fish passage design flows. The latter document includes appendices with detailed discussions of fish passage design flows and AT concerns with the 3Q10 methodology.

⁵

https://www.enqr.colostate.edu/~pierre/ce_old/classes/ce717/Manuals/Fishway%20design%20Katopodis/1992%20Katopodis%20Introduction%20to%20Fishway%20Design.pdf

⁶ <http://www.transportation.alberta.ca/content/doctype30/production/dsngdlclvapril2012.pdf>

⁷ <https://open.alberta.ca/publications/bridge-conceptual-design-guidelines-version-3-0>

When Tetra Tech applied the AT fish passage flow methodology for a bridge-size culvert along the PCAR segment, the design flow seemed to be unreasonably small compared to the separately-estimated 3Q10 values which are often comparable to a 2-year return period flow. That design was subsequently developed considering a fish passage discharge for a survey-determined bankfull stage, often also similar to a 2-year return period flow.

Because AT guidelines referenced by GNWT do not recommend the 3Q10 method, this report does not provide 3Q10 values for the watercourse crossings. Alternative AT slope-based fish passage flows are not provided because of initial unsatisfactory results using that method. While computed 2-year peak flows presented in this report may be suitable for fish passage designs, we recommend that fish passage flows be assessed on a case-by-case basis when needed, considering the fish species that are present and difficulty and cost of providing a bridge or open-bottom culvert solution to mitigate potential fish passage impacts.

The approach for determining fish passage flows to be used for culvert crossing designs should be confirmed by GNWT with input from fisheries specialists and possibly regulators. The 2-year peak flows such as provided in the present report can potentially be used as a defensible proxy for fish passage flows.

4.3 Preliminary Crossing Designs

The 100-year return period flows, inclusive of estimated climate change effects, developed through Tetra Tech's hydrologic analysis were used as the design events for culvert designs.

Preliminary culvert sizes for each crossing were determined from nomographs published in the Handbook of Steel Drainage and Highway Construction Projects⁸ (Corrugated Steel Pipe Institute, 2007). Design assumed inlet control conditions for non-embedded circular culverts with projecting inlets and a minimum diameter of 800 mm. This minimum diameter is understood to be the present standard for the Northwest Territories. The culverts were sized such that the inlet headwater depth for the 100-year peak flow does not exceed the culvert diameter (a headwater to diameter ratio (HW/D) of 1.0) and is independent of the road embankment height.

Culverts smaller than 1500 mm in diameter can be specified to be corrugated steel pipe (CSP), while culvert larger than 1500 mm will require structural plate corrugated steel pipe (SPCSP).

Summaries of preliminary culvert sizes are presented in Table 4-9.

Table 4-9: Preliminary Proposed Culverts for Minor Watercourse Crossings

| Crossing ID | UTM 10 Easting (m) | UTM 10 Northing (m) | Watershed Area (sq km) | Climate Change Adjusted 100-Year Flow (m ³ /s) | Preliminary Single-Culvert Diameter (mm) | Notes |
|-------------|--------------------|---------------------|------------------------|---|--|---|
| KM 797.9 | 437749 | 7101831 | 50.22 | 15.92 | 3050 | Significant beaver activity at crossing has impacted the ability to estimate maximum allowable headwater elevation from LiDAR and will impact culvert hydraulic performance. Recommend completing a site survey to confirm available headwater and hydraulic modelling to develop culvert crossing design cognizant of downstream backwatering effects. |

⁸https://www.csipi.ca/sites/default/files/download/handbook_chapter04.pdf

| Crossing ID | UTM 10 Easting (m) | UTM 10 Northing (m) | Watershed Area (sq km) | Climate Change Adjusted 100-Year Flow (m³/s) | Preliminary Single-Culvert Diameter (mm) | Notes |
|-------------|--------------------|---------------------|------------------------|--|--|--|
| KM 805.5 | 435588 | 7108256 | 37.94 | 11.27 | 2590 | Insufficient head is available to utilize a single large culvert. Multiple smaller culverts are recommended (5 x 1400 mm) |
| KM 812.7 | 434330 | 7115335 | 6.41 | 2.39 | 1400 | Single Culvert at main coordinates, supplemented by four additional culverts at minor drainages within the segment extending from 200 m south to 200 m north of the main culvert. This is needed to minimize concentration of flow entering the top of gully immediately downstream. |
| KM 815.0 | 432726 | 7117027 | 3.83 | 1.49 | 1200 | Single Culvert |
| KM 820.7 | 433134 | 7121695 | 15.64 | 5.44 | 1970 | Two 1400 mm culverts can be fit in 8 m wide channel and avoid bridge culvert requirements |
| KM 821.9 | 432581 | 7123102 | 0.30 | 0.14 | 800 | Single Culvert; supplemented by six additional culverts at minor drainages within the segment extending from 700 m south to 700 m north of the designated culvert. |
| KM 823.0 | 431979 | 7123969 | 8.84 | 3.21 | 1600 | Single Culvert |
| KM 826.0 | 431008 | 7126447 | 1.41 | 0.59 | 800 | Single Culvert |
| KM 826.3 | 430947 | 7126835 | 4.30 | 1.66 | 1200 | Single Culvert |
| KM 828.6 | 429994 | 7129068 | 2.12 | 0.86 | 900 | Insufficient head (~ 0.7 m) to pass design flow at coordinates. Two 800 mm culverts are recommended instead. Overflow will drain north. An additional culvert will need to be sized for a terminal low point about 130 m northwest of the listed coordinates |
| KM 834.1 | 425726 | 7132183 | 3.05 | 1.21 | 1200 | Single Culvert but recommend increasing capacity to accommodate potential bypass runoff from the 3 km of road north of KM 834.1, that may drain to the terminal low at this location. Additional cross drainage culverts should be added at minor low points along the segment. |
| KM 835.0 | 425407 | 7132984 | 1.32 | 0.56 | 800 | Single Culvert. This watercourse is in the segment that will drain south along the alignment to KM 834.1 if culvert capacity is exceeded. About 1.1 m of head is available before overflow. |
| KM 837.1 | 424624 | 7135021 | 2.43 | 0.98 | 1000 | Single Culvert |
| KM 843.3 | 422302 | 7140425 | 2.67 | 1.07 | 1000 | Insufficient head (< 0.3 m) available prior to bypass flow north along the alignment. Recommend multiple (potentially four) 800 mm diameter culverts within the broad wet area. |

| Crossing ID | UTM 10 Easting (m) | UTM 10 Northing (m) | Watershed Area (sq km) | Climate Change Adjusted 100-Year Flow (m ³ /s) | Preliminary Single-Culvert Diameter (mm) | Notes |
|-------------|--------------------|---------------------|------------------------|---|--|---|
| KM 846.4 | 419957 | 7142711 | 4.25 | 1.64 | 1200 | Single Culvert |
| KM 857.4 | 415860 | 7151193 | 0.75 | 0.33 | 800 | Single Culvert, in a reach significantly affected by beaver activity. Install an additional 1200 mm culvert at a deeper low point located 120 m to the south, which will receive overflow |
| KM 872.9 | 412680 | 7164554 | 1.36 | 0.57 | 800 | Single Culvert |
| KM 879.1 | 411054 | 7169500 | 0.22 | 0.03 | 800 | Single Culvert |
| KM 879.4 | 411210 | 7169865 | 1.63 | 0.21 | 800 | Single Culvert |
| KM 880.2 | 411595 | 7170626 | 0.26 | 0.01 | 800 | Single Culvert |
| KM 880.6 | 411801 | 7171055 | 11.40 | 1.12 | 1000 | Single Culvert |
| KM 883.6 | 411616 | 7173284 | 0.42 | 0.19 | 800 | Single Culvert |
| KM 884.8 | 411300 | 7174637 | 8.63 | 1.00 | 1000 | Single Culvert |
| KM 891.4 | 406838 | 7178354 | 62.26 | 7.29 | 2280 | Single Culvert |
| KM 919.9 | 394957 | 7198774 | 1.85 | 0.51 | 800 | Single Culvert |
| KM 940.1 | 375328 | 7203624 | 2.77 | 1.11 | 1000 | Single Culvert |
| KM 981.2 | 629355 (Zone 9) | 7227772 (Zone 9) | 5.36 | 2.03 | 1400 | Single Culvert |

Following the completion of road and embankment design, crossing profiles should be developed for each of the proposed culvert crossings. Preliminary embankment heights are needed to assess available culvert cover heights and the location of the toe of upstream embankment. The preliminary toe of upstream embankment is required to: (1) identify the low areas where culvert inlets should be placed to minimize ponding in areas without defined channels; and (2) confirm the amount of head available before bypass flow occurs down the alignment.

Section profiles perpendicular to the alignment will allow for detailed hydraulic modelling which will provide accurate headwater depths, peak flows, and peak water velocities through the proposed culverts. This is required for confirmation of design sizes and design of scour and erosion protection measures, both of which should be completed prior to tendering and construction.

5.0 CLOSURE

We trust this document meets your present requirements. If you have any questions or comments, please contact the undersigned.

Respectfully submitted,
Tetra Tech Canada Inc.


FILE: 704-ENG.WTRI03067-01
FILE: 704-ENG.WTRI03067-01
FILE: 704-ENG.WTRI03067-01

Prepared by:
Mark Aylward-Nally, P.Eng. (BC)
Water Resources Engineer
Direct Line: 778.945.5894
Mark.AylwardNally@tetrtech.com

FILE: 704-ENG.WTRI03067-01
FILE: 704-ENG.WTRI03067-01
FILE: 704-ENG.WTRI03067-01

Reviewed by:
Bill Rozeboom, P.Eng.
Principal Specialist – Water Resources
Direct Line: 587.460.3611
Bill.Rozeboom@tetrtech.com

| | |
|--|---|
| PERMIT TO PRACTICE | |
| TETRA TECH CANADA INC. | |
| Signature |  |
| Date | May 26, 2021 |
| PERMIT NUMBER: P 018 | |
| NT/NU Association of Professional Engineers and Geoscientists | |

REFERENCES

Corrugated Steel Pipe Institute. (2007, November). *Handbook of Steel Drainage & Highway Construction Products*. Cambridge, Ontario, Canada.

EBA, A Tetra Tech Company. (2011). *Project Description Report for Construction of the Mackenzie Valley Highway Tulita District, Sahtu Settlement Area*. Retrieved from https://reviewboard.ca/upload/project_document/EA1213-02_Project_Description_Report_Pehdzeh_Ki_Ndeh_-_Dehcho_Region.PDF

Pacific Climate Impacts Consortium. (2013). *PCIC Climate Explorer*. Retrieved from Pacific Climate Impacts Consortium: https://services.pacificclimate.org/pcex/app/#/data/climo/ce_files

Tetra Tech. (2021). *Mackenzie Valley Highway Dehcho Segment Hydrotechnical Assessments* GNWT Service Contract SC-4306.

Tetra Tech. (2021). *Mackenzie Valley Highway Mount Gaudet Access Road Hydrotechnical Assessments*.

Tetra Tech. (2021). *Mackenzie Valley Highway Prohibition Creek Access Road Hydrotechnical Assessments*.

The Prairie Climate Centre. (2019, July 10). *Find & Display Local Data*. Retrieved from The Climate Atlas of Canada: <https://climateatlas.ca/>

APPENDIX A

TETRA TECH'S LIMITATIONS ON THE USE OF THIS DOCUMENT

LIMITATIONS ON USE OF THIS DOCUMENT

HYDROTECHNICAL

1.1 USE OF DOCUMENT AND OWNERSHIP

This document pertains to a specific site, a specific development, and a specific scope of work. The document may include plans, drawings, profiles and other supporting documents that collectively constitute the document (the "Professional Document").

The Professional Document is intended for the sole use of TETRA TECH's Client (the "Client") as specifically identified in the TETRA TECH Services Agreement or other Contractual Agreement entered into with the Client (either of which is termed the "Contract" herein). TETRA TECH does not accept any responsibility for the accuracy of any of the data, analyses, recommendations or other contents of the Professional Document when it is used or relied upon by any party other than the Client, unless authorized in writing by TETRA TECH.

Any unauthorized use of the Professional Document is at the sole risk of the user. TETRA TECH accepts no responsibility whatsoever for any loss or damage where such loss or damage is alleged to be or, is in fact, caused by the unauthorized use of the Professional Document.

Where TETRA TECH has expressly authorized the use of the Professional Document by a third party (an "Authorized Party"), consideration for such authorization is the Authorized Party's acceptance of these Limitations on Use of this Document as well as any limitations on liability contained in the Contract with the Client (all of which is collectively termed the "Limitations on Liability"). The Authorized Party should carefully review both these Limitations on Use of this Document and the Contract prior to making any use of the Professional Document. Any use made of the Professional Document by an Authorized Party constitutes the Authorized Party's express acceptance of, and agreement to, the Limitations on Liability.

The Professional Document and any other form or type of data or documents generated by TETRA TECH during the performance of the work are TETRA TECH's professional work product and shall remain the copyright property of TETRA TECH.

The Professional Document is subject to copyright and shall not be reproduced either wholly or in part without the prior, written permission of TETRA TECH. Additional copies of the Document, if required, may be obtained upon request.

1.2 ALTERNATIVE DOCUMENT FORMAT

Where TETRA TECH submits electronic file and/or hard copy versions of the Professional Document or any drawings or other project-related documents and deliverables (collectively termed TETRA TECH's "Instruments of Professional Service"), only the signed and/or sealed versions shall be considered final. The original signed and/or sealed electronic file and/or hard copy version archived by TETRA TECH shall be deemed to be the original. TETRA TECH will archive a protected digital copy of the original signed and/or sealed version for a period of 10 years.

Both electronic file and/or hard copy versions of TETRA TECH's Instruments of Professional Service shall not, under any circumstances, be altered by any party except TETRA TECH. TETRA TECH's Instruments of Professional Service will be used only and exactly as submitted by TETRA TECH.

Electronic files submitted by TETRA TECH have been prepared and submitted using specific software and hardware systems. TETRA TECH makes no representation about the compatibility of these files with the Client's current or future software and hardware systems.

1.3 STANDARD OF CARE

Services performed by TETRA TECH for the Professional Document have been conducted in accordance with the Contract, in a manner consistent with the level of skill ordinarily exercised by members of the profession currently practicing under similar conditions in the jurisdiction in which the services are provided. Professional judgment has been applied in developing the conclusions and/or recommendations provided in this Professional Document. No warranty or guarantee, express or implied, is made concerning the test results, comments, recommendations, or any other portion of the Professional Document.

If any error or omission is detected by the Client or an Authorized Party, the error or omission must be immediately brought to the attention of TETRA TECH.

1.4 DISCLOSURE OF INFORMATION BY CLIENT

The Client acknowledges that it has fully cooperated with TETRA TECH with respect to the provision of all available information on the past, present, and proposed conditions on the site, including historical information respecting the use of the site. The Client further acknowledges that in order for TETRA TECH to properly provide the services contracted for in the Contract, TETRA TECH has relied upon the Client with respect to both the full disclosure and accuracy of any such information.

1.5 INFORMATION PROVIDED TO TETRA TECH BY OTHERS

During the performance of the work and the preparation of this Professional Document, TETRA TECH may have relied on information provided by third parties other than the Client.

While TETRA TECH endeavours to verify the accuracy of such information, TETRA TECH accepts no responsibility for the accuracy or the reliability of such information even where inaccurate or unreliable information impacts any recommendations, design or other deliverables and causes the Client or an Authorized Party loss or damage.

1.6 GENERAL LIMITATIONS OF DOCUMENT

This Professional Document is based solely on the conditions presented and the data available to TETRA TECH at the time the data were collected in the field or gathered from available databases.

The Client, and any Authorized Party, acknowledges that the Professional Document is based on limited data and that the conclusions, opinions, and recommendations contained in the Professional Document are the result of the application of professional judgment to such limited data.

The Professional Document is not applicable to any other sites, nor should it be relied upon for types of development other than those to which it refers. Any variation from the site conditions present, or variation in assumed conditions which might form the basis of design or recommendations as outlined in this report, at or on the development proposed as of the date of the Professional Document requires a supplementary exploration, investigation, and assessment.

TETRA TECH is neither qualified to, nor is it making, any recommendations with respect to the purchase, sale, investment or development of the property, the decisions on which are the sole responsibility of the Client.

1.7 ENVIRONMENTAL AND REGULATORY ISSUES

Unless expressly agreed to in the Services Agreement, TETRA TECH was not retained to explore, address or consider, and has not explored, addressed or considered any environmental or regulatory issues associated with the project.

1.8 LEVEL OF RISK

It is incumbent upon the Client and any Authorized Party, to be knowledgeable of the level of risk that has been incorporated into the project design, in consideration of the level of the hydrotechnical information that was reasonably acquired to facilitate completion of the design.

APPENDIX B

SAHTU SOUTH SEGMENT FIELD PHOTOS



Photo 1: KM 797.9 (1 of 4) - Looking north (upstream) at PDR alignment.



Photo 2: KM 797.9 (2 of 4) - Looking northeast (upstream) at PDR alignment.



Photo 3: KM 797.9 (3 of 4) - Looking southwest (downstream) from PDR alignment.
Site is backwatered by beaver dams downstream.



Photo 4: KM 797.9 (4 of 4) - Looking southwest (downstream) approximately 30 m upstream
of PDR alignment. Channelized watercourse with large amount of woody debris.



Photo 5: KM 805.5 (1 of 2) - Looking north along PDR alignment at crossing location. Two distinguishable channels within an approximately 30m wide wetland.

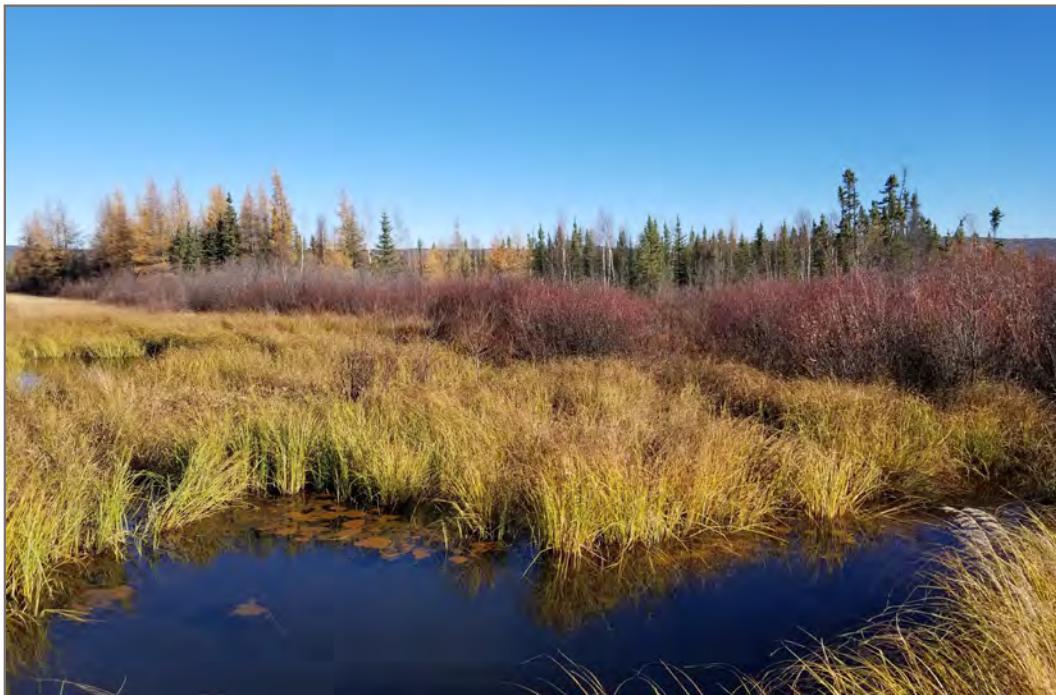


Photo 6: KM 805.5 (2 of 2) - Looking northeast (upstream) from PDR alignment. No defined channels within upstream wetland.



Photo 7: KM 812.7 (1 of 5) - Looking north (upstream) at PDR alignment. Channel is small at this location with only 2 L/s of flow observed.



Photo 8: KM 812.7 (2 of 5) – Looking southeast (downstream) at PDR alignment.



Photo 9: KM 812.7 (3 of 5) - Looking southeast (upstream) at downstream side of existing wooden bridge structure on winter road, downstream of proposed crossing.



Photo 10: KM 812.7 (4 of 5) – Looking east (upstream) approximately 200m downstream of proposed crossing. Flow ~8 L/s.



Photo 11: KM 812.7 (5 of 5) - Looking southeast (upstream) at a wide neighbouring channel approximately 150m southwest of 812.7. Stagnant water. No visible flow during site inspection.



Photo 12: KM 815 (1 of 3) - Looking west (upstream) approximately 25m upstream of proposed crossing. Defined channel with cobble + gravel substrate and above average levels of woody debris.



Photo 13: KM 815 (2 of 3) - Looking east (downstream) approximately 100m downstream of proposed crossing. 5 L/s, some woody debris, substrate gravel and sand.



Photo 14: KM 815 (3 of 3) – Looking east (downstream) approximately 200m downstream of proposed crossing. Water has dispersed into numerous braids. No defined channel.



Photo 15: KM 820.7 (1 of 6) - Looking west (downstream). Low flow is predominately contained within a single channel. Banks comprised of wetland type vegetation, likely inundated during freshet and summer.



Photo 16: KM 820.7 (2 of 6) – Looking east (upstream) at proposed crossing. Wetted width is 10m, but probably increases to 20-30m during freshet.



Photo 17: KM 820.7 (3 of 6) – Looking northeast (upstream) approximately 60m downstream of PDR alignment. Wide wetland area with a single main flowpath but no defined channel features.



Photo 18: KM 820.7 (4 of 6) – Looking north (upstream) approximately 150m downstream of PDR alignment. A 900 and 600mm culvert sit along winter road alignment. Flow rechannellizes at this location.



Photo 19: KM 820.7 (5 of 6) – Looking west (downstream) approximately 300m downstream of PDR alignment.



Photo 20: KM 820.7 (6 of 6) – Looking east (upstream) approximately 30m upstream of proposed crossing. No defined channel as flow emerges from this wetland area.



Photo 21: KM 821.9 (1 of 3) – Looking east (upstream) from PDR alignment. Small but defined channel. Trickle of flow.



Photo 22: KM 821.9 (2 of 3) – Looking east (upstream) approximately 300m downstream of PDR alignment.



Photo 23: KM 821.9 (3 of 3) – Looking east (upstream) approximately 50m upstream of PDR alignment.



Photo 24: KM 823 (1 of 4) – Looking south along PDR alignment at watercourse valley.



Photo 25: KM 823 (2 of 4) – Looking west (downstream) at existing culvert within crossing used for winter road.



Photo 26: KM 823 (3 of 4) – Looking east (upstream) immediately upstream of crossing. Small but defined channel. Substrate comprised of small rounded boulders and cobbles.



Photo 27: KM 823 (4 of 4) – Looking west (downstream) approximately 100m downstream of alignment.



Photo 28: KM 826 (1 of 4) – Looking east (upstream) at crossing location. Wetland and lake are upstream, stagnant flow channelized through the PDR alignment.



Photo 29: KM 826 (2 of 4) – Looking southwest (downstream) from crossing location. Stagnant 1.5m wide channel.



Photo 30: KM 826 (3 of 4) – Looking east (upstream) approximately 300m downstream of PDR alignment. Poorly defined channel. ~0.5 L/s.



Photo 31: KM 826 (4 of 4) – Looking east (upstream) at wetland and lake approximately 75m upstream of PDR alignment.



Photo 32: KM 826.3 (1 of 4) – Looking east (upstream) from PDR alignment. Overgrown and poorly defined channel.



Photo 33: KM 826.3 (2 of 4) – Looking west (downstream) from PDR alignment. Overgrown and poorly defined channel.

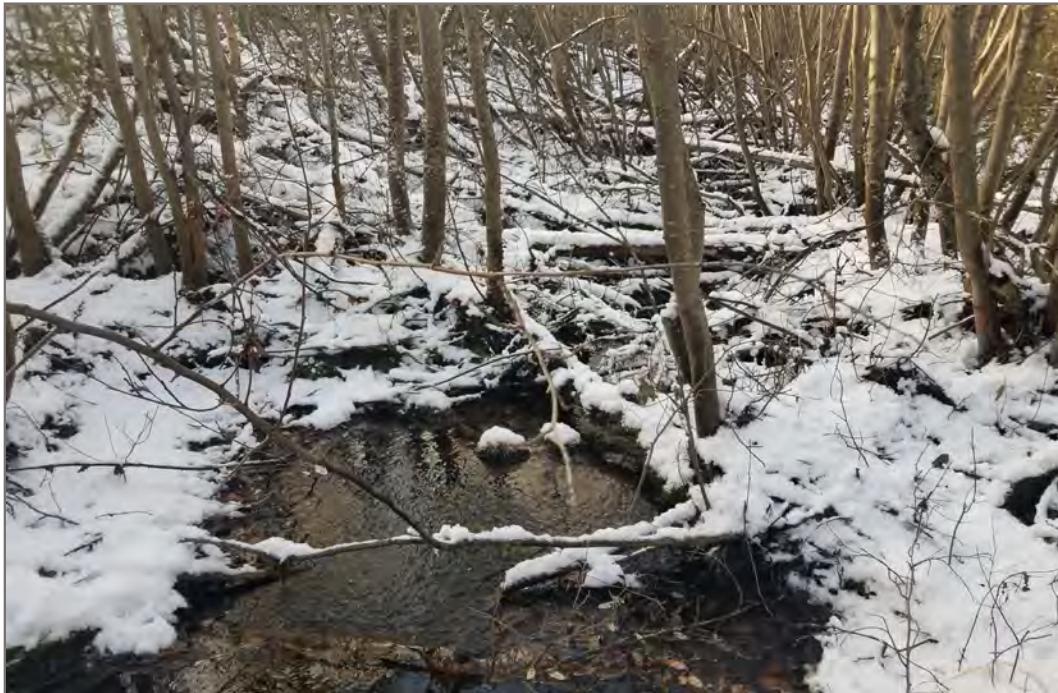


Photo 34: KM 826.3 (3 of 4) – Looking west (downstream) approximately 250m downstream of PDR alignment. Poorly defined channel with much woody debris.



Photo 35: KM 826.3 (4 of 4) – Looking east (upstream) approximately 100m upstream of PDR alignment. No defined channel.



Photo 36: KM 828.6 (1 of 4) – Looking northwest at watercourse crossing winter road and PDR alignments.



Photo 37: KM 828.6 (2 of 4) – Looking northeast (upstream) from PDR alignment.
Small incised channel.



Photo 38: KM 828.6 (3 of 4) – Looking east (upstream) approximately 200m downstream of proposed crossing.



Photo 39: KM 828.6 (4 of 4) – Looking east (upstream) approximately 100m upstream of proposed crossing. Flow contained within defined channel.



Photo 40: KM 834.1 (1 of 2) – Looking east (upstream) from PDR alignment. Poorly defined channel.



Photo 41: KM 834.1 (2 of 2) – Looking west (downstream) from PDR alignment.



Photo 42: KM 835 (1 of 2) – Looking northwest (upstream) from PDR alignment. Channel covered in snow; no water visible.



Photo 43: KM 835 (2 of 2) – Looking east (upstream) approximately 100m upstream of PDR alignment. Small channel snowed over.



Photo 44: KM 837.1 (1 of 4) – Looking east (upstream) from PDR alignment.



Photo 45: KM 837.1 (2 of 4) – Looking west (downstream) from PDR alignment.



Photo 46: KM 837.1 (3 of 4) – Looking east (upstream) approximately 100m upstream of PDR alignment. Defined channel with rounded boulders and cobble substrate.



Photo 47: KM 837.1 (4 of 4) – Looking northeast (upstream) approximately 250m downstream of PDR alignment where watercourse crosses Enbridge pipeline. 1m wetted top width. Cobble and gravel substrate.



Photo 48: KM 843.3 (1 of 6) – Looking south along PDR alignment at crossing location. No defined channel, water is shallow and spread out as it seeps across the alignment.



Photo 49: KM 843.3 (2 of 6) – Looking northwest (downstream) from PDR alignment.



Photo 50: KM 843.3 (3 of 6) – Looking northwest (downstream) approximately 50m downstream of alignment. Area is flooded, no defined channel.



Photo 51: KM 843.3 (4 of 6) – Looking west (downstream) approximately 100m downstream of alignment. Area flooded ~25m wide, water split into many braids



Photo 52: KM 843.3 (5 of 6) – Looking east (upstream) immediately upstream of crossing location at one of two channels that approach the crossing. This one the northernmost of the two and stagnant.



Photo 53: KM 843.3 (6 of 6) – Looking southeast (upstream) upstream of crossing location at one of two channels that approach the crossing. This one the southernmost of the two, with a trickle of flow.



Photo 54: KM 846.4 (1 of 4) – Looking northwest (upstream) at PDR alignment. Water is spread 12m wide as it flows across alignment. No defined channel



Photo 55: KM 846.4 (2 of 4) – Looking east (upstream) from PDR alignment. Inflow spread out with no defined channels upstream of crossing.



Photo 56: KM 846.4 (3 of 4) – Looking west (downstream) at PDR alignment. Flow collects within a defined channel shortly downstream of alignment.



Photo 57: KM 846.4 (4 of 4) – Looking northeast (upstream) approximately 100m downstream of PDR alignment. Flow has channelized in slow moving channel. 2.2m wide x 0.6m deep



Photo 58: KM 857.4 (1 of 5) – Looking north (upstream) from PDR alignment. Two small beaver dams immediately upstream of crossing have flooded entire upstream area.



Photo 59: KM 857.4 (2 of 5) – Looking south (downstream) at beaver dam immediately upstream of PDR alignment and small channel crossing alignment.



Photo 60: KM 857.4 (3 of 5) – Looking southeast (downstream) from PDR alignment. Flow collects in small channel.



Photo 61: KM 857.4 (4 of 5) – Looking southeast (downstream) approximately 200m downstream. Entire downstream area is flooded by a series of beaver dams.



Photo 62: KM 857.4 (5 of 5) – Looking southwest (downstream) approximately 50m upstream of PDR alignment. Entire area flooded by beaver activity.



Photo 63: KM 872.9 (1 of 3) – Looking northeast (upstream) at watercourse from air. Entire area is wetland with no defined channel. 500mm culvert from winter road visible.



Photo 64: KM 872.9 (2 of 3) – Looking northeast (upstream) from PDR alignment at upstream wetland. Standing on existing wooden bridge structure.



Photo 65: KM 872.9 (3 of 3) – Looking southwest (downstream) within wetland approximately 60m upstream of PDR alignment.



Photo 66: KM 879.1 (1 of 2) – Looking west (upstream) from PDR alignment. Upstream area is entirely wetland/lake.



Photo 67: KM 879.1 (2 of 2) – Looking southeast (downstream) from PDR alignment. Water contained within a stagnant channel, enters a lake approximately 70m downstream of crossing.



Photo 68: KM 879.4 (1 of 2) – Looking east (upstream) from PDR alignment. Water is spread with approximately 5m top width. Lake outlet located approximately 100m upstream.



Photo 69: KM 879.4 (2 of 2) – Looking west (downstream) approximately 200m downstream of PDR alignment. Flow is channelized within small channel set in deep valley. ~10L/s



Photo 70: KM 880.2 (1 of 3) – Looking southeast (upstream) at PDR alignment. Flow is confined within small overgrown channel.



Photo 71: KM 880.2 (2 of 3) – Looking southeast (upstream) approximately 100m upstream of PDR alignment. Area is marshy with no defined channels.



Photo 72: KM 880.2 (3 of 3) – Looking southeast (upstream) from winter road approximately 25m downstream of PDR alignment.

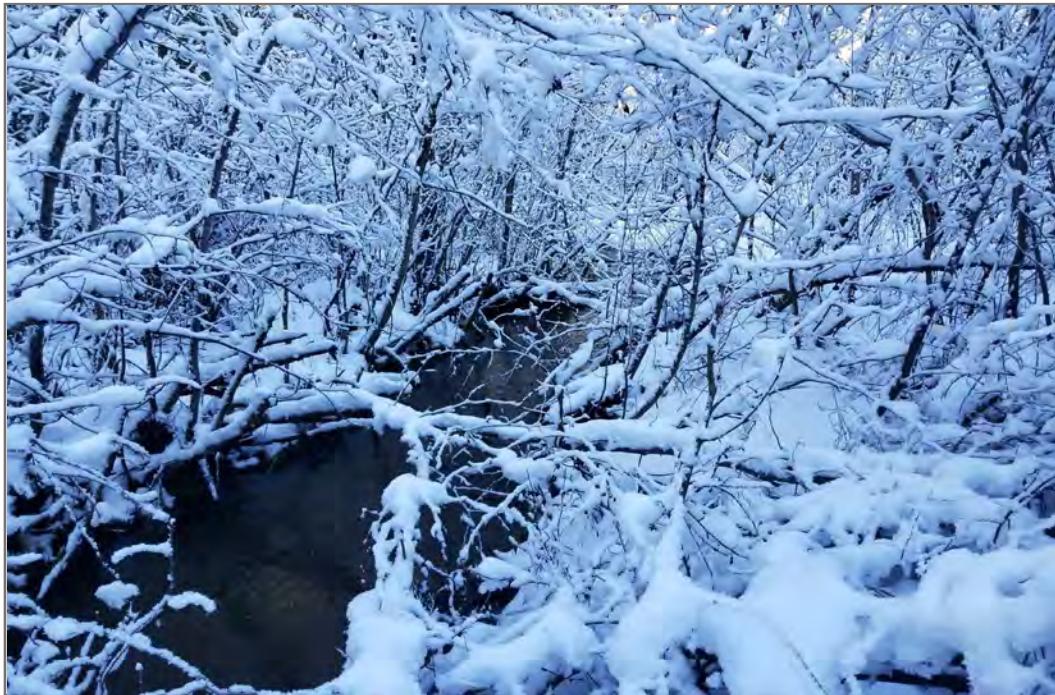


Photo 73: KM 880.6 (1 of 4) – Looking east (upstream) at PDR alignment.



Photo 74: KM 880.6 (2 of 4) – Looking southwest (downstream) approximately 100m downstream of PDR alignment at Enbridge pipeline alignment. Channellized flow ~50 L/s



Photo 75: KM 880.6 (3 of 4) – Looking west (downstream) approximately 300m downstream of PDR alignment. Flow channelized with minimal debris.



Photo 76: KM 880.6 (4 of 4) – Looking west (downstream) approximately 100m upstream of PDR alignment.



Photo 77: KM 883.6 (1 of 5) – Looking south along PDR alignment. Crossing 883.6 visible in foreground, a second minor drainage visible further south.



Photo 78: KM 883.6 (2 of 5) – Looking east (upstream) from PDR alignment.



Photo 79: KM 883.6 (3 of 5) – Looking west (downstream) from PDR alignment.



Photo 80: KM 883.6 (4 of 5) – Looking east (upstream) approximately 300m downstream of PDR alignment. Eroded banks and much debris in channel. ~ 1.5 L/s.



Photo 81: KM 883.6 (5 of 5) – Looking southeast (upstream) approximately 50m upstream of PDR alignment, while on Enbridge pipeline alignment. Stagnant water with no defined channel.



Photo 82: KM 884.8 (1 of 5) – Looking southwest (downstream). PDR alignment is further downstream than the visible Enbridge and Winter Road alignments.



Photo 83: KM 884.8 (2 of 5) – Looking east (upstream) from winter road alignment, approximately 150m upstream of PDR alignment.



Photo 84: KM 884.8 (3 of 5) – Looking southwest (downstream) from winter road alignment. Area was flooded an extra 1.5m by a beaver dam which was removed last year.



Photo 85: KM 884.8 (4 of 5) – Looking west (downstream) at PDR alignment. Staining on trees indicates area was previously flooded by beaver dams ~2m higher than current water level.



Photo 86: KM 884.8 (5 of 5) – Looking west (downstream) approximately 200m downstream of PDR alignment. 12 L/s in defined 1m x 0.3m deep channel.



Photo 87: KM 891.4 (1 of 5) – Looking southwest (downstream). PDR crosses watercourse approximately 100m downstream of lake outlet.

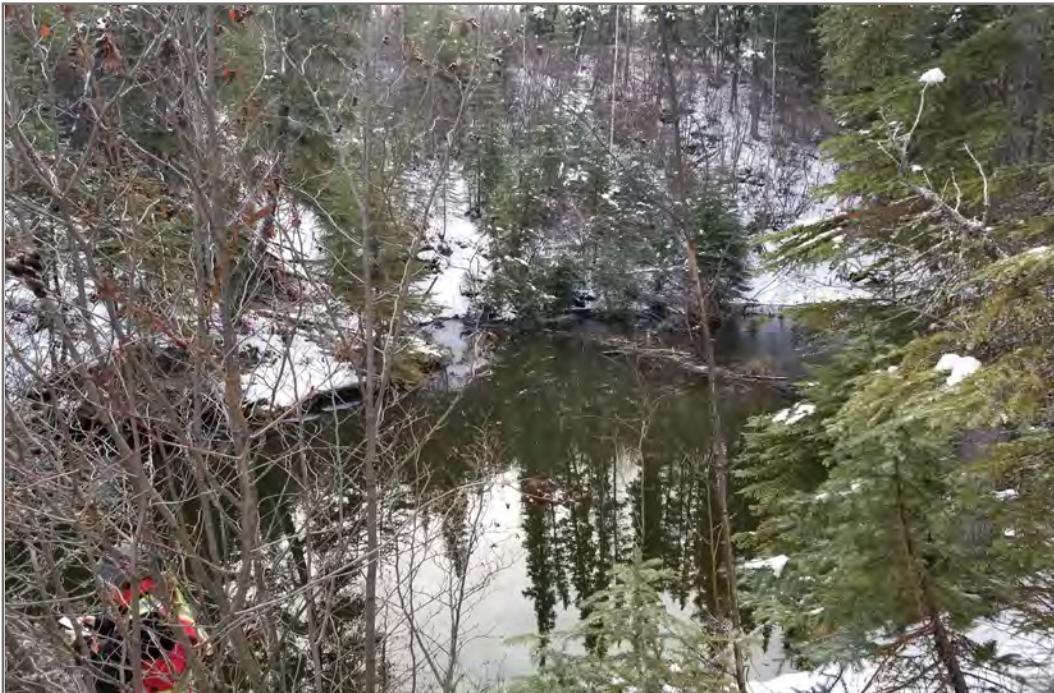


Photo 88: KM 891.4 (2 of 5) – Looking southwest (downstream) from 25m upstream of PDR alignment. Beaver dam visible along PDR alignment Site is flooded as obvious banks are visible 30cm below the water surface.



Photo 89: KM 891.4 (3 of 5) – Looking south (downstream) at PDR alignment. Erosion on left bank immediately downstream of PDR alignment. Large woody debris present within channel.



Photo 90: KM 891.4 (4 of 5) – Looking northeast (upstream) at lake outlet PDR alignment.



Photo 91: KM 891.4 (5 of 5) – Looking south (downstream) approximately 100m downstream of alignment. Water is flowing freely, no longer backwatered



Photo 92: KM 919.9 (1 of 4) – Looking east along PDR alignment. A 600mm culvert backfilled with crushed rock span exists at this crossing.



Photo 93: KM 919.9 (2 of 4) – Looking southeast (upstream) from PDR at lake/wetland immediately upstream of crossing.



Photo 94: KM 919.9 (3 of 4) – Looking north (downstream) from PDR. Site is backwatered by a beaver dam ~50m downstream.



Photo 95: KM 919.9 (4 of 4) – Looking south (upstream) approximately 60m downstream of PDR. Beaver dam and impounded water visible through foliage.



Photo 96: KM 940.1 (1 of 4) – Looking north (upstream) across PDR and Enbridge alignments. Channel alignment visible by changes in vegetation.



Photo 97: KM 940.1 (2 of 4) – Looking north (upstream) at PDR alignment. Water channelized in a heavily overgrown channel.



Photo 98: KM 940.1 (3 of 4) – Looking south (downstream) at PDR alignment. Water channelized in a heavily overgrown channel.



Photo 99: KM 940.1 (4 of 4) – Looking north (upstream) approximately 100m upstream of PDR alignment. Water flowing in heavily vegetated creek valley.

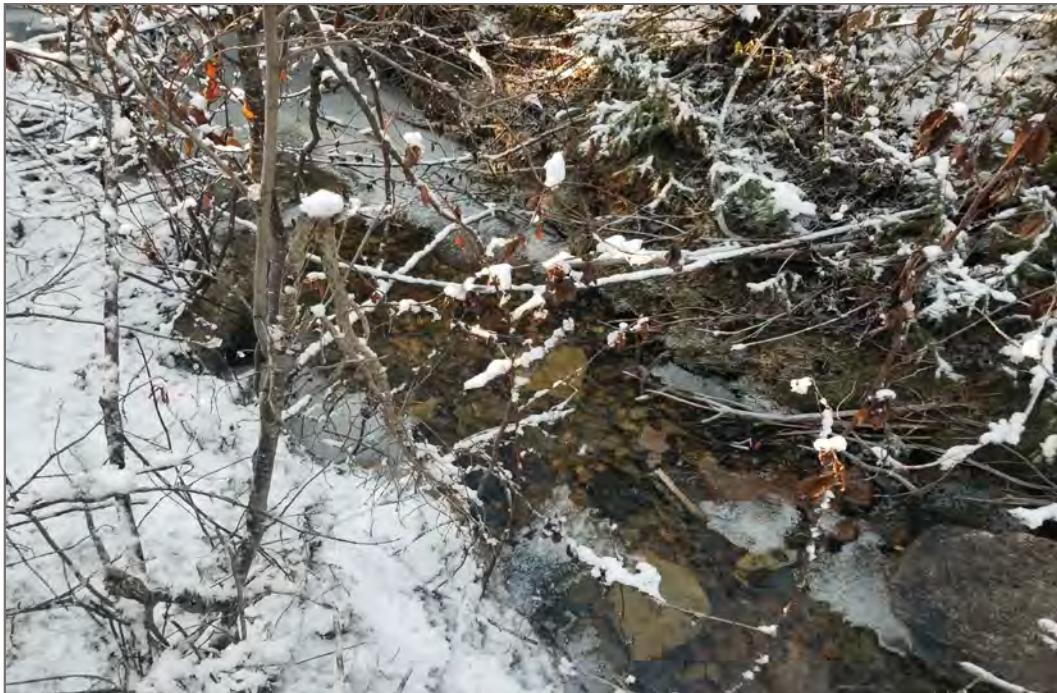


Photo 100: KM 981.2 (1 of 3) – Looking northeast (upstream) at PDR alignment. Substrate comprised of cobbles and gravel with some boulders.



Photo 101: KM 981.2 (2 of 3) – Looking south (downstream) from PDR alignment. Defined channel 2.2m wide by 0.8m high at bank full.

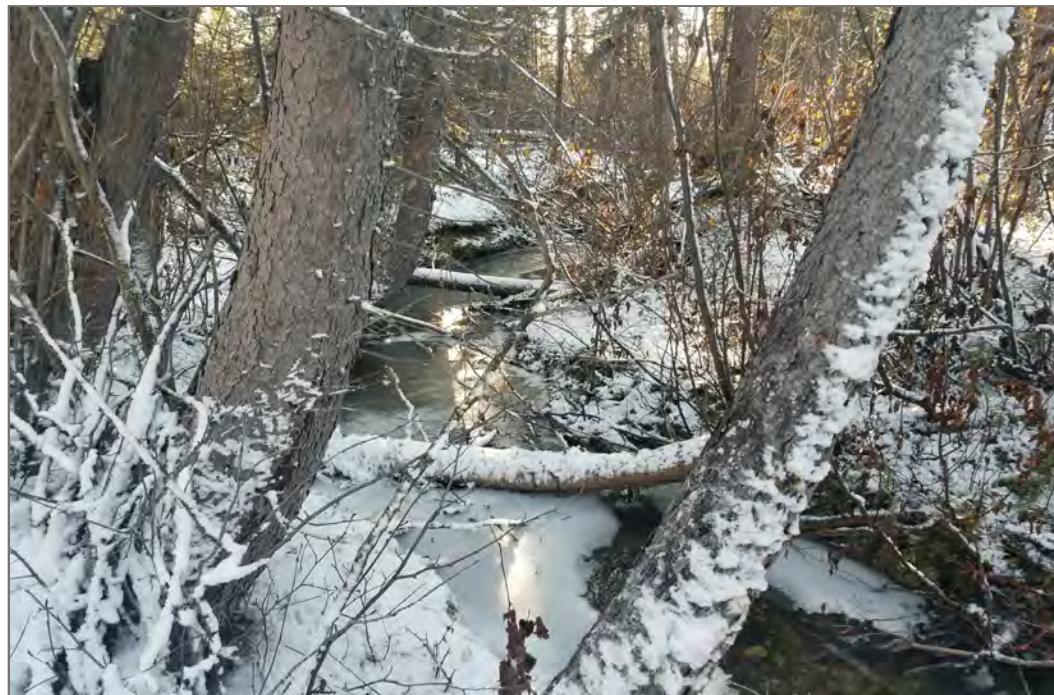
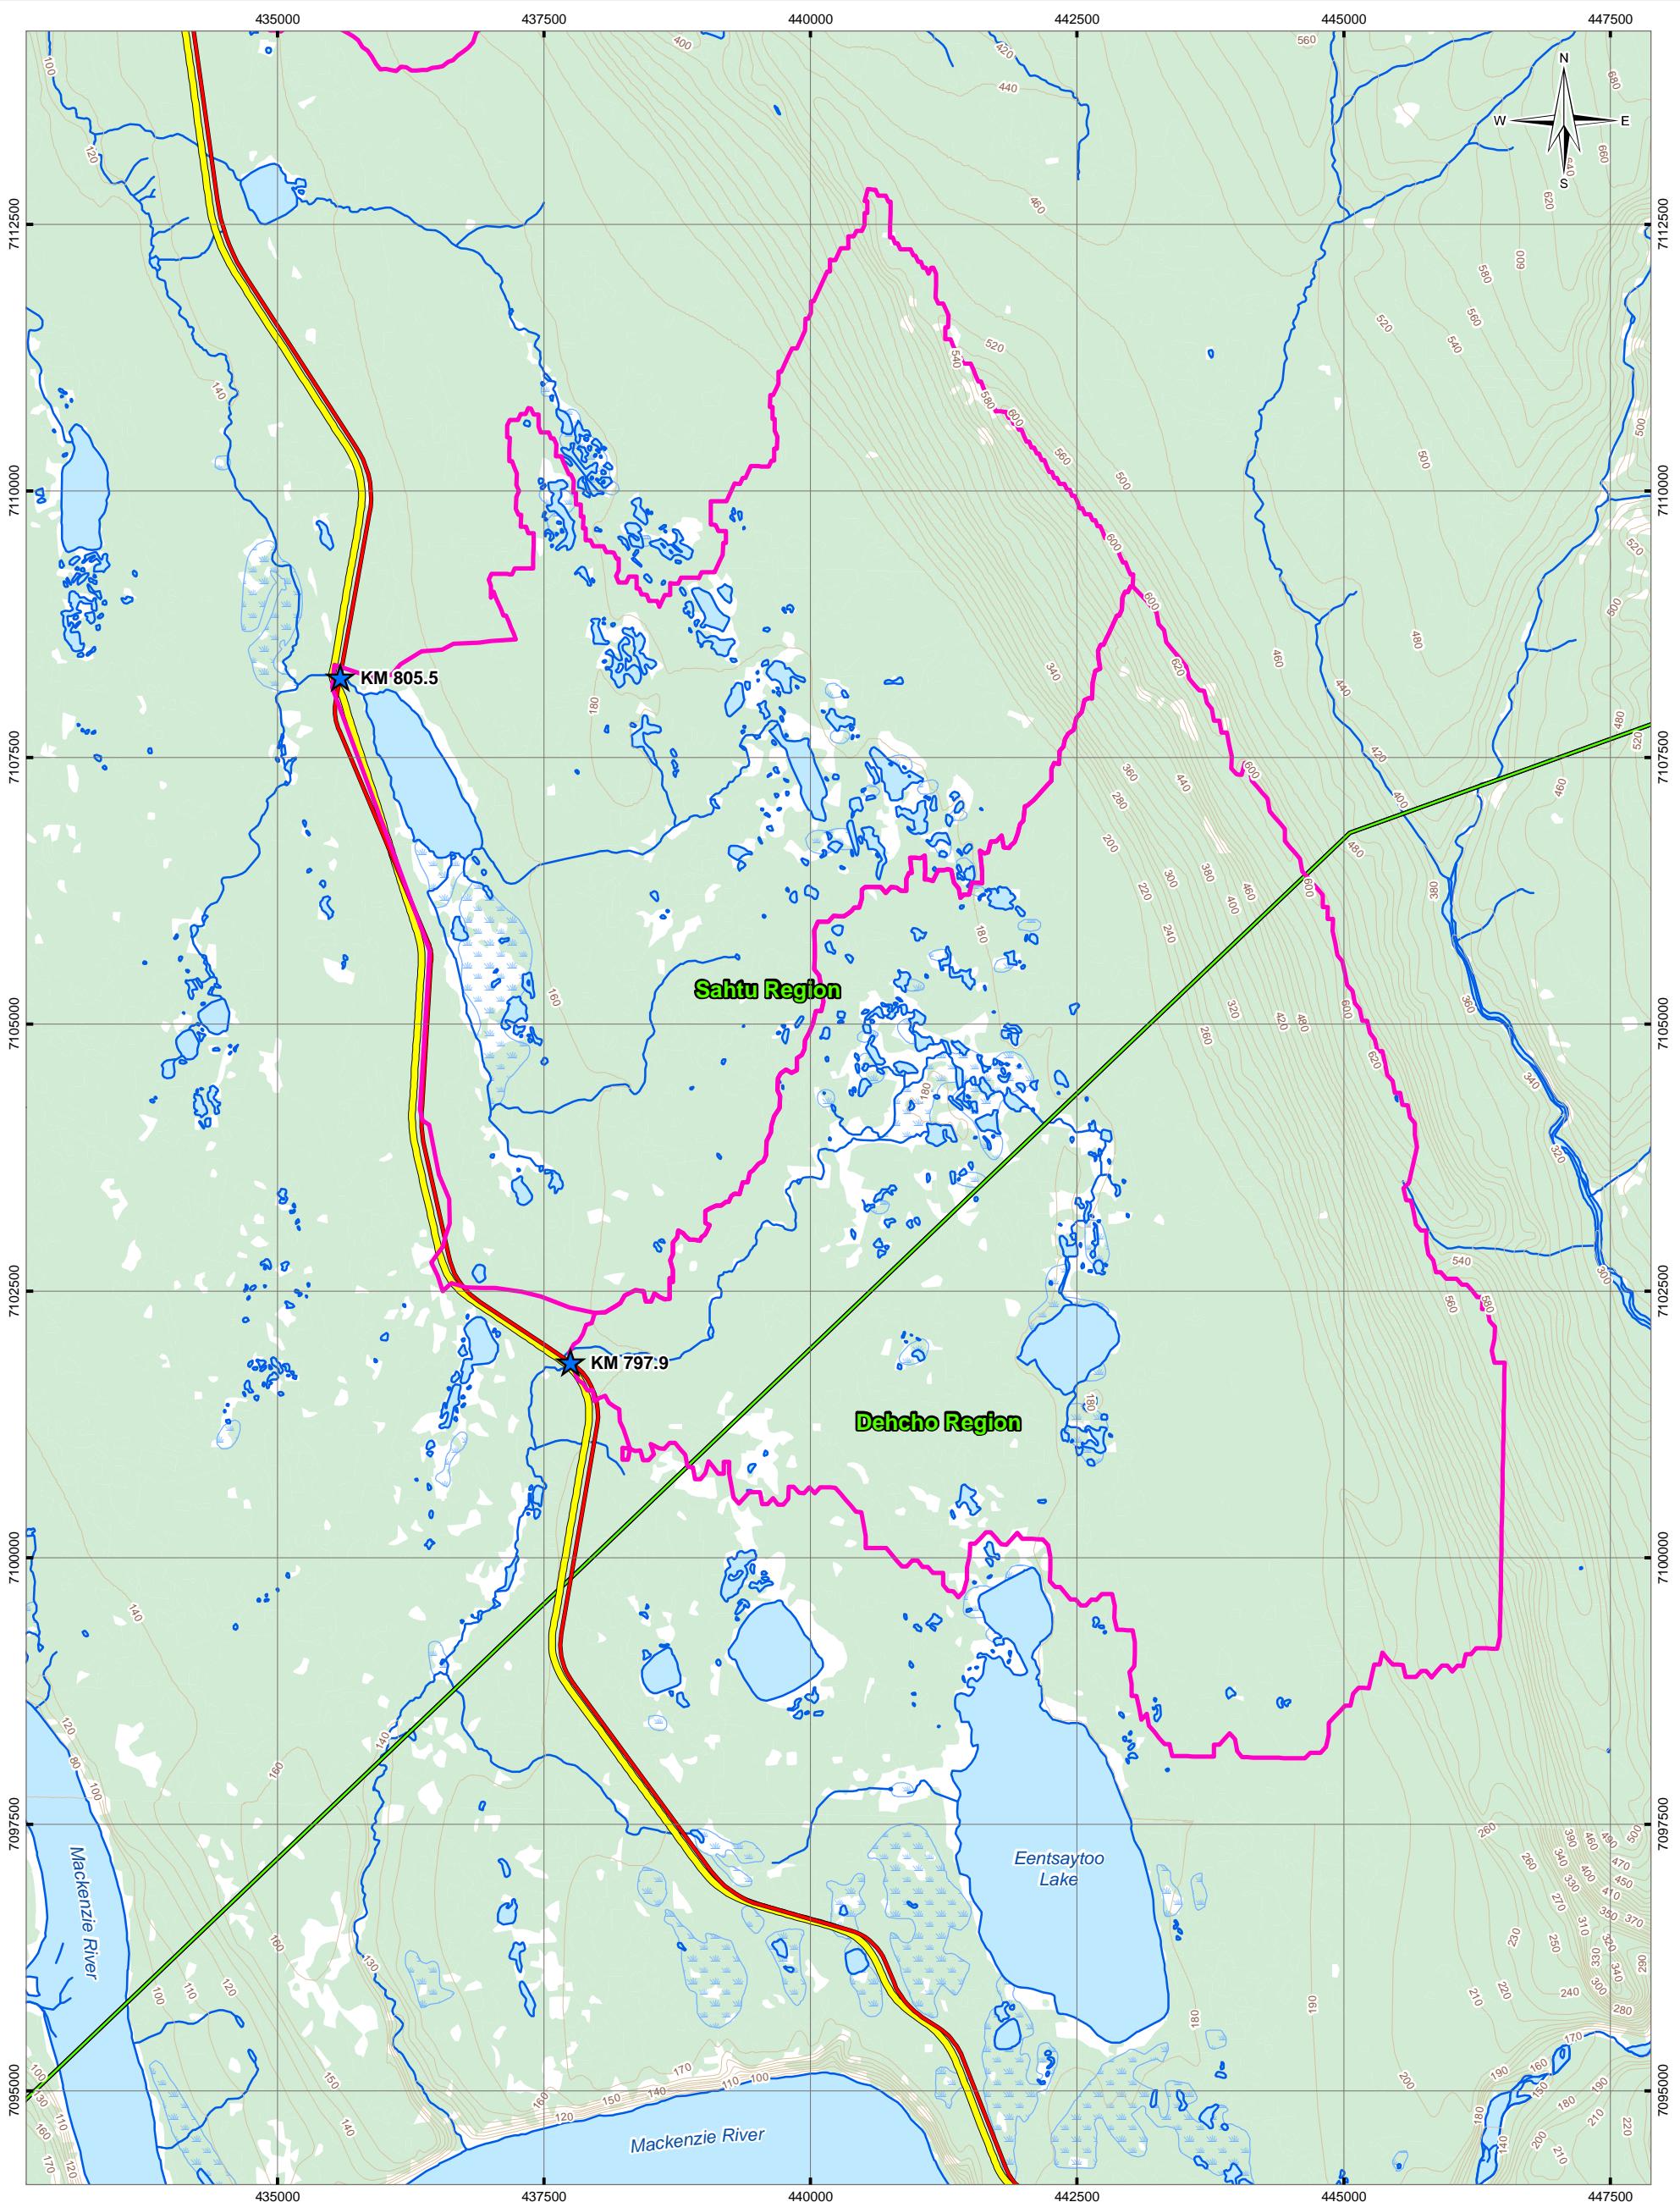


Photo 102: KM 981.2 (3 of 3) – Looking south (downstream) approximately 100m downstream of alignment. Wetted width = 1.35m, defined banks 2 to 2.5m wide.

APPENDIX C

MINOR WATERCOURSE DRAINAGE BASINS

**LEGEND**


- Drainage Basin
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area


NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar

STATUS
 ISSUED FOR USE

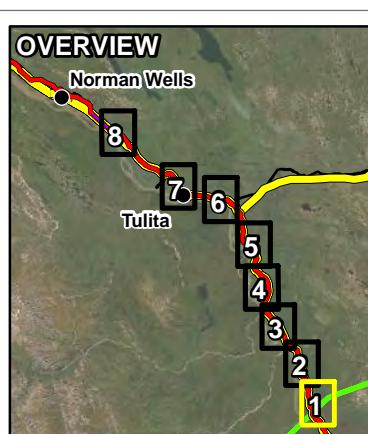**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

| PROJECTION UTM Zone 10 | | DATUM NAD83 | CLIENT Northwest Territories |
|---------------------------|--------------------------------------|----------------------------|---------------------------------|
| Scale: 1:60,000 | | 1 0.5 0 1 | TETRA TECH |
| | | Kilometres | |
| FILE NO. | WTRI03067-01_FigC_DrainageBasins.mxd | | |
| OFFICE | Tt-VANC | DWN SL CKD BB APVD MAN REV | 0 |
| DATE | May 25, 2022 | PROJECT NO. | ENG.WTRI03067-01 |

Figure C-1

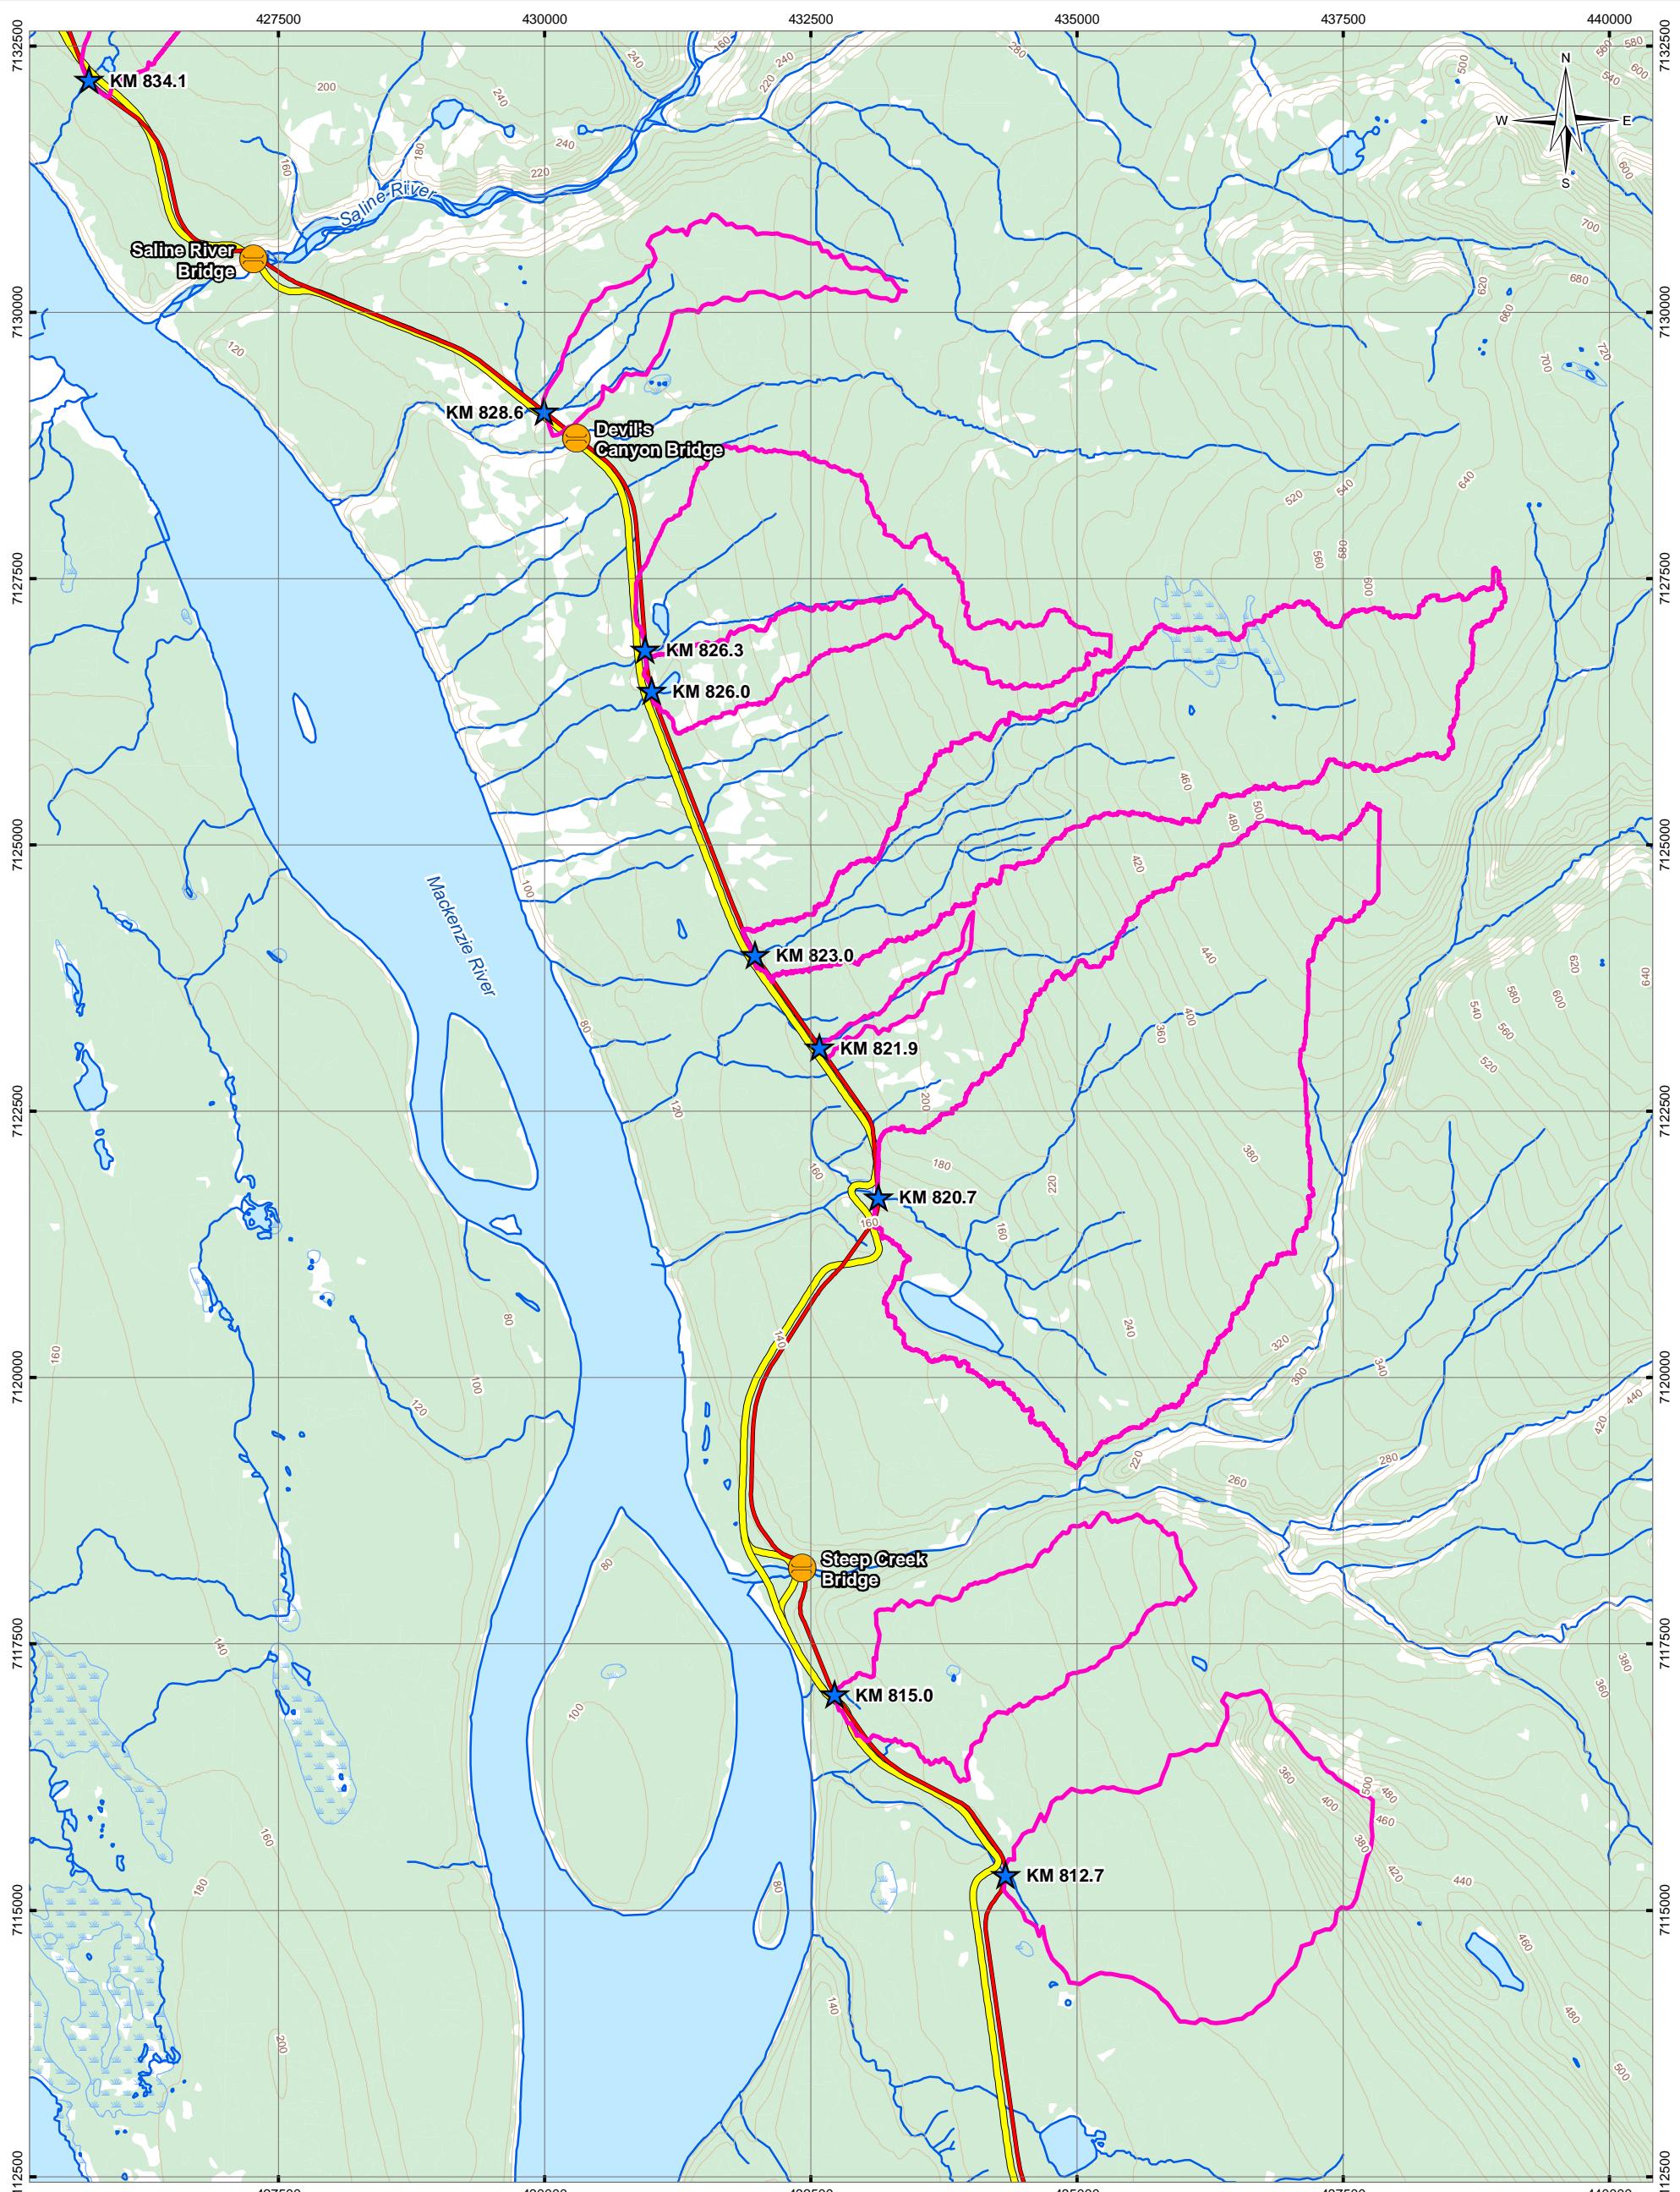**LEGEND**

- Drainage Basin
- Existing Bridge
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area

NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar


STATUS
 ISSUED FOR USE

**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

**Sahtu South Segment
Minor Watercourse Drainage Basins**

| PROJECTION | DATUM | CLIENT |
|--------------------------------------|-------------------------|---|
| UTM Zone 10 | NAD83 |  Northwest Territories |
| Scale: 1:60,000 | | |
| 1 | 0.5 | 1 |
| Kilometres | | |
| FILE NO. | | |
| WTRI03067-01_FigC_DrainageBasins.mxd | DWN SL CKD APVD MAN REV | 0 |
| OFFICE | DATE | PROJECT NO. |
| Tt-VANC | May 25, 2022 | ENG.WTRI03067-01 |

Figure C-2

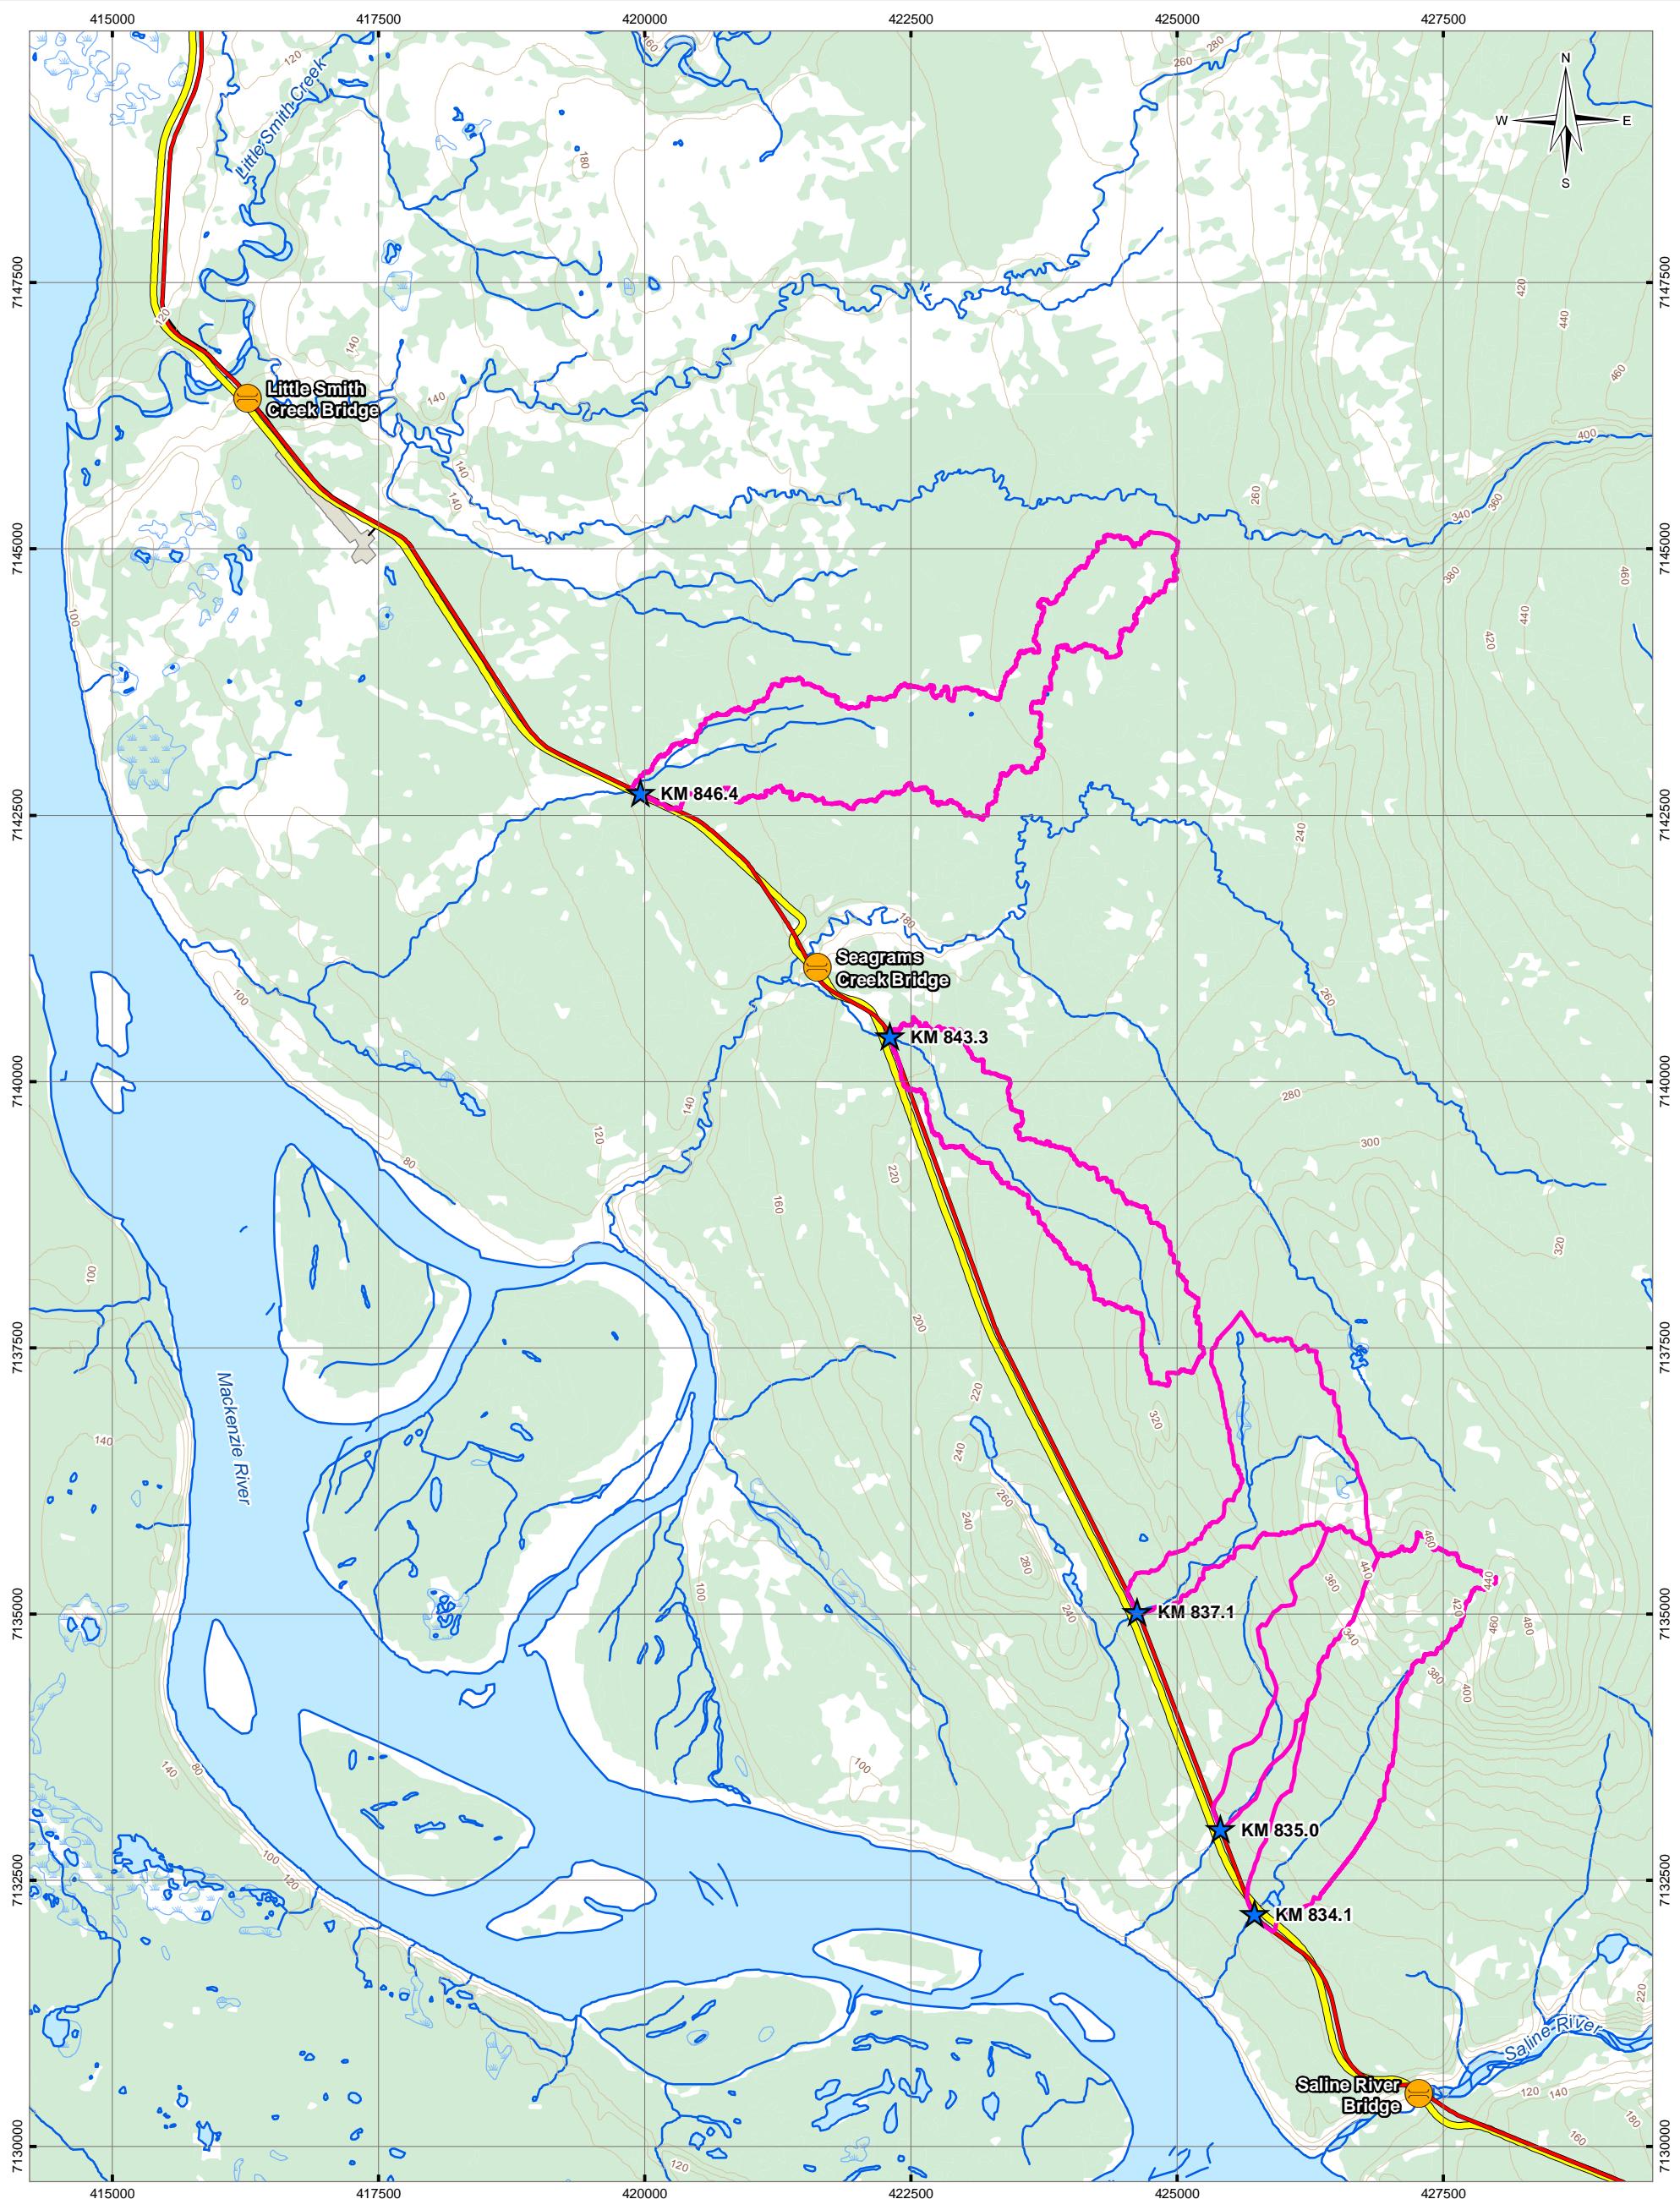**LEGEND**


- ♡ Drainage Basin
- Existing Bridge
- ★ Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road
- Runway


NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar

STATUS
 ISSUED FOR USE

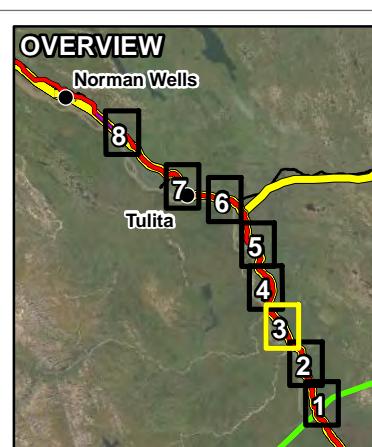**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

| PROJECTION | | DATUM | | CLIENT |
|--------------------------------------|-------|------------------|--------------|--------|
| UTM Zone 10 | NAD83 | Scale: 1:60,000 | 1 Kilometres | |
| 1 0.5 0 | | 1 | | |
| FILE NO. | | PROJECT NO. | | |
| WTRI03067-01_FigC_DrainageBasins.mxd | | ENG.WTRI03067-01 | | |
| OFFICE | | DWN | CKD | APVD |
| Tt-VANC | | SL | BB | MAN |
| DATE | | REV | 0 | |
| May 25, 2022 | | | | |

Figure C-3

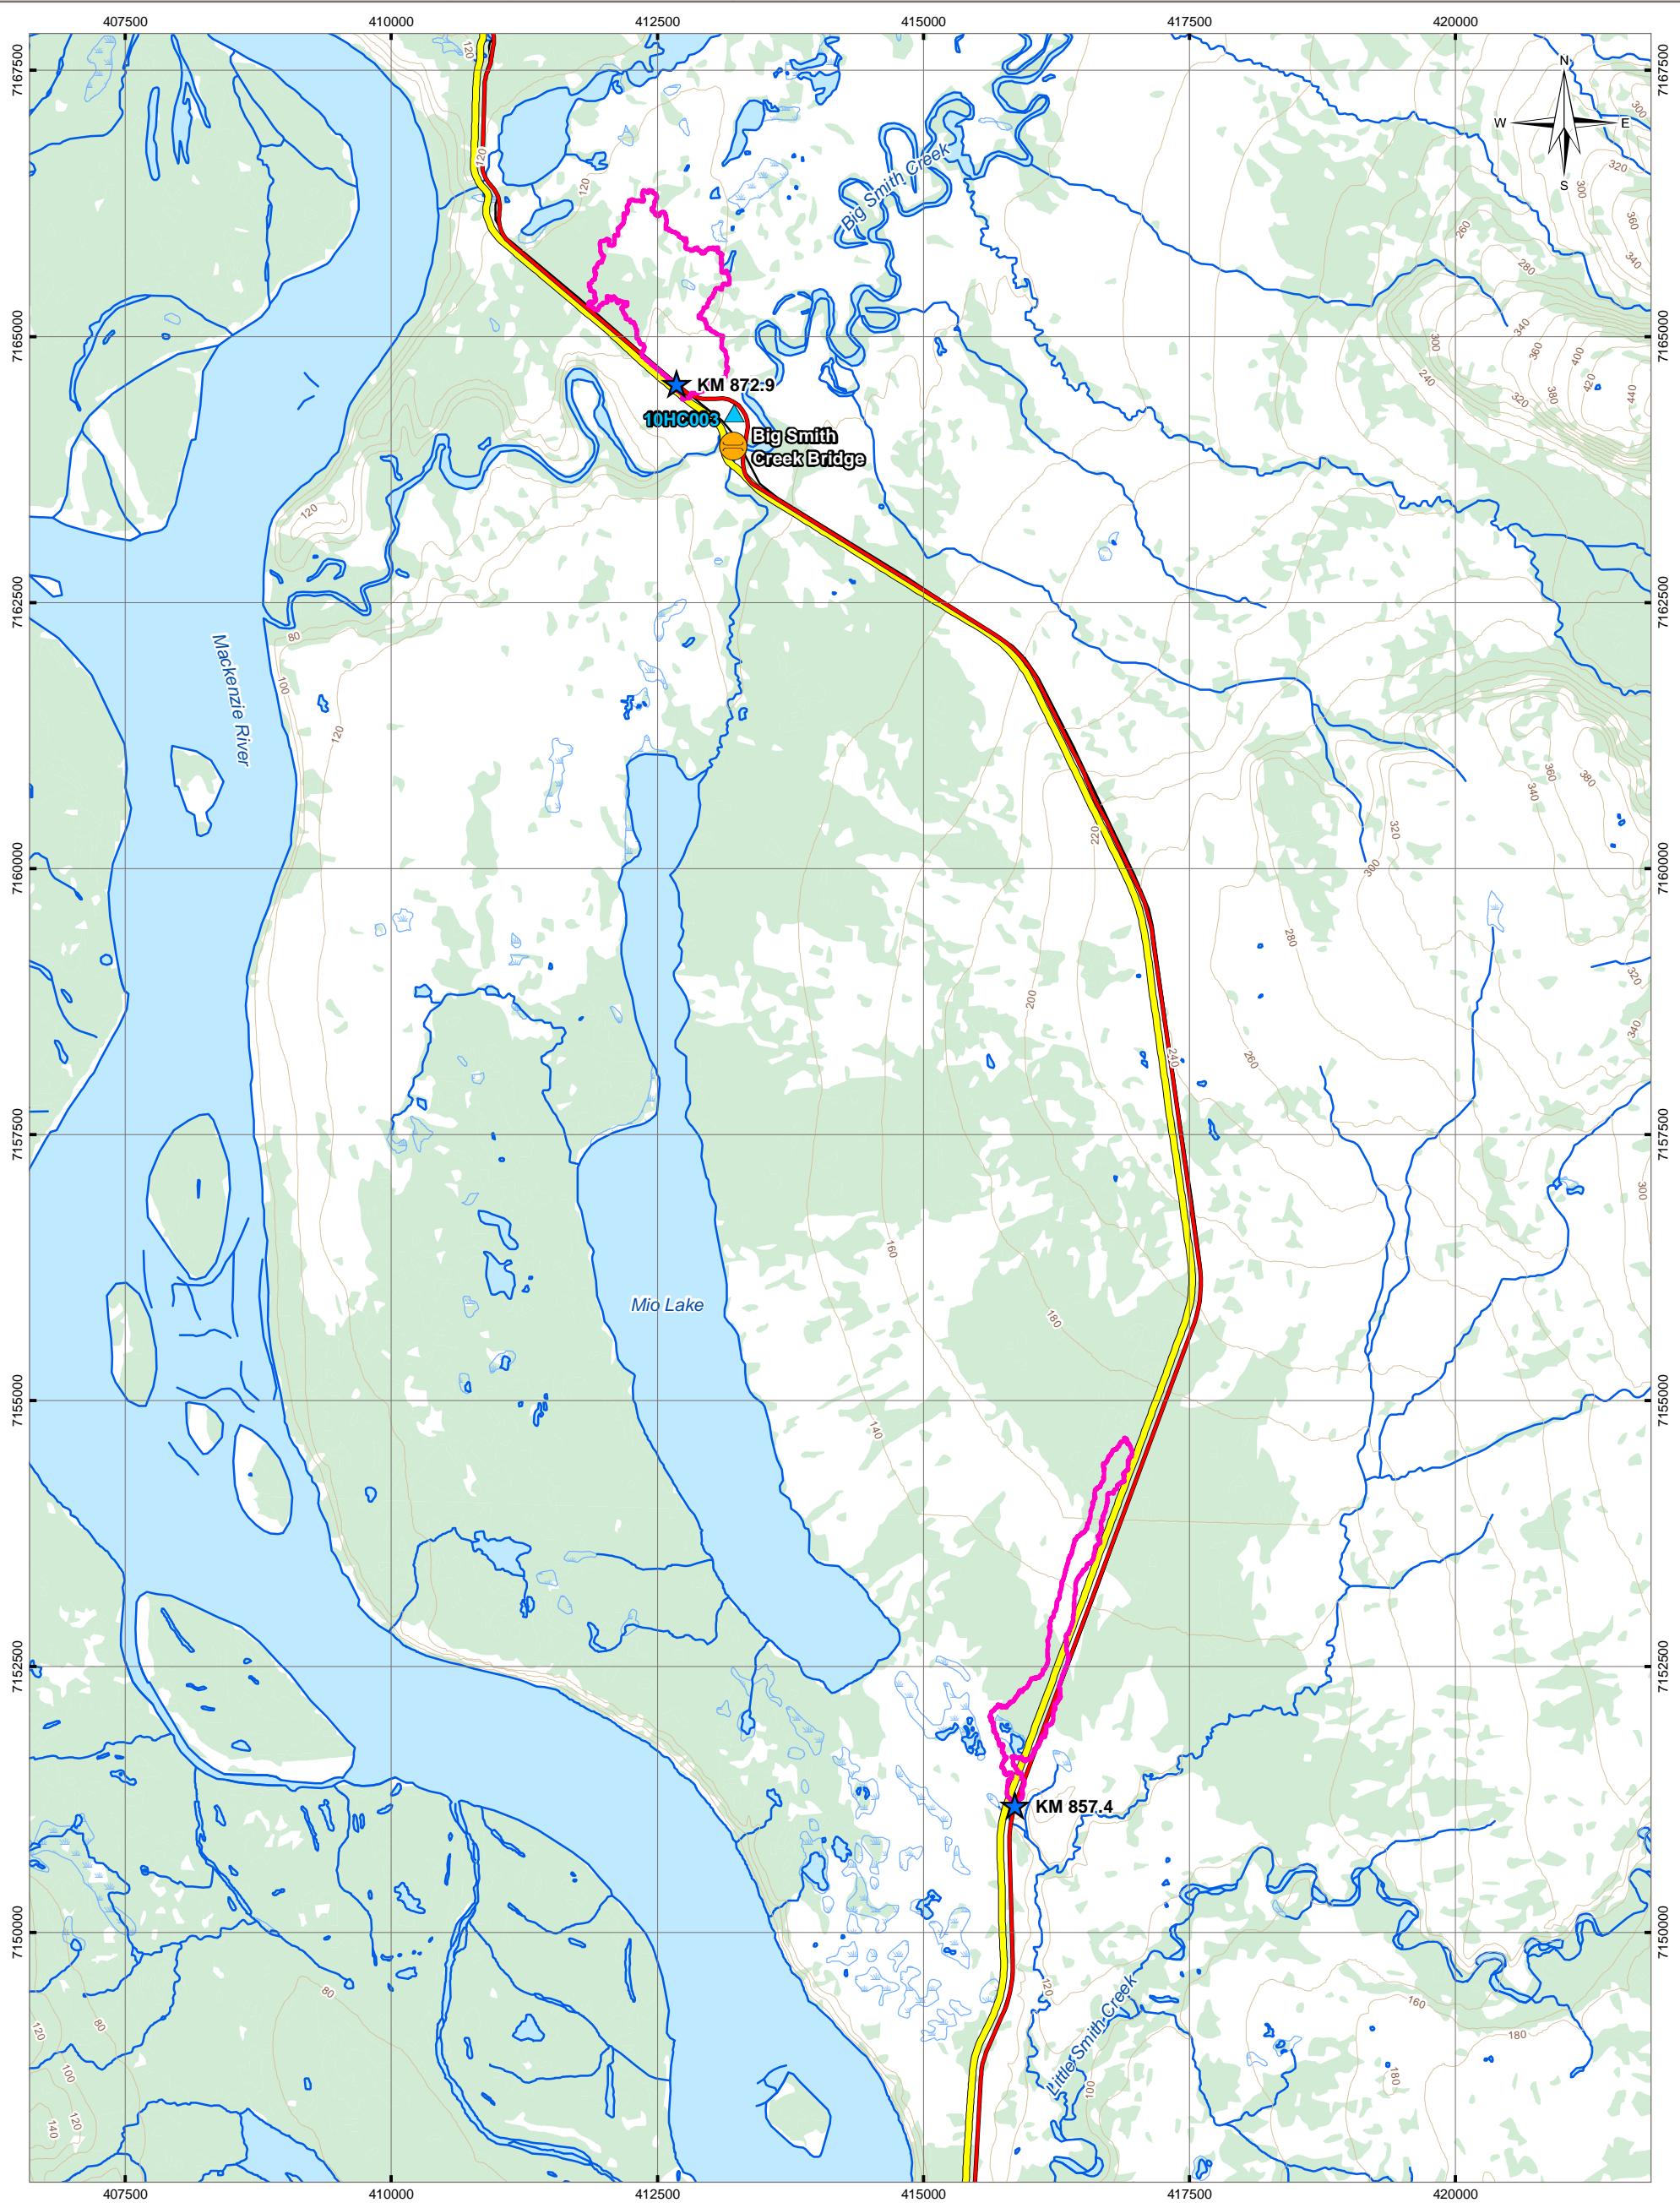**LEGEND**


- Drainage Basin
- Existing Bridge
- Minor Watercourse Crossing
- Water Survey of Canada Stream Gauge Station
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road

NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar


STATUS
ISSUED FOR USE

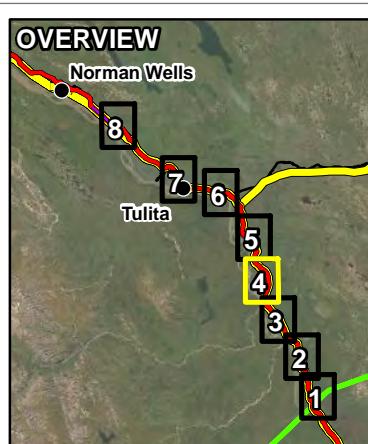**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

**Sahtu South Segment
Minor Watercourse Drainage Basins**

| PROJECTION | DATUM | CLIENT |
|--|---------------------------------------|---|
| UTM Zone 10 | NAD83 |  Northwest Territories |
| Scale: 1:60,000 | | |
| 1 | 0.5 | 1 |
| Kilometres | | |
| FILE NO. WTRI03067-01_FigC_DrainageBasins.mxd | | |
| OFFICE | DWN SL CKD BB APVD MAN | CLIENT |
| Tt-VANC | 0 |  TETRA TECH |
| DATE | REV | PROJECT NO. |
| May 25, 2022 | 0 | ENG.WTRI03067-01 |

Figure C-4

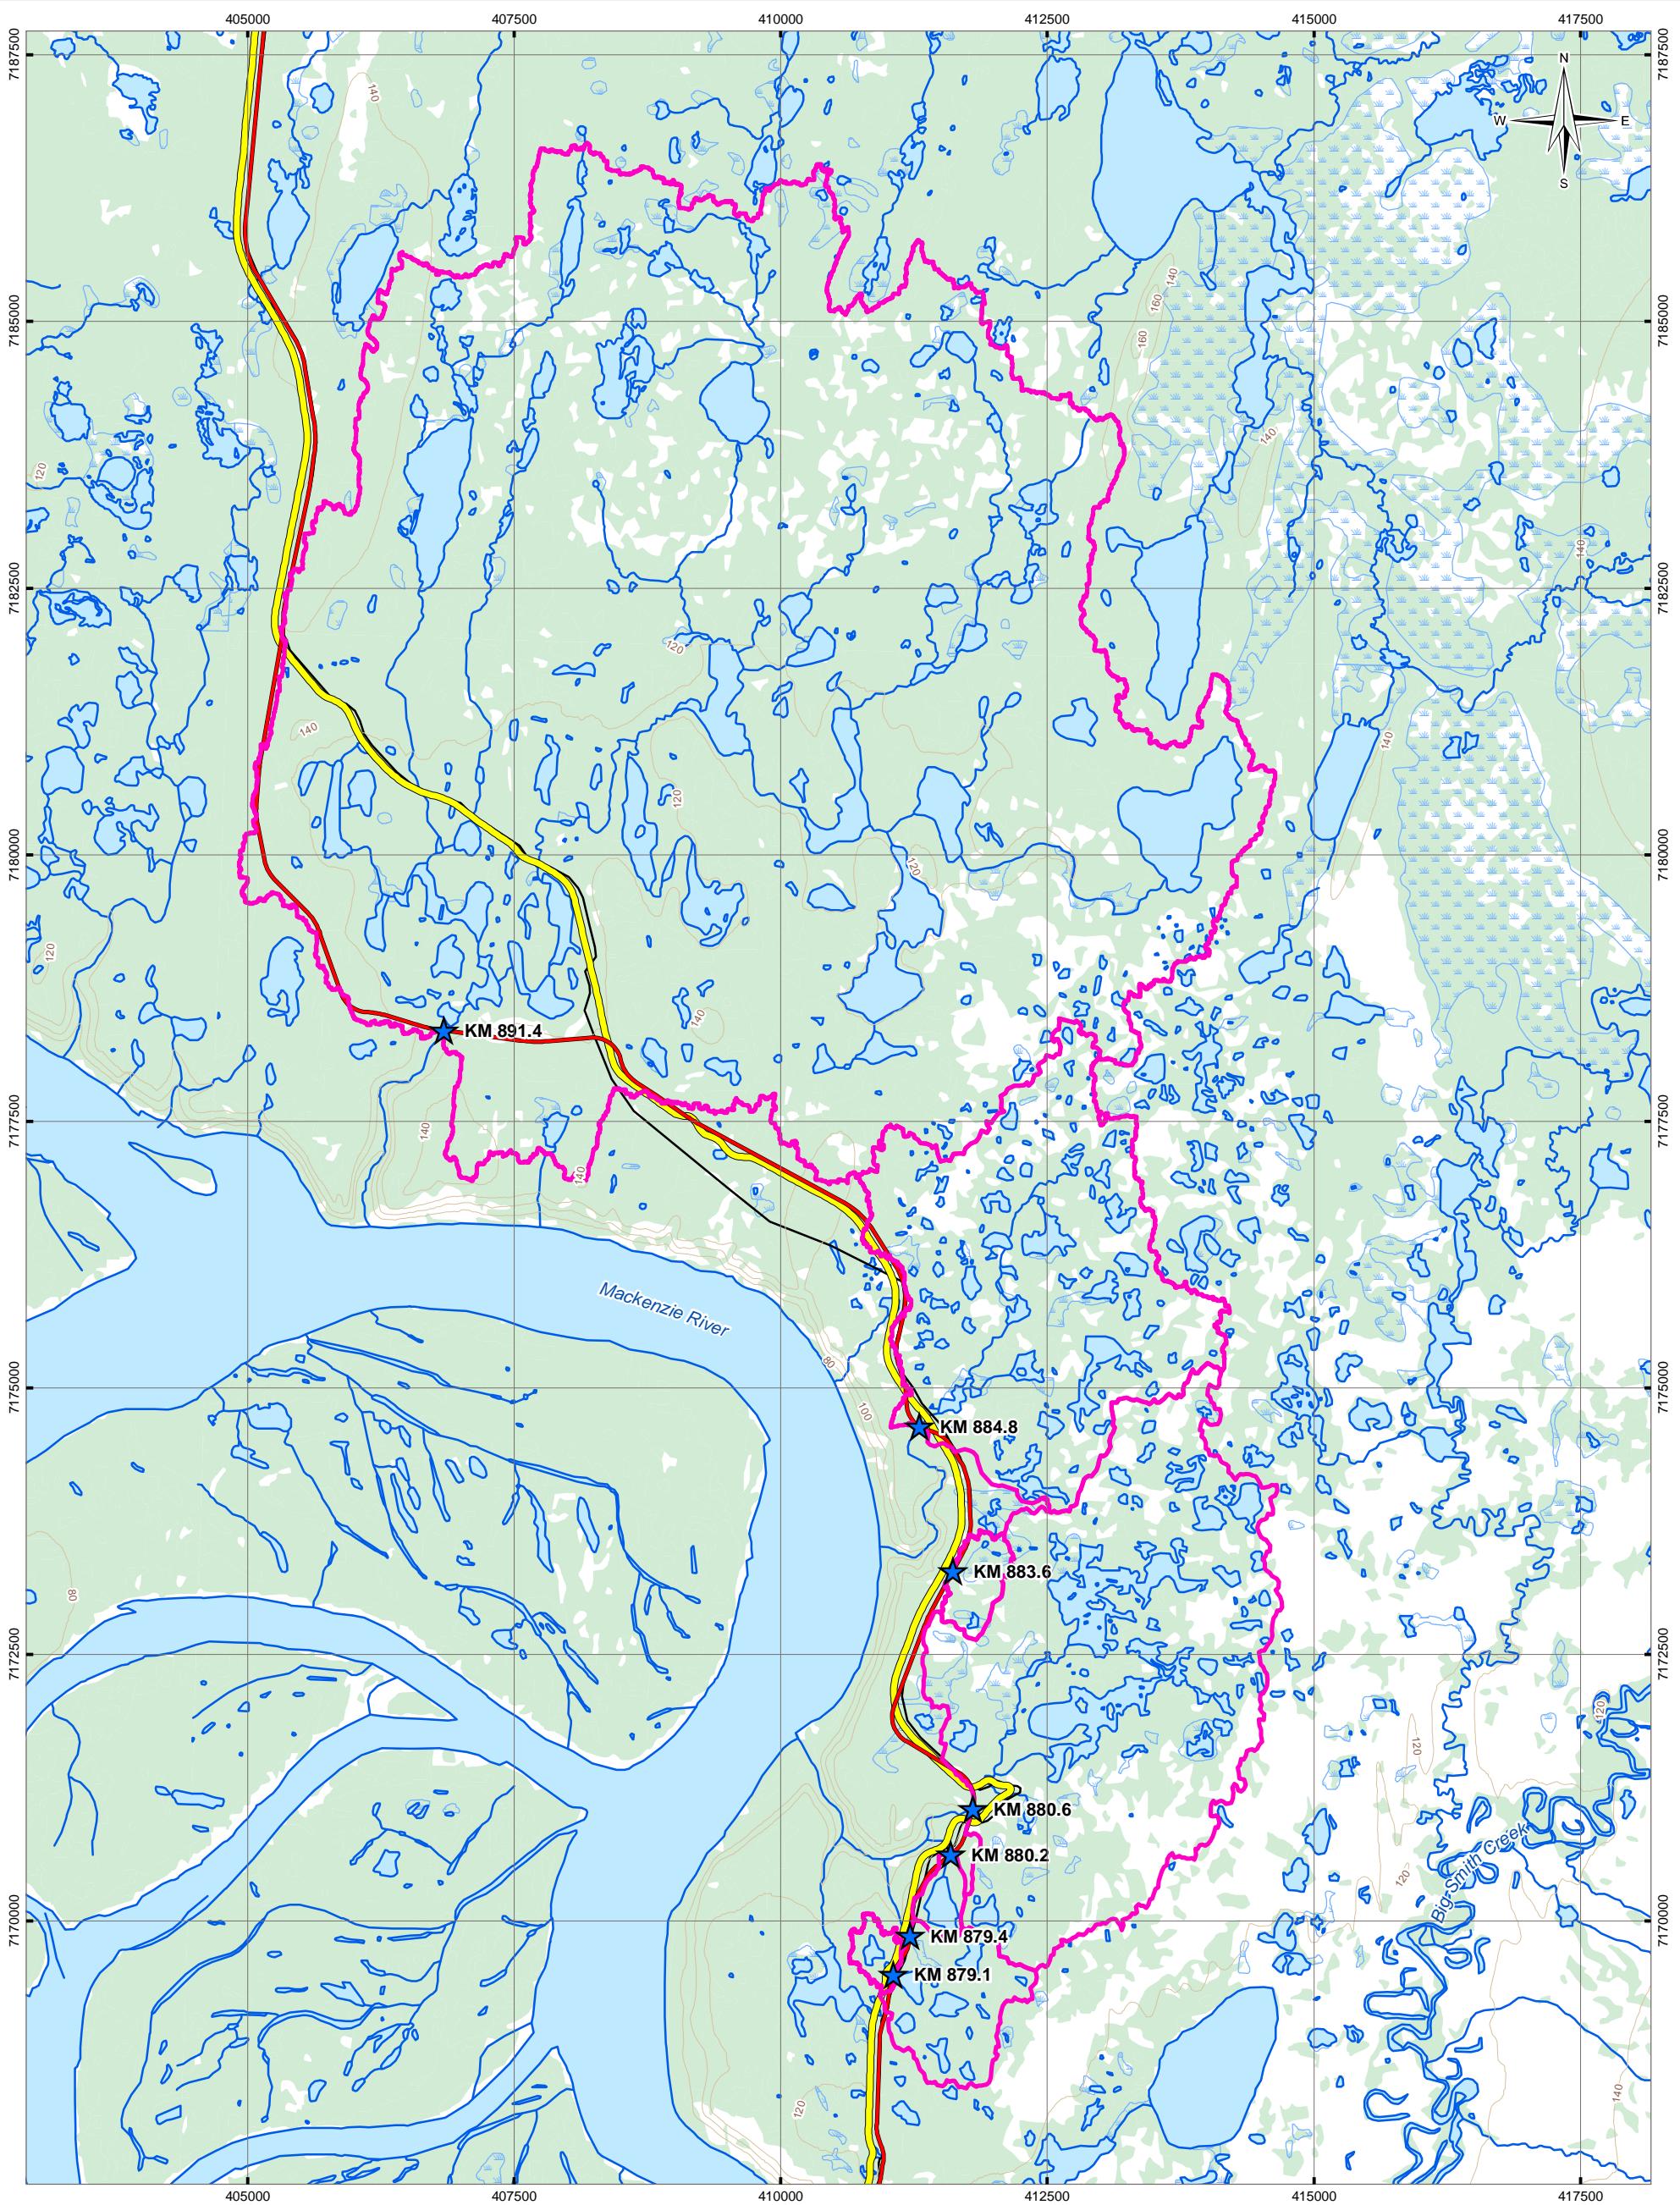**LEGEND**

- Drainage Basin
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road

NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar


STATUS
 ISSUED FOR USE

**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

**Sahtu South Segment
Minor Watercourse Drainage Basins**

| PROJECTION | DATUM | CLIENT |
|---|---|---|
| UTM Zone 10 | NAD83 |  Northwest Territories |
| Scale: 1:60,000 | | |
| 1 | 0.5 | 1 |
| | Kilometres | |
| FILE NO. WTRI03067-01_FigC_DrainageBasins.mxd | | |
| OFFICE | DWN SL CKD BB APVD MAN REV 0 |  TETRA TECH |
| DATE | PROJECT NO. | |
| May 25, 2022 | ENG.WTRI03067-01 | |

Figure C-5

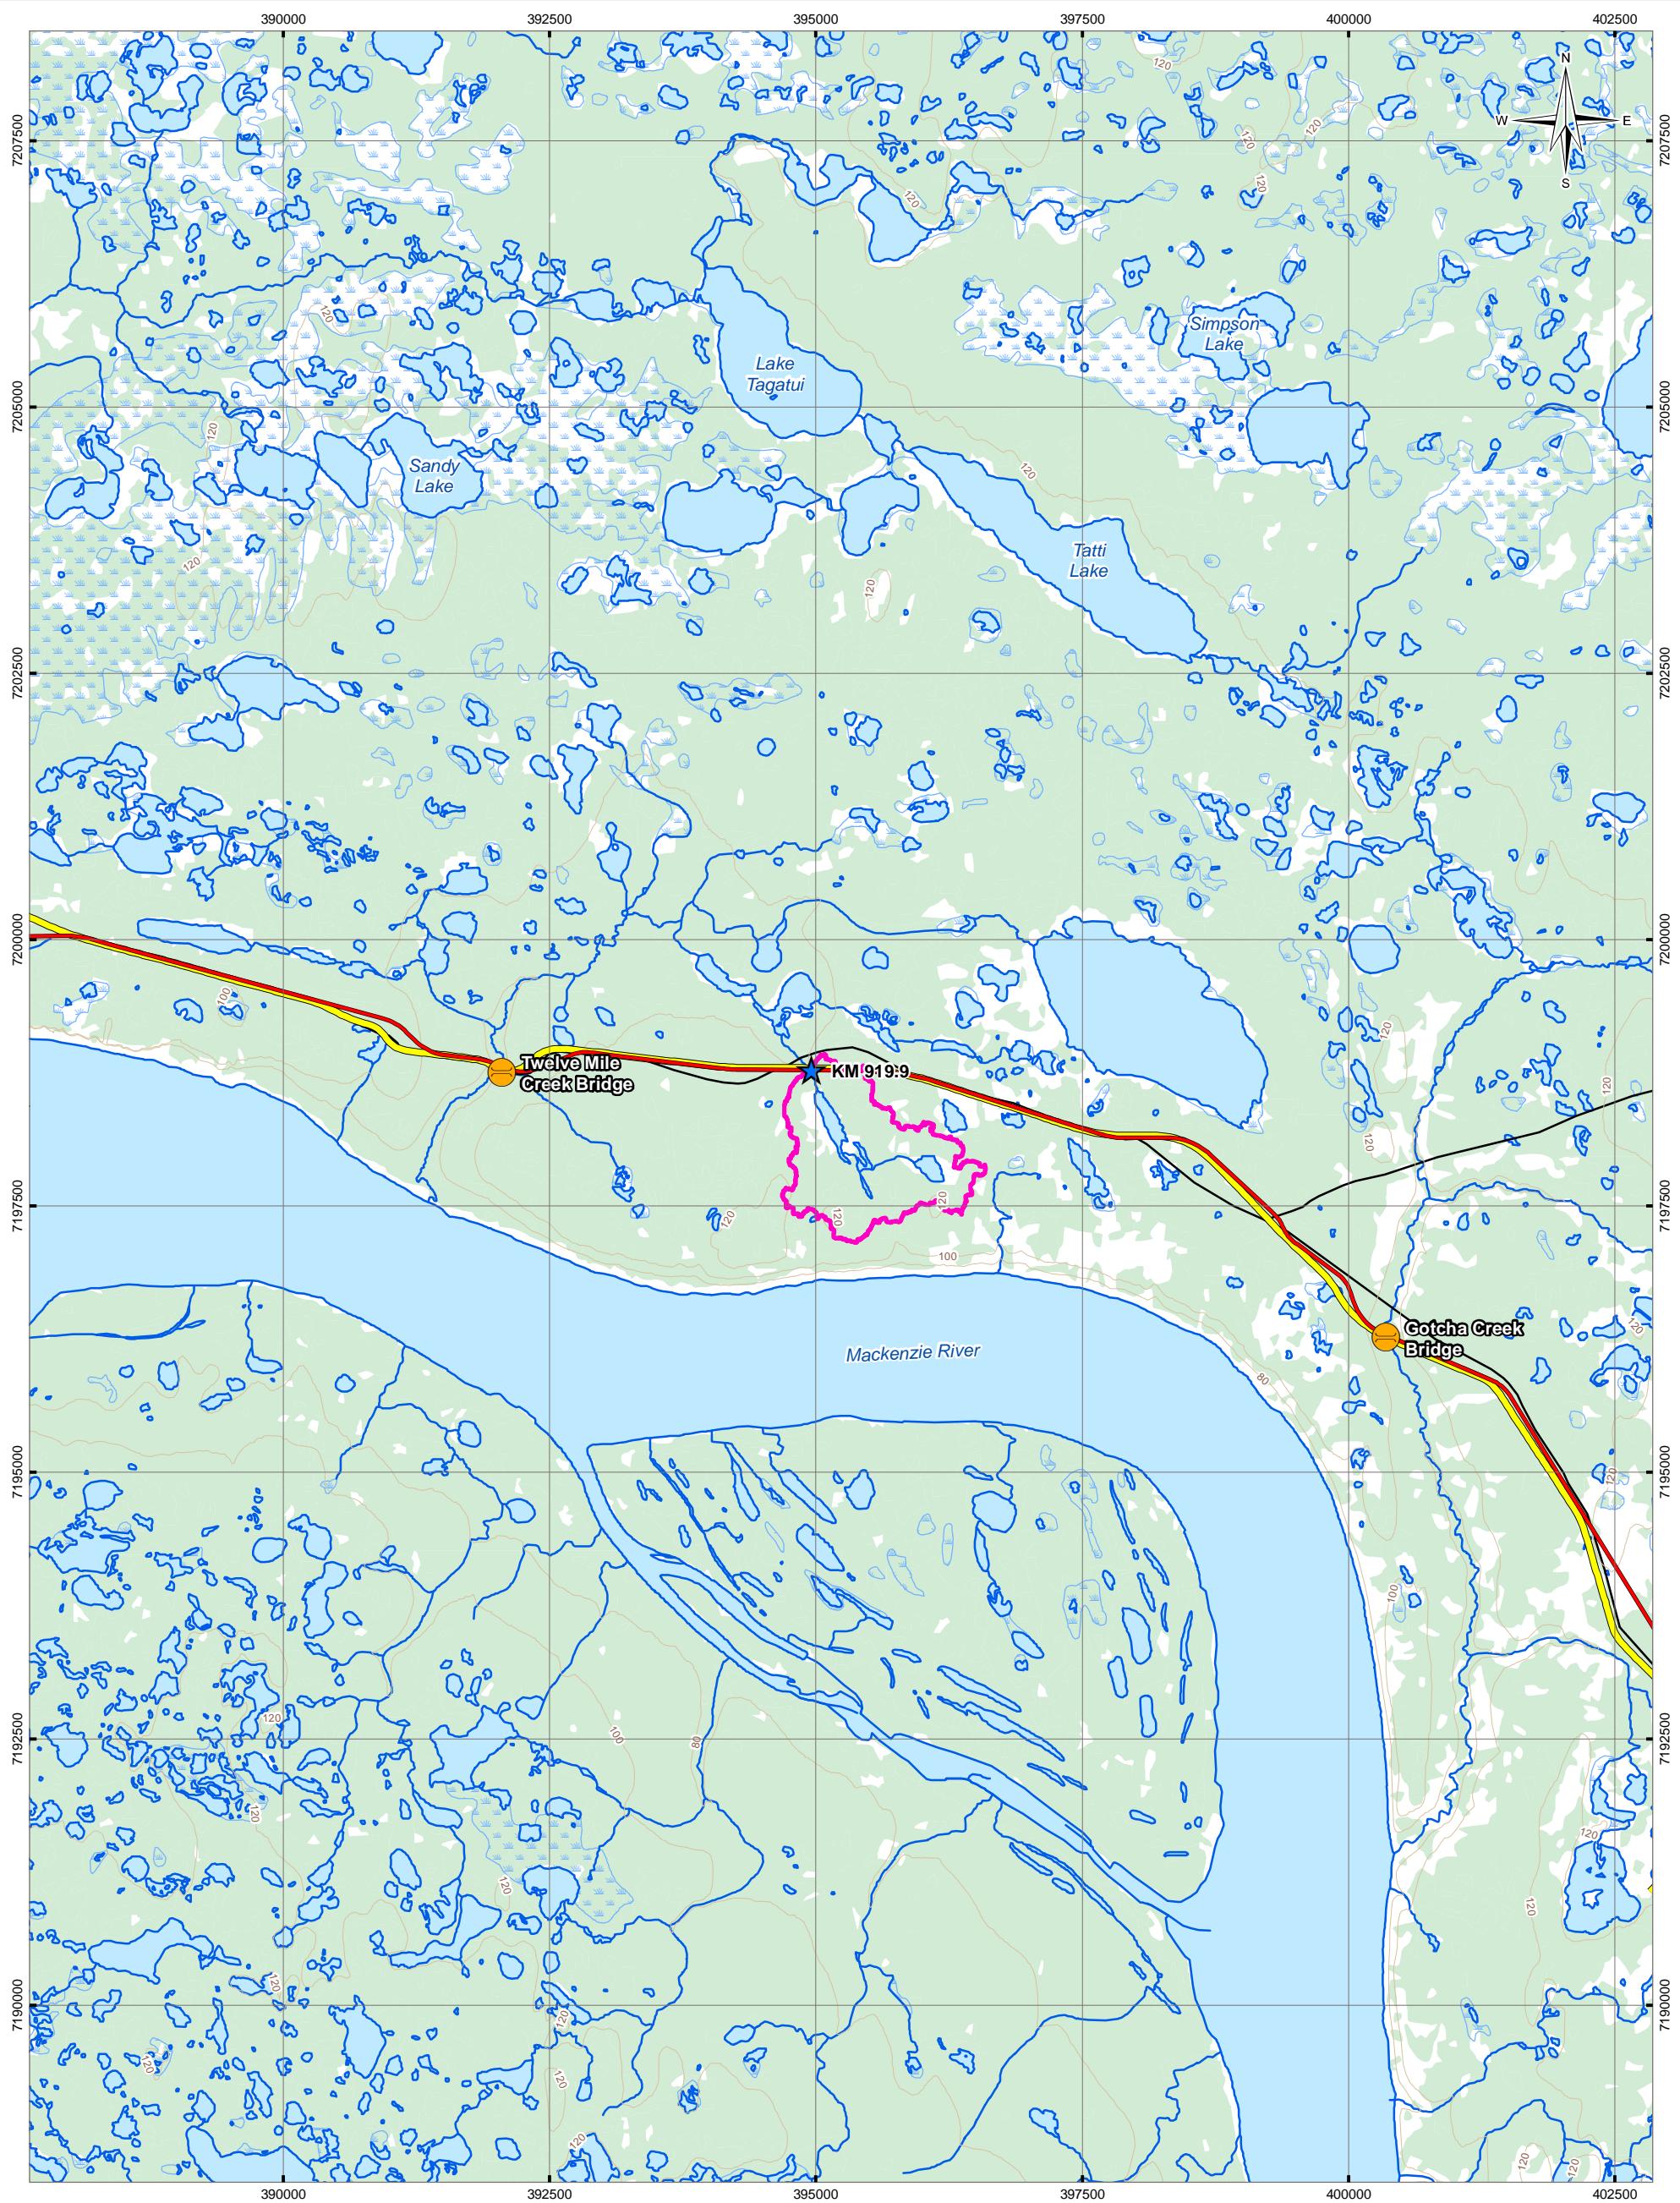**LEGEND**

- S Drainage Basin
- B Existing Bridge
- ★ Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road

NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source: Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar

STATUS
 ISSUED FOR USE



| MACKENZIE VALLEY HIGHWAY 2021 HYDROTECHNICAL ASSESSMENTS | | | | | |
|---|------------------|---|------|-----|-----|
| Sahtu South Segment Minor Watercourse Drainage Basins | | | | | |
| PROJECTION | DATUM | CLIENT | | | |
| UTM Zone 10 | NAD83 |  | | | |
| Scale: 1:60,000 | | | 1 | 0.5 | 0 |
| | | | | | |
| Kilometres | | | | | |
| FILE NO. | DWN | CKD | APVD | MAN | REV |
| WTRI03067-01_FigC_DrainageBasins.mxd | SL | BB | | 0 | |
| OFFICE | | | | | |
| Tt-VANC | | | | | |
| DATE | PROJECT NO. | | | | |
| May 25, 2022 | ENG.WTRI03067-01 | | | | |

Figure C-6

**LEGEND**


- Drainage Basin
- Existing Bridge
- Minor Watercourse Crossing
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road
- Runway
- Populated Place


NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar

STATUS
 ISSUED FOR USE

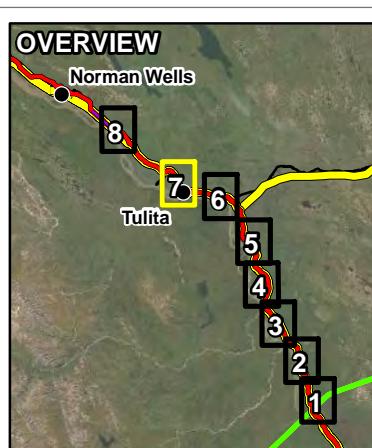**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

| PROJECTION UTM Zone 10 | | DATUM NAD83 | CLIENT Northwest Territories |
|---------------------------|--------------------------------------|----------------|---------------------------------|
| Scale: 1:60,000 | | | TETRA TECH |
| 1 | 0.5 | 0 | |
| Kilometres | | | |
| FILE NO. | WTRI03067-01_FigC_DrainageBasins.mxd | | |
| OFFICE | DWN SL | CKD BB | APVD MAN |
| DATE | May 25, 2022 | | |
| | PROJECT NO. ENG.WTRI03067-01 | | |

Figure C-7

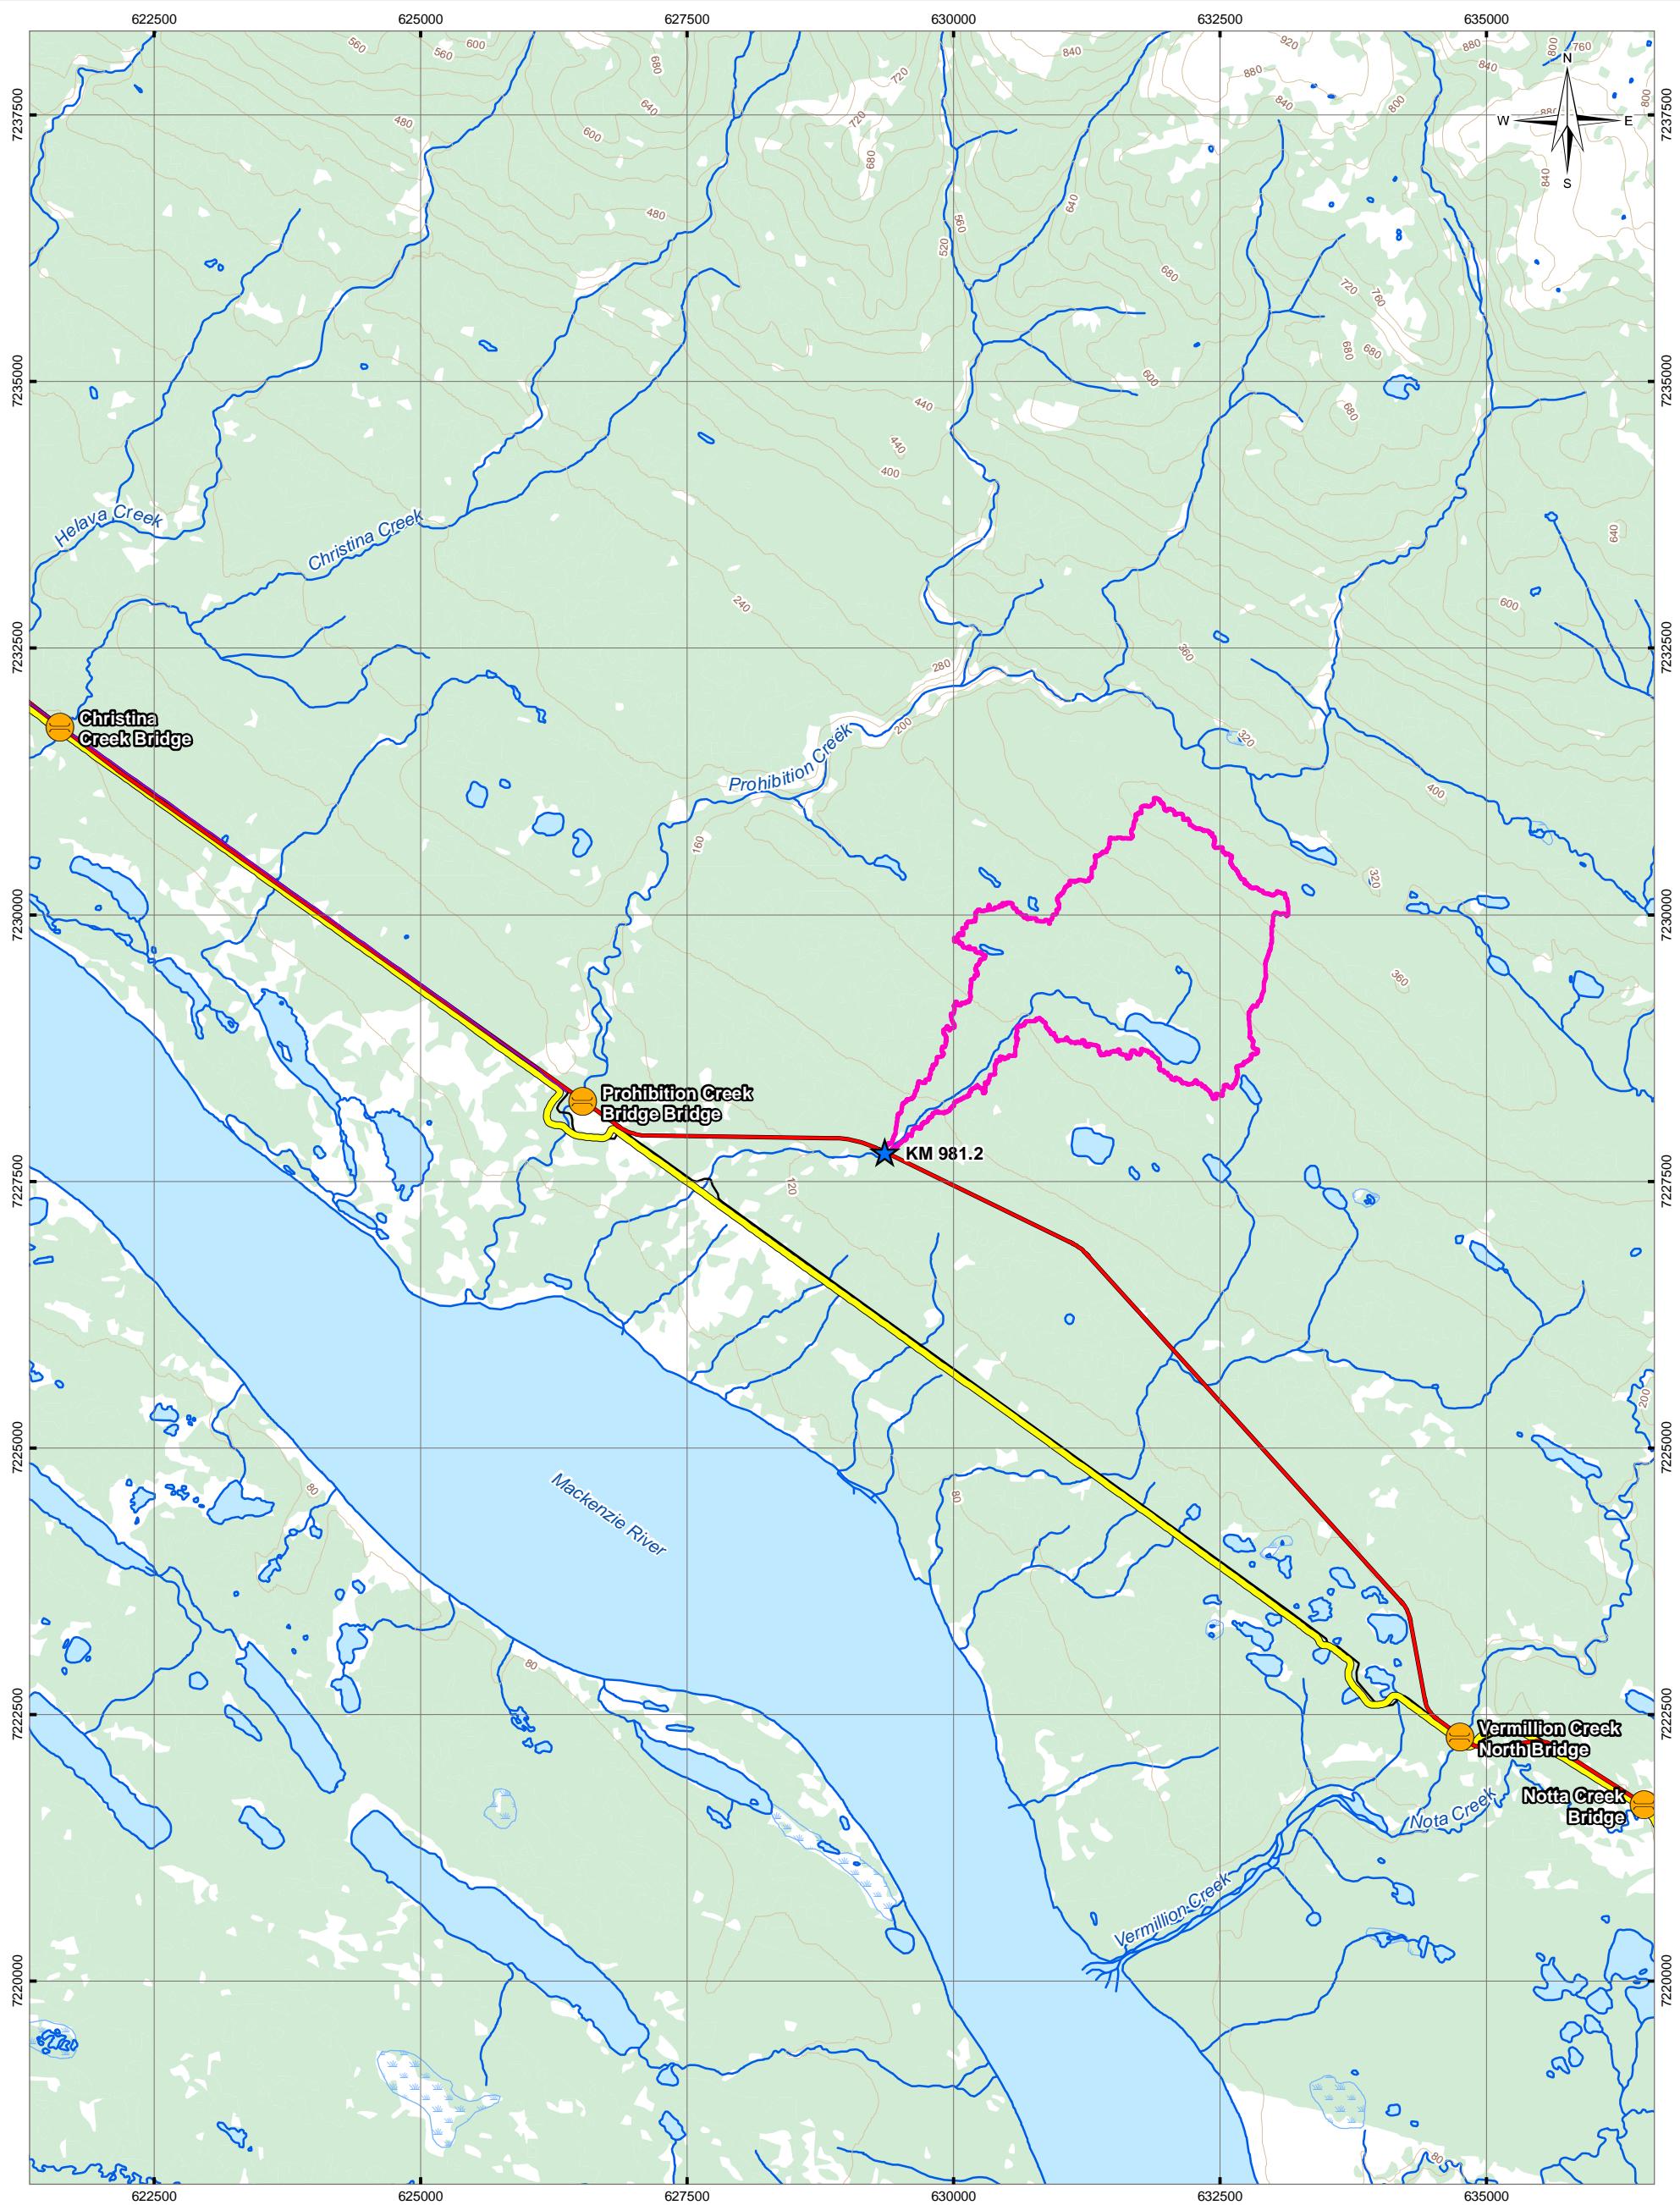**LEGEND**


- Drainage Basin
- Existing Bridge
- Minor Watercourse Crossing
- Prohibition Creek Access Road
- Mackenzie Valley Highway Project
- Mackenzie Valley Winter Road
- Region Boundary

Base Data

- Contour (10 or 20 m)
- Watercourse
- Waterbody
- Wetland
- Wooded Area
- Other Road

NOTES
 Kilometre Markers (KMs) based on All-Season Road KMs from the Tulita District Project Description Report (October 2011)
 Base data source:
 Natural Resources Canada CanVec 1:50,000 scale
 ESRI Data Maps
 Imagery provided by ESRI; Maxar

STATUS
 ISSUED FOR USE

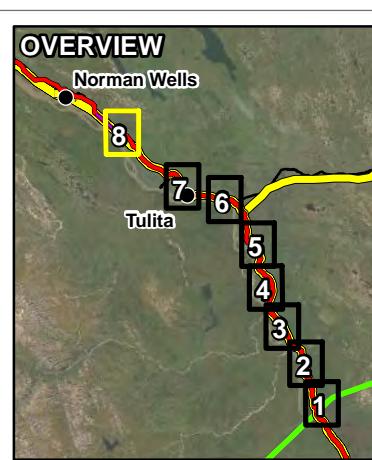**MACKENZIE VALLEY HIGHWAY
2021 HYDROTECHNICAL ASSESSMENTS**

| PROJECTION | | DATUM | | CLIENT |
|------------|--------------------------------------|-----------------|------------------|----------|
| UTM Zone 9 | NAD83 | Scale: 1:60,000 | 1 Kilometres | |
| 1 | 0.5 | 0 | 1 | |
| | | | | |
| FILE NO. | WTRI03067-01_FigC_DrainageBasins.mxd | | | |
| OFFICE | DWN SL | CKD BB | APVD MAN | REV 0 |
| DATE | May 25, 2022 | PROJECT NO. | ENG.WTRI03067-01 | |

Figure C-8